

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-08367
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. E5898 - 1
7. Lease Name or Unit Agreement Name Unit A Bell Lake SWD
8. Well Number 7
9. OGRID Number
10. Pool name or Wildcat Pennsylvanian

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other Water Disposal

2. Name of Operator
Kaiser-Francis Oil Company

3. Address of Operator
11722 West Hwy. 80 East Odessa, TX 79765

4. Well Location
Unit Letter A: 660 feet from the North line and 660 feet from the East line
Section 1 Township 24 S Range 33 E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
GL 3606'

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Renew Temporary Abandonment ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

11/2/2005:

MIT chart attached. Well is temporarily abandoned.

Test was witnessed by Kaiser-Francis representative, Jerry Stamps. Chaparral Service, Inc. performed the MIT.

This Approval of Temporary
Abandonment Expires 11/2/10

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE David Rodawalt TITLE Superintendent DATE 11/5/05


Type or print name David Rodawalt E-mail address: davidr@kfoc.net Telephone No. 432-563-2992

For State Use Only

APPROVED BY: Harry W. Wink TITLE REPRESENTATIVE II/STAFF MANAGER DATE _____
Conditions of Approval (if any) OC FIELD REPRESENTATIVE

NOV 14 2005

WELLBORE DIAGRAM - 12/11/04

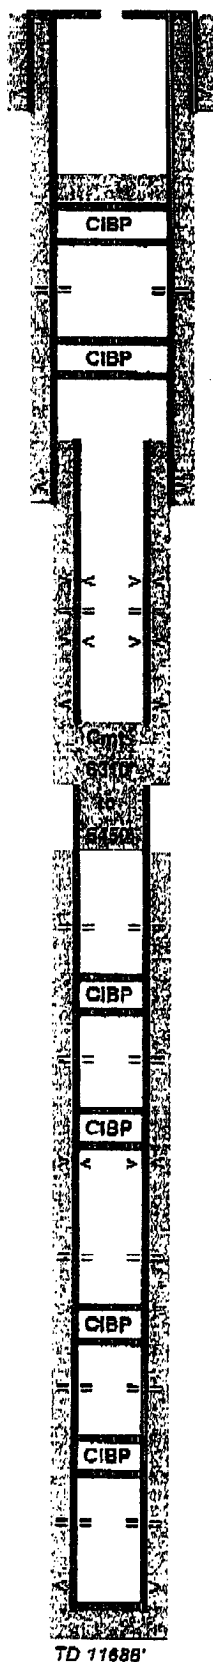

BELL LAKE #7

1-24S-33E

LEA CO., NM.

13 3/8"
817' w/650 sxs79' cmt on top
CIBP 5090'

5198'-5355' O/A

CIBP 5800'

TOL 5902'

8 5/8" 36# J55
6000' w/8102 sxs

8073'-74' Sqz'd

8077'-83' O/A

8084'-85' Sqz'd

5 1/2" 17# 6310'
w/110 sxs

CO Csg 6385'

TOC 6450'

8872'-8812' O/A

CIBP 8965'

8830'-40' C/A

CIBP 8965'

DV Tool 8984'
w/1380 cu ft

9114'-11180' O/A

CIBP 11510'

11540'-44' O/A

CIBP 11580'

11600'-30' O/A

5 1/2" 17/20/23#

11,688'
w/675 cu ft

SPUD: 4/7/61 TD: 11,688 KF: 3625'

COMPLETION:

PF: WOLFCAMP: 11600'-08'; 616'-30' (2SPF)

Acid w/5000 gal 15% NE - Swab dry

CIBP at 11580' w/1 sx cmt on top. PBTB 11,572'

PF: 11540'-54'

Acid w/5000 gal 15% NE - Swab dry

CIBP at 11,510'

PF: 11145-80; 11098-112; 10338-370; 10234-80; 9632-72; 9506-80; 9390-9405;

9372-80; 9167-74; 9114-60; 8880-76; 88700-55; 8772-82 (2sp)

Straddle 11098-11180: Acid w/7000 g 15% NE

Straddle 10234-10370: Acid w/10000 g 15% NE

Straddle 9506-9672: Acid w/12000 g 15% NE

Straddle 9372-405: Acid w/6000 g 15% NE

Straddle 9114-74: Acid w/7000 g 15% NE

CIBP at 8965' w/1 sx cmt

Straddle 8772-8876: Acid w/100000 g 15%, 100000# sd. CO. POP. Sqz'd 274 sxs

PF: 8830-40 - Acid frac w/10000 g 15% gel Acid + 10000# sd - CIBP 8820'

PF: 8772-85 - Acid frac w/15000 g 15% gel acid + 15000# sd

CUT OFF CASING at 6385'. Pmp 60 sx plug 6310'-6450'. RIH w/5 1/2" 17# Liner set

5902'-6310' w/110 sxs. PF: 6073'-74' & 6084'. Sqz w/100 sxs. DO.

PF: 6077-83'. Acid w/500 gal. Communicated. Set CIBP at 5300'.

PF: 5198-5206' - Acid w/250 g. Set 30 sx plug 5106'-5210' and 10 sxs at surf
WELL P&A'd09/88: WO: CONVERT TO WI

Clean out to 5850'. Set CIBP at 5800' w/2 sxs cmt on top.

PF: 5201, 3, 10, 19, 41, 46, 60, 71, 78, 80, 6310, 26, 27, 30, 55 (1sp)

GIH w/Guiberson A-F pkr on 2 7/8" IPC tbg. Set pkr at 5167'

Acid w/3000 g 15% HCL + BS

08/79: Pull Guiberson Pkr. Rerun AD1 on 168 jts of tubing. Fix leaks. PO WI

03/86: WO: TEMPORARILY ABANDON WI WELL.

Set CIBP at 5090'. Spot 79' cmt on top. Load w/9.6 brine w/Adomall. Tat 816#

NOTE: There was a bridge at 6134 during this workover

MIT Tests: 01/91 - 03/98 - 01/04

