

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-03791
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-7766
7. Lease Name or Unit Agreement Name: State "R"
8. Well No. 5
9. Pool name or Wildcat Lovington-ABO

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Texaco Exploration & Production, Inc.

3. Address of Operator
15 Smith Rd. Midland, Texas 79706

4. Well Location
Unit Letter N : 330 feet from the South line and 2310 feet from the West line
Section 36 Township 16S Range 36E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- Set 5 1/2" CIBP @ 8100, spot 25 sxs. plug 8100 to 7900 (ABO) Tag @ 7860
- Displace hole w/MLF, 9.5# Brine w.25# gel P/BBL
- Spot 25 sxs. plug 6100 to 5100 (Glorieta)
- Spot 25 sxs. plug 4600 to 4400 (Queen) Tag @ 4329
- Cut 5 1/2" csg. @ 3400 unable to pull sqz. cut w/100 sxs. 3400 to 3000 (8 5/8 shoe, Yates, B-Salt) Tag @ 2918
- Perf. @ 2400 sqz. w/50 sxs. 2400 to 2200 (T-Salt) Tag @ 2108
- Perf @ 300 sqz. w/ 150 sxs. 300 to surf. circ. Cmt. 5 1/2 x 13 3/8 (13 3/8 shoe)
- Install dry hole marker

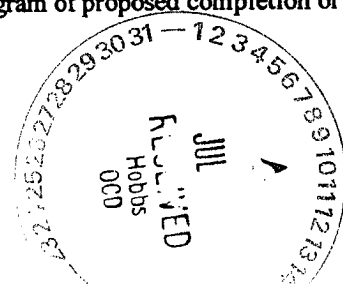

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE MANAGER DATE 3/6/02

Type or print name Jimmy BAGLEY Telephone No. 915 683-4996

(This space for State use)

APPROVED BY Harry W. Wink OC FIELD REPRESENTATIVE II/STAFF MANAGER
Conditions of approval, if any: DATE JUL 15 2003