

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-025-20936

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

E-9721

7. Lease Name or Unit Agreement Name:

NEW MEXICO "CR" STATE

8. Well No.

2

9. Pool name or Wildcat

LUSK; STRAWN

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

MARBOB ENERGY CORPORATION

3. Address of Operator

PO BOX 227, ARTESIA, NM 88211-0227

4. Well Location

Unit Letter P : 885 feet from the SOUTH line and 885 feet from the EAST line

Section 32 Township 19S Range 32E NMPM County DOY

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3532' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

MARBOB ENERGY CORPORATION PROPOSES TO PLUG & ABANDON THIS WELL AS FOLLOWS:

WILL NOTIFY OCD 24 HOURS BEFORE STARTING PLUGGING.

1. POOH W/ TURING

2. SET 4 1/2" CIBP @ 10600' (PERF @ 10661'-10693')

3. CUT & PULL 4 1/2" CASING FROM 9000'

4. SPOT 100' PLUG ACROSS CUT 50' IN & OUT, WOC, TAG

5. SPOT 100' PLUG @ 7330'

6. SPOT 100' PLUG @ 3950' ACROSS 8 5/8" SHOE @ 3900', WOC, TAG

7. SPOT 100' PLUG @ 2550'

8. SPOT 100' PLUG @ 2425' (B SALT @ 2375'), ~~WOC, TAG~~

9. SPOT 100' PLUG @ 1090' (B SALT @ 1040'), ~~WOC, TAG~~

10. SPOT 100' PLUG @ ~~750'~~ 815' TAG

11. ~~SPOT 100' PLUG @ 60' TO SURFACE~~ 12. CUT OFF WELL HEAD, INSTALL DRY HOLE MARKER

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Diana J. Cannon TITLE PRODUCTION ANALYST DATE 7/16/03

Type or print name DIANA J. CANNON

(This space for State use)

APPROVED BY Larry W. Winkler TITLE FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of approval, if any: DATE

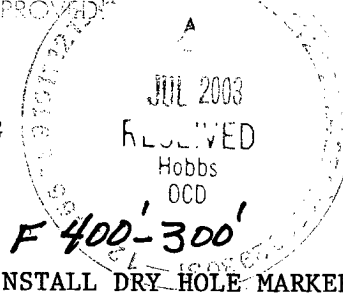

Telephone No. (505) 748-3303

Well: NM CMC JT. C

Zerv!

Location: 885' E 885' S

P-32-195-32e


Loc NM

KB:

GL: 3522'

Casing Program:

Size	Wt.	Grade	Conn.	Depth
11 3/4	31.2	Spialweld		925'
8 5/8	24	J55		3900'
4 1/2	11.6	N80		11496'
2 7/8				

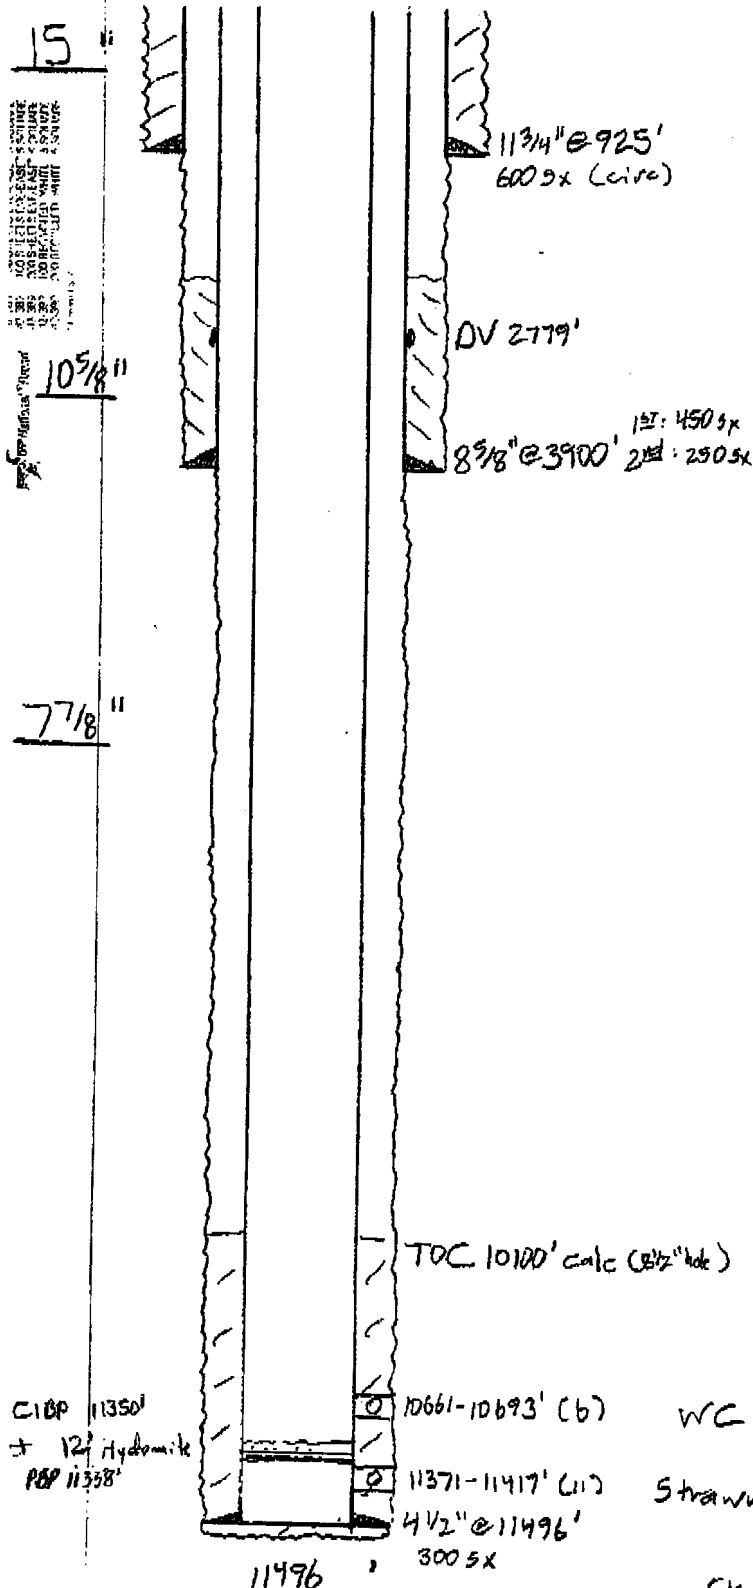

11/61: Perf Shewn 11371-11417' (11) Acidz 1000g. 15%
 Snab. Acidz 3000g. 15% + 500g. Kerdown +
 5000g. SRA-1. Snab. Acidz
 30,000g SEA-2 + 10,000g. slick wtr.

Hydramite plug 11338'

Perf WC 10661'-10693' (6) Acidz
 1000g. 15%. Snab. Acidz 1000g. 15%
 Snab dry.

2/98: (Previously CIBP 11350' + 12' hydramite)
 Snab 10,661-10,693'.

TOC 10100' calc (8 1/2" hole)

CIBP 11350'
 + 12' Hydramite
 PBP 11338'

10661-10693' (6)

WC

11371-11417' (11)

Shewn

4 1/2" @ 11496'

3005x

11496

- Sketch Not To Scale -

KBCollins / 20 Sept 02