# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OCD Hobbs

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an OCT O

Lease Serial No. NMLC029489B

abandoned wel	2 2016	6. If Indian, Allottee or Tribe Name			
SUBMIT IN TRIE	PLICATE - Other instruc	tions on reverse side EC	7. If Unit or	CA/Agreement, Name and/or No.	
Type of Well     ☐ Gas Well ☐ Other				e and No. SOUTH FEDERAL COM 4	
2. Name of Operator Contact: DAVID STEWART OXY USA INCORPORATED E-Mail: david_stewart@oxy.com				No. 41319-00-S1	
3a. Address P O BOX 4294 HOUSTON, TX 77210-4294  3b. Phone No. (include area code) Ph: 432-685-5717 Fx: 432-685-5742				d Pool, or Exploratory	
4. Location of Well (Footage, Sec., T.	11. County of	or Parish, and State			
Sec T18S R33E SWNW 1700FNL 330FWL - 32.779051 N Lat, 103.675096 W Lon			LEA CC	DUNTY, NM	
12. CHECK APPR	ROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE, REPORT, OR	OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION			× 1.	
Notice of Intent     □ Subsequent Report	☐ Acidize	□ Deepen	☐ Production (Start/Re	INT TO PA	
	☐ Alter Casing	□ Fracture Treat	□ Reclamation	P&A NR	
	Casing Repair	■ New Construction	□ Recomplete	P&A R	
☐ Final Abandonment Notice	☐ Change Plans	☑ Plug and Abandon	☐ Temporarily Abando		
	□ Convert to Injection	☐ Plug Back	■ Water Disposal		
13. Describe Proposed or Completed Ope If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab- determined that the site is ready for fit TD-11505' PBTD-9430' Perfs- 11-3/4" 47# csg @ 1570' w/ 12 8-5/8" 32# csg @ 2918' w/ 620	ally or recomplete horizontally, k will be performed or provide operations. If the operation resonandoment Notices shall be fill in all inspection.)  9485-10587' CIBP-9450'  130sx, 14-3/4" hole, TOC-	give subsurface locations and meas the Bond No. on file with BLM/BL sults in a multiple completion or rec ed only after all requirements, inclu	ured and true vertical depths of A. Required subsequent report completion in a new interval, a	of all pertinent markers and zones. ts shall be filed within 30 days Form 3160-4 shall be filed once	

SEE ATTACHED FOR CONDITIONS OF APPROVAL

	ė i				
14. I hereby certify that the foregoing is true and correct.					
Electronic Submission #349610 verified by the BLM Well Information System For OXY USA INCORPORATED, sent to the Hobbs					
Committed to AFMSS for processing by DEBORAH MCKINNEY on 09/01/2016 (16DLM0907SE)					
Name (Printed/Typed) DAVID STEWART	Title S	SR. REGULATORY ADVISOR			

Name (Printed/Typed) DAVID STEWART

Title SR. REGULATORY ADVISOR

Signature (Electronic Submission)

Date 08/31/2016

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By CHRISTOPHER WALLS \_\_\_\_\_\_ TitlePETRO

TitlePETROLEUM ENGINEER

Date 10/13/2016

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

1. RIH & tag cmt/CIBP @ 9430', M&P 25sx cmt to 9280'
2. M&P 25sx cmt @ 6980-6810' WOC-Tag
3. M&P 25sx cmt @ 5160-5010' WOC-Tag
4. M&P 25sx cmt @ 3500-3350' WOC-Tag
5. M&P 45sx cmt @ 3157-2820' WOC-Tag
6. M&P 25sx cmt @ 1620-1470' WOC-Tag

Office Hobbs

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

### Additional data for EC transaction #349610 that would not fit on the form

#### 32. Additional remarks, continued

7. M&P 35sx cmt @ 250' to Surface

10# MLF between plugs Above ground steel tanks will be utilized

This Intent to P&A was originally approved 12/27/14, EC Transaction 284541, Serial Number 810-16112.

OXY USA WTP LP - Proposed Corbin South Federal Com #4 API No. 30-025-41319

35sx @ 250'-Surface


25sx @ 1620-1470' WOC-Tag

45sx @ 3157-2820' WOC-Tag

25sx @ 6980-6810' WOC-Tag

25sx @ 5160-5010' WOC-Tag

25sx @ 9430-9280' 5/14-CIBP @ 9450' w/ 2sx

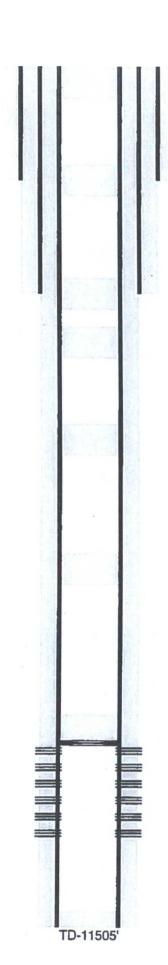

14-3/4" hole @ 1575' 11-3/4" csg @ 1570' w/ 1130sx-TOC-Surf-Circ


10-5/8" hole @ 2928' 8-5/8" csg @ 2918' w/ 620sx-TOC-Surf-Circ

Perfs @ 9485-10587'

7-7/8" hole @ 11505' 5-1/2" csg @ 11505' w/ 1300sx-TOC-Surf-Circ

PB-11414'

OXY USA WTP LP - Current Corbin South Federal Com #4 API No. 30-025-41319

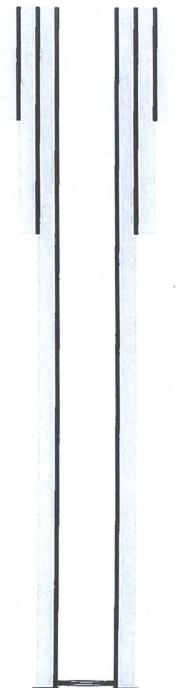

TD-11505'

14-3/4" hole @ 1575' 11-3/4" csg @ 1570' w/ 1130sx-TOC-Surf-Circ

10-5/8" hole @ 2928' 8-5/8" csg @ 2918' w/ 620sx-TOC-Surf-Circ

Perfs @ 9485-10587'

5/14-CIBP @ 9450' w/ 2sx

7-7/8" hole @ 11505' 5-1/2" csg @ 11505' w/ 1300sx-TOC-Surf-Circ

PB-11414'

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted