

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-00573 00576	✓
5. Indicate Type of Lease STATE ☒ FEE ☐	✓
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name Edward State	✓
8. Well Number 2	✓
9. OGRID Number 229137	✓
10. Pool name or Wildcat Maljamar : GB/SA	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐ **HOBBS OCD** ✓

2. Name of Operator
COG Operating, LLC

3. Address of Operator
600 W. Illinois, Midland, TX 79701

4. Well Location
Unit Letter **K** : **1720** feet from the **South** line and **2240** feet from the **West** line
Section **16** Township **17S** Range **32E** NMPM County **Lea** ✓

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4029'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	COMMENCE DRILLING OPN: ☐
PULL OR ALTER CASING ☐	CASING/CEMENT JOB ☐
DOWNHOLE COMMINGLE ☐	
OTHER: ☐	OTHER: ☐

INT TO P&A **INT**
P&A NR _____
P&A R _____

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- Set 5 1/2" CIBP @ 3680'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 3680-3580'.
- Perf & Sqz 55 sx cmt @ 2330-2180'. WOC & Tag (Yates)
- Perf & Sqz 50 sx cmt @ ~~1400-1000'~~ **850' WOC & TAG**
- Perf & Sqz 70 sx cmt @ 290'-Surface.
- Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

This well is in Lessor Prairie Chicken Area. P&A marker should be plate 3' below ground level.

NOTIFY OCD 24 HOURS PRIOR TO BEGINNING PLUGGING OPERATIONS

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Abigail Montgomery TITLE Agent DATE 5/4/17
Type or print name Abigail Montgomery E-mail address: abbym@bcmmandassociates.com PHONE: 432-580-7161
For State Use Only
APPROVED BY: Michael Litch TITLE Petroleum Engr. Specialist DATE 05/04/2017
Conditions of Approval (if any):

30-025-00576
32.8320732
-103.7727966

Concho


Lease & Well #

Edward # 2

Spud - 6/11/59

Elevation - 4029'

KB -

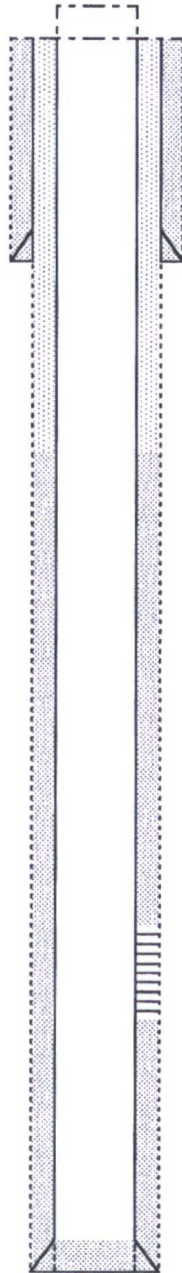

8 5/8" 24# @ 236', 100 sx CL C, circ cmt.

Top of cement @ 2975' FS, temp sur.

Grayburg

3730-3804

Acidized w/1000 gal 15%NEFE

Aidized w/4,000gal 15% NEFE, 10,000 gal oil, 15,000 # sd

PBTD-4112'

Cmt w/150 sx CL C, d/n circ. cmt. TOC 2975', temp sur.

5 1/2" 14# csg @ 4153'

Concho

30-025-00576
32.8320732
-103.7727966

Lease & Well # Edward # 2

Spud - 6/11/59


Elevation - 4029'

KB -

8 5/8" 24# @ 236', 100 sx CL C, circ cmt.

Top of cement @ 2975' FS, temp sur.

PBTD-4112'

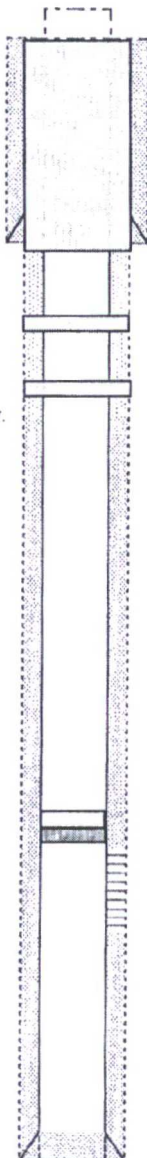

4. Perf & Sqz 70 sx cmt @ 290'-Surface.

3. Perf & Sqz 50 sx cmt @ 1100-1000'.

2. Perf & Sqz 55 sx cmt @ 2330-2180'. WOC & Tag (Yates)

1. Set 5 1/2" CIBP @ 3680'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 3680-3580'.

Grayburg

3730-3804

Acidized w/1000 gal 15% NEFE

Aidized w/4,000gal 15% NEFE, 10,000 gal oil, 15,000 # sd

Cmt w/150 sx CL C, d/n circ. cmt. TOC 2975', temp sur.
5 1/2" 14# csg @ 4153'