

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

30-025-26753

Form C-103
Revised July 18, 2013

HOBBBS OGD AUG 21 2017 RECEIVED		OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-26644	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐	
2. Name of Operator RMR Operating, LLC		6. State Oil & Gas Lease No. L-6453	
3. Address of Operator 14282 Gillis Rd. Farmers Branch, Texas 75244-3715		7. Lease Name or Unit Agreement Name Maralo "16" State	
4. Well Location Unit Letter <u>XH</u> : <u>1980</u> feet from the <u>North</u> line and <u>660</u> feet from the <u>West</u> line Section <u>16</u> Township <u>26S</u> Range <u>36E</u> NMPM County <u>Lea</u>		8. Well Number <u>X9</u>	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 2943'GL		9. OGRID Number 281085	
		10. Pool name or Wildcat Sioux Tansill (Yates 7 Rivers)	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING/CEMENT JOB ☐
OTHER: ☐

INT TO PA Pm. ✓
P&A NR _____
P&A R _____

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

② Circulate hole with 9.5# Brine w/ 12.5# gel/BB1 Pressure test csg to 500 psi

① Set CIBP at 3241'. (Top Perf @3291')

Spot ³⁰ 25 sx on top CIBP.

Perf 5-1/2" casing (4 SPF) @1453'. Sqz with 75 sxs. Displace to 1353'. WOC and Tag

Spot 100' cmt plug from 400' to 300' (Fresh Water Plug)

Perf @ 200'. Circulate cement to surface inside/outside 5 1/2" csg.

Spot 10 sxs cmt surface plug.

Cut-off wellhead. Install marker. Clean Location

Spud Date:

Verify cement to surface all strings

Rig Release Date:

NOTIFY OCD 24 HOURS PRIOR TO BEGINNING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ross Pearson TITLE V. P. Operations DATE 8/18/17
Type or print name Ross Pearson E-mail address: ross@redmountainresources.com PHONE: 469-995-0925
For State Use Only
APPROVED BY: Maah Whitah TITLE Petroleum Engr. Specialist DATE 08/21/2017
Conditions of Approval (if any):


WELL DATA

DATE: 4/12/2007

LEASE/WELL: **Maralo "16" State #9**
FIELD: **Sioux Tansill (Yates 7 Rivers)**

LOCATION: L: 660' FWL and 1980' FSL, Sec 16,
Township 26S, Range 36E

COUNTY: Lea STATE: NM

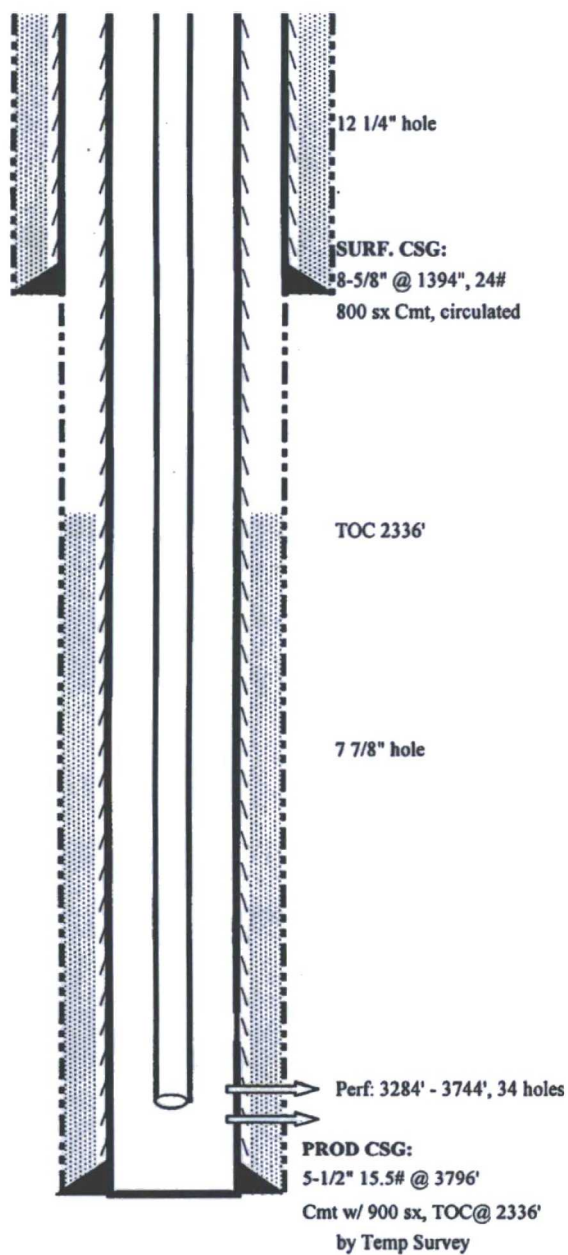

TD: 3796'
PBD: 3752'

REMARKS: