

Submit 1 Copy To Appropriate District Office

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-27486 ✓
1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐ HOBBSSWD ✓		5. Indicate Type of Lease STATE ☒ FEE ☐ ✓
2. Name of Operator BTA Oil Producers LLC		6. State Oil & Gas Lease No.
3. Address of Operator 104 South Pecos, Midland, TX 79701		7. Lease Name or Unit Agreement Name State 2, 8016 JV-P ✓
4. Well Location Unit Letter N : 660 feet from the S line and 1980 feet from the W line Section 2 Township 23S Range 34E NMPM County Lea ✓		8. Well Number 1 ✓
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3376' GR		9. OGRID Number 260297 ✓
		10. Pool name or Wildcat SWD Delaware

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- Tag 9 5/8" CIBP @ 7300'. **CIRC MLF TO 5458'**
- ~~Spot 50 sx cmt @ 5566-5466'. WOC & Tag (DV Tool)~~
- Set 9 5/8" CIBP @ 5458'. Circulate hole w/ MLF. Pressure test csg. Spot 50 sx cmt @ 5458-5358'.
- Perf & Sqz 100 sx cmt @ 4901-4801'. WOC & Tag (13 3/8" Shoe)
- Perf & Sqz 180 sx cmt @ 1700-1465'. WOC & Tag (20" Shoe, T Salt)
- ~~* Spot 50 sx cmt @ 700-600'.~~ **Spot 50 sx @ 1050'. (sg. holes. WOC & TAG)**
- ~~* Spot 50 sx cmt @ 100'-Surface.~~
- Cut off well head, verify cmt to surface, weld on Dry Hole Marker.

*** Open all bradenhead valves prior to squeezing. If able to circulate, change spots on #6 & #7 to perf & squeeze w/ 100 sx cmt.**


Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Abigail Montgomery TITLE Agent DATE 10/17/17
Type or print name Abigail Montgomery E-mail address: abby.m@bamandassociates.com PHONE: 432-530-7161
For State Use Only
APPROVED BY Mark Whitaker TITLE P.E.S. DATE 10/17/2017
Conditions of Approval (if any):


CURRENT
State 2 #1 - ~~Proposed~~ WBD

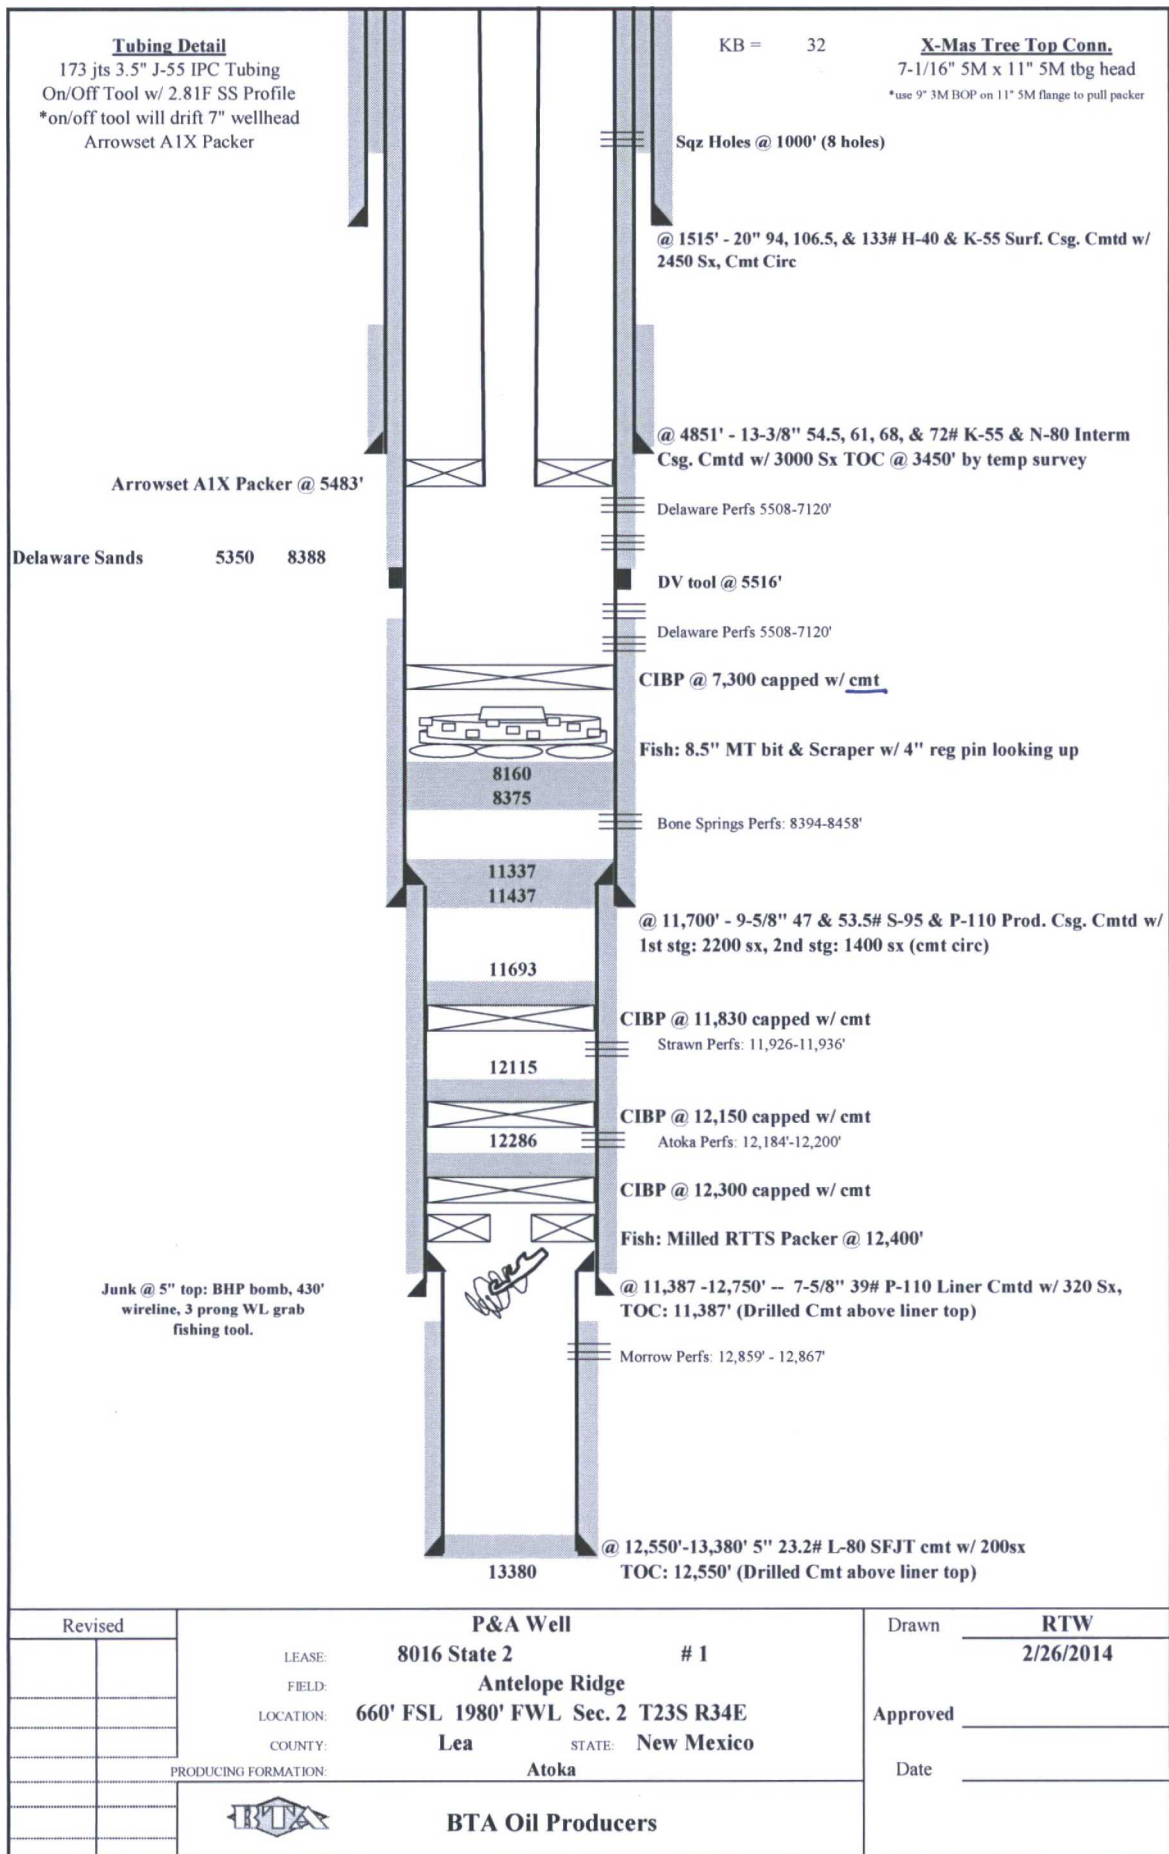

Revised	P&A Well		Drawn	RTW
	LEASE:	8016 State 2 # 1		2/26/2014
	FIELD:	Antelope Ridge		
	LOCATION:	660' FSL 1980' FWL Sec. 2 T23S R34E	Approved	
	COUNTY:	Lea STATE: New Mexico		
	PRODUCING FORMATION:	Atoka	Date	
	 BTA Oil Producers			

7. Spot 50 sx cmt @ 100'-Surface.

6. Spot 50 sx cmt @ 700-600'.

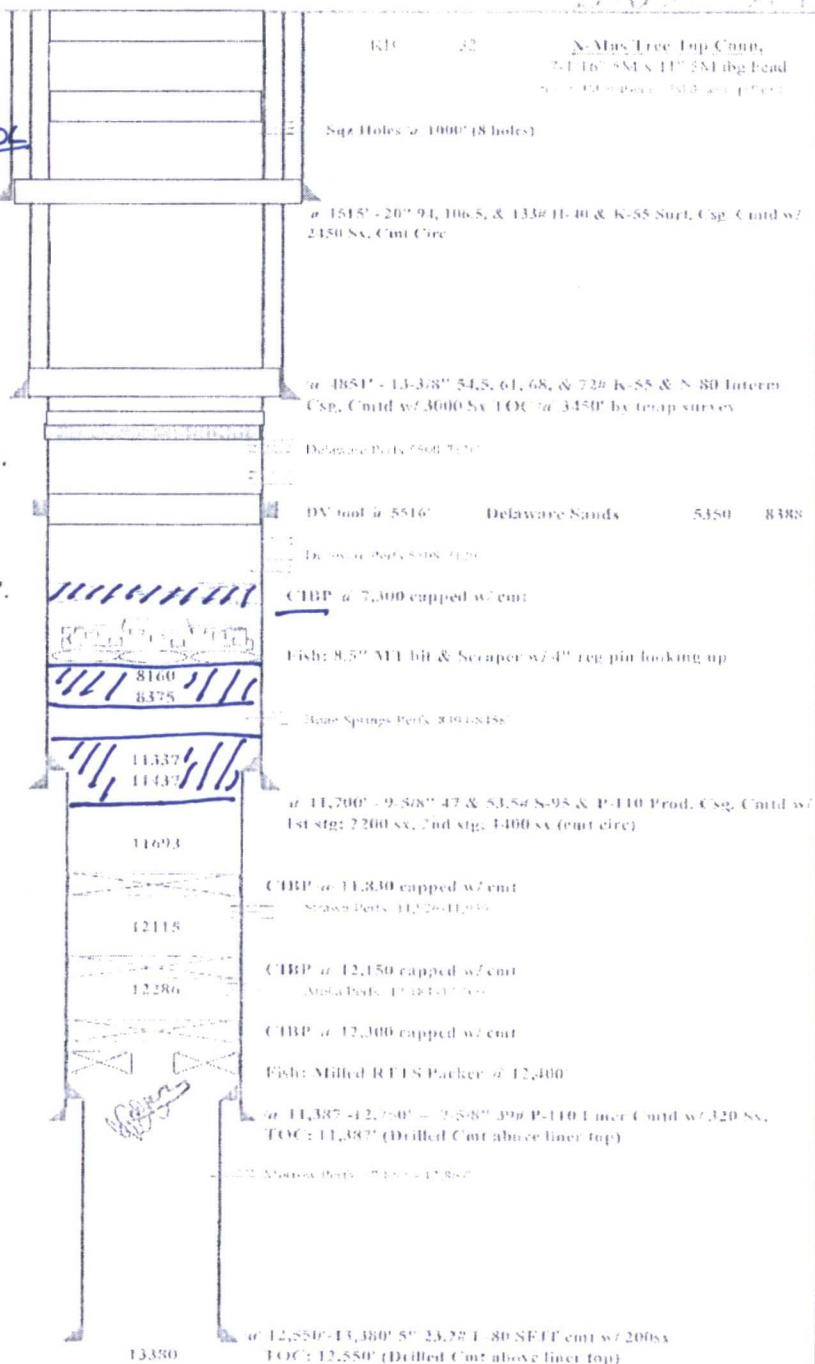*Spot 50sx @ 1050' WOC*5. P&SQ 100 sx cmt @ 1700-1465'.
WOC & Tag. (T Salt & Shoe)4. P&SQ 180 sx cmt @ 4901-4801'.
WOC & Tag3. Set 9 5/8" CIBP @ 5458'.
Spot 50 sx cmt @ 5458-5358'.2. Spot 50 sx cmt @ 5566-5466'.
WOC & Tag (DV Tool)1. Tag 9 5/8" CIBP @ 7300'.
*Spot MLF from
tag to 5458'*Tool at 5" top; BHP: 1000, 200'
wireline, 3 prong WL probe
fishing tool

Revised	P&A Well	Decision	RTW
	8016 State 2		2/26/2014
	Antelope Ridge	Approved	
	660' EST 1980' FWL Sec. 2 T23S R34E		
	Lea	Date	
	Atoka		
	BTA Oil Producers		