Submit 1 Copy To Appropriate District Office <u>District I</u> – (575) 393-6161	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised July 18, 2013 WELL API NO.				
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	OIL CONSERVATION DIVISION 1220 South St. Francis Dr.	30 - 005 - 6222 5. Indicate Type of Lease FEDERAL STATE				
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 87505	6. State Oil & Gas Lease No. NMNM-032.330				
SUNDRY NOTICES (DO NOT USE THIS FORM FOR PROPOSALS DIFFERENT RESERVOIR. USE "APPLICATI PROPOSALS.)	7. Lease Name or Unit Agreement Name JERRY DON FEDERAL					
1. Type of Well: Oil Well Gas	8. Well Number					
2. Name of Operator State of New Mexico formerly Mcl	9. OGRID Number 14424					
3. Address of Operator	10. Pool name or Wildcat					
1625 N. French Drive Hobbs, NI	Pecos Slope; Abo, West (Gas)					
4. Well Location Unit Letter A : 790 feet from the NORTH line and 790 feet from the EAST line Section 24 Township 48 Range 2/E NMPM County CHAVES						
11. Elevation (Show whether DR, RKB, RT, GR, etc.)						

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK [PLUG AND ABANDON	×	REMEDIAL WORK ALTERING CASING [
TEMPORARILY ABANDON [CHANGE PLANS		COMMENCE DRILLING OPNS. P AND A	
PULL OR ALTER CASING [MULTIPLE COMPL		CASING/CEMENT JOB	
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM [
OTHER:				OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date					

 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED PROCEDURE & SCHEMATICS


Spud Date:	Rig Release Date:	
I hereby certify that the information above is true and c	complete to the best of my knowledge and belief.	
SIGNATURE Mark Whitaker	TITLE Petroleum Engr. Specialist E-mail address: marka.whitaker@state.nm.us	DATE 8/22/2017 PHONE: 575-393-6161
For State Use Only APPROVED BY: Mayby Brown Conditions of Approval (if any):	TITLE AO/II	DATE 11/1/2017

McKay Oil Corp Jerry Don Federal No. 1 30-005-62221 UL – A, Sec. 24, T4S, R21E 790' FNL & 790' FEL BLM Serial #: NM – 032330

8 5/8" 24# @ 1087' w/ 550 sx cmt 4 1/2" 10.5# @ 3202' w/ 300 sx cmt Top Perforation 2975'

- 1. MIRU. POOH w/ production equipment.
- 2. Set CIBP at 2875'. Circulate hole with mud laden fluid. Pressure test casing to 500 psi. Spot 25 sx cement on CIBP.
- 3. Perf @ 1137'. Sqz w/ 45 sx cmt. WOC. Tag at 1037' or better.
- 4. Perf @ 100'. Circulate cement to surface inside/outside 4 ½" casing.
- 5. Cut off wellhead 3' below ground level and verify cement to surface all strings.
- 6. Install below ground P&A marker. Photos should be taken prior to and after welding on plate. Record GPS reading. BLM should be notified prior to cut off so it can be witnessed.

NOTES: Mud laden fluid consists of fresh water with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to proceeding with P&A.

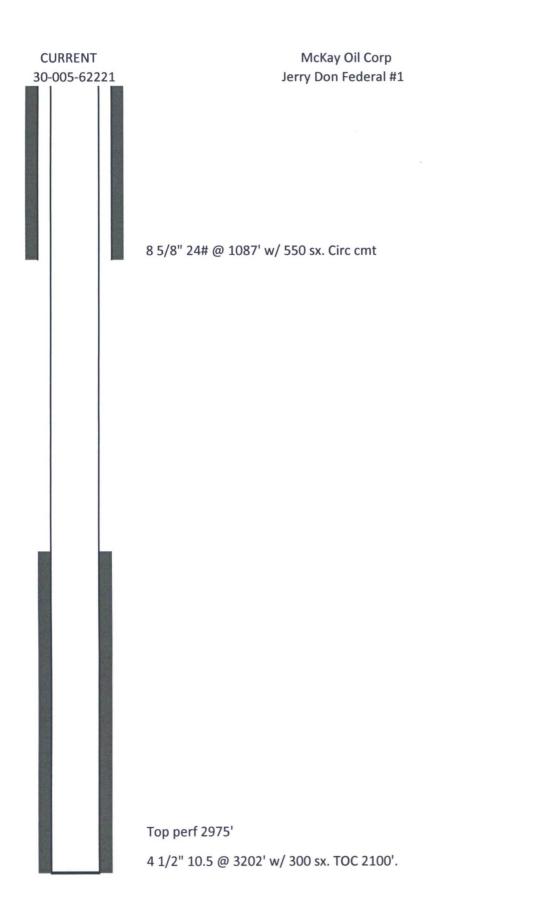

McKay Oil Corp Jerry Don Federal #1

PROPOSED 30-005-62221 CUT OFF WELLHEAD 3' BELOW GL, VERIFY CEMENT, & INSTALL BELOW GROUND MARKER. TAKE PHOTO & GPS READINGS PERF @ 100'. CIRC CMT TO SURFACE 8 5/8" 24# @ 1087' PERF @ 1137'. SQZ W/ 45 SX. WOC & TAG. PRESSURE TEST CASING **CIRCULATE MUD LADEN FLUID** SET CIBP AT 2875'. CAP WITH 25 SX Top Perf 2975' 4 1/2 "10.5# @ 3202'