

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Carlsbad Field Office

FORM APPROVED
OMB NO. 1004-0137
Expires: January 31, 2018

OCD Hobbs

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

5. Lease Serial No.
NMNM107396

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
WAPITI 31 FEDERAL 02

9. API Well No.
30-025-37643-00-S1

10. Field and Pool or Exploratory Area
EK-YATES-7RVRS-QUEEN

11. County or Parish, State
LEA COUNTY, NM

SUBMIT IN TRIPLICATE - Other instructions on page 2

1. Type of Well
 Oil Well Gas Well Other

2. Name of Operator
CHISHOLM ENERGY OPERATING LLC
Contact: JENNIFER ELROD
Email: JELROD@CHISHOLMENERGY.COM

3a. Address
801 CHERRY STREET SUITE 1200 UNIT 20
FORT WORTH, TX 76102

3b. Phone No. (include area code)
Ph: 817-953-3728

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
Sec 31 T18S R34E SWSE 330FSL 1830FEL

HOBBS OCD
APR 21 2019
RECEIVED

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input checked="" type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

CHISHOLM ENERGY OPERATING, LLC REQUESTS TO TEMPORARILY ABANDON THE WAPITI 31 FEDERAL 2 WITH THE PROCEDURE SHOWN BELOW IN ORDER TO EVALUATE ADDITIONAL POTENTIAL IN THE BONE SPRING FORMATION.

WAPITI 31 FEDERAL 2-TEMPORARILY ABANDON PROCEDURE

MIRU; PULL 2 7/8" TUBING

SET CIBP @ 9050' TVD; DUMP BAIL 35' OF CLASS C CMNT ON TOP OF CIBP

NOTIFY BLM 24 HOURS PRIOR TO MIT

14. I hereby certify that the foregoing is true and correct.
Electronic Submission #474039 verified by the BLM Well Information System
For CHISHOLM ENERGY OPERATING LLC, sent to the Hobbs
Committed to AFMSS for processing by PRISCILLA PEREZ on 07/18/2019 (19PP2567SE)

Name (Printed/Typed) JENNIFER ELROD Title SR. REGULATORY ANALYST

Signature (Electronic Submission) Date 07/18/2019

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By /s/ Jonathon Shepard Title Petroleum Engineer Date JUL 24 2019
Carlsbad Field Office

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2) **** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED ****
SUBJECT TO LIKE APPROVAL BY BLM FOR RECORD ONLY
XZ NM OCD 9-6-19

Additional data for EC transaction #474039 that would not fit on the form

32. Additional remarks, continued

PERFORM MIT W/LESS THAN 10% PRESSURE DROP OVER 30 MIN

RDMO


NOTICE OF INTENT TO CONDUCT MIT FILED 7/18/2019



Wapiti 31 Federal 2

API # 30-025-37643

CURRENT COMPLETED WBD

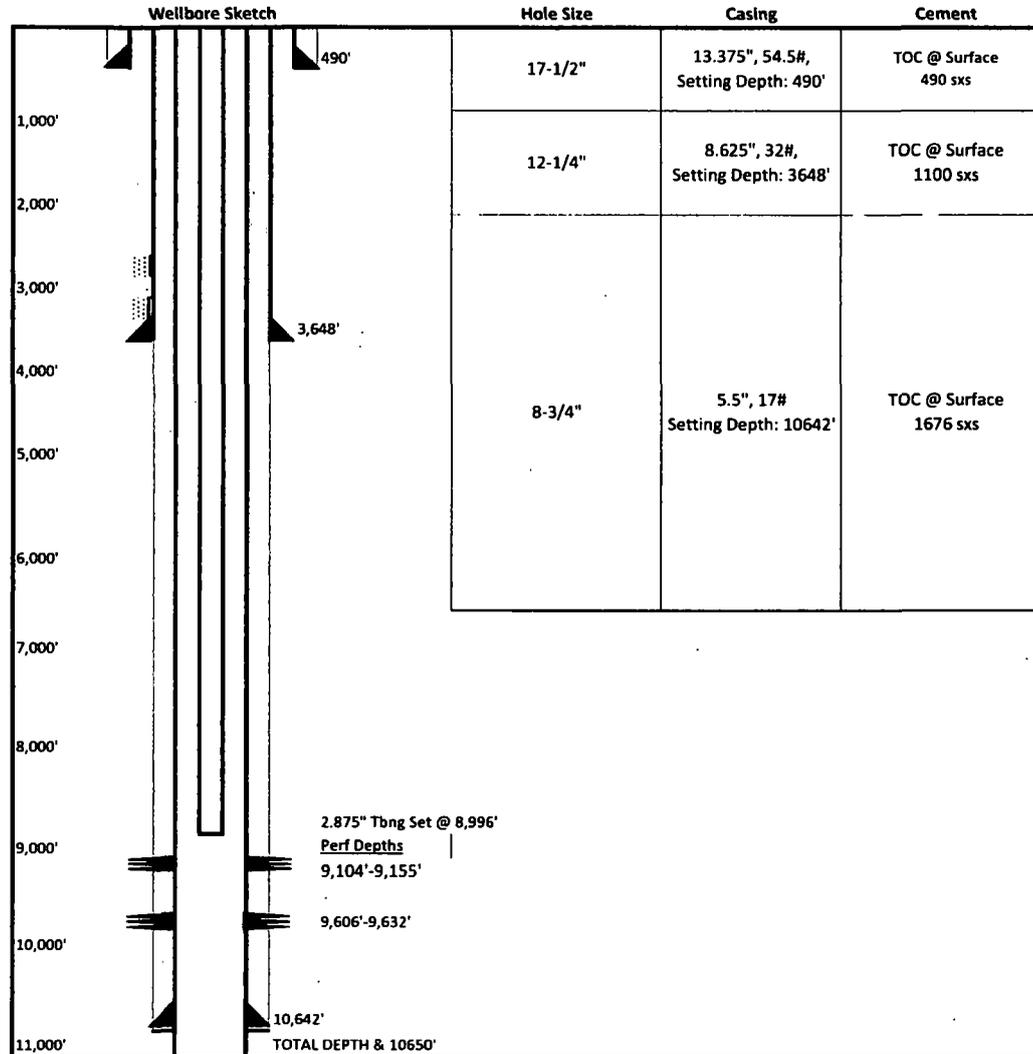




Wapiti 31 Federal 2

API # 30-025-37643

PROPOSED TEMPORARILY ABANDONED WBD

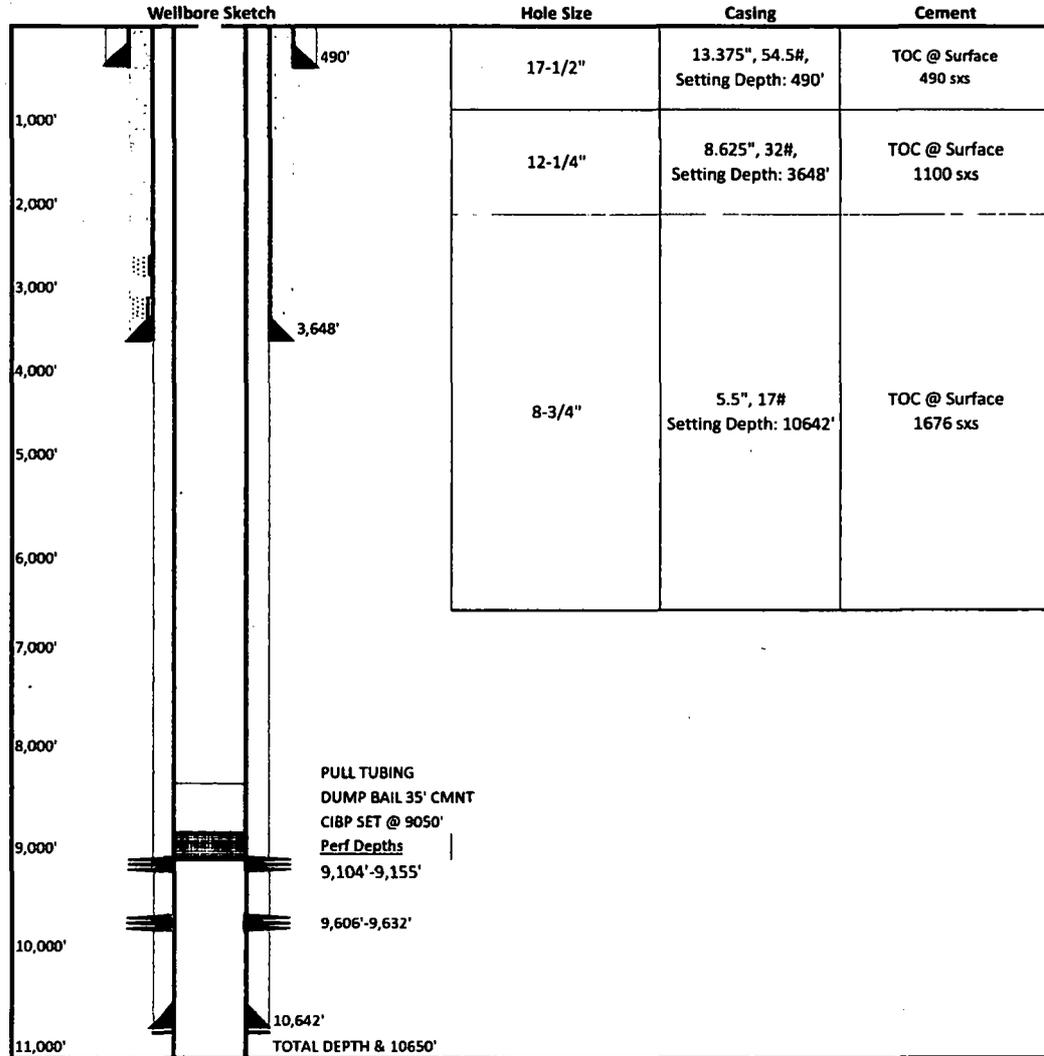

BUREAU OF LAND MANAGEMENT

**Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

Conditions of Approval for Temporary Abandonment of Wells

Definition: A temporarily abandoned well is a completion that is not capable of production in paying quantities but which may have future value. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

Note: TA status "will be effective for a period up to 1 year from the date of NOI approval and can be renewed annually thereafter" per IM NM-2016-017.

1. A bridge plug (CIBP) must be installed 50 to 100 feet above any open perforations or open hole. The CIBP must be capped with either a minimum of 25 sacks of cement if placed with tubing or 35 feet of cement if placed with a bailer. The top of the cement must be verified by tagging.
2. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. If the well does not pass the casing integrity test, then the operator shall, within 30 days, submit a procedure to either repair the casing or to plug and abandon the well.
3. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
4. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if it is not isolated by a packer.
5. A bradenhead test must be conducted. If the test indicates a problem, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
6. Submit a subsequent Sundry Notice (Form 3160-5) with the following information:
 - a. A well bore diagram with all perforations, CIBP's, and tops of cement on CIBP's.
 - b. A description of the temporary abandonment procedure.
 - c. A clear copy or the original of the pressure test chart.