

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06840
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	CENTRAL DRINKARD UNIT
8. Well No.	109
9. Pool Name or Wildcat	DRINKARD
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3470' GL


**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER INJECTOR
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>E</u> : <u>2086'</u> Feet From The <u>NORTH</u> Line and <u>454'</u> Feet From The <u>WEST</u> Line Section <u>28</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3470' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPERATION <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input checked="" type="checkbox"/> C/O, ADD PERFS & ACIDIZE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-11-06: MIRU. REL PKR. PU BIT & TAG @ 6615'. (PBD @ 6625). PULL UP ABOVE LINER TOP.  
5-12-06: TIH B/BIT TO 6615'. C/O FILL FR 6615-6625'.  
5-15-06: PRTG 6533-37, 6549-53, 6574-80, 6594-98. TIH W/204 JTS & PKR & SET @ 6493'.  
5-16-06: ACIDIZE W/35 BBLs ACID. PUT 600 PSI ON BS. INSTALL CHART RECORDER TO MONITOR BS & LET ACID SPEND. REL PKR. TIH & TAG @ 6620.  
5-17-06: TIH W/INJ TBG & PKR. SET PKR @ 6477.  
5-18-06: RUN MIT ON CSG TO 500 PSI. (ORIGINAL CHART & COPY OF CHART ATTACHED).  
RIG DOWN. FINAL REPORT

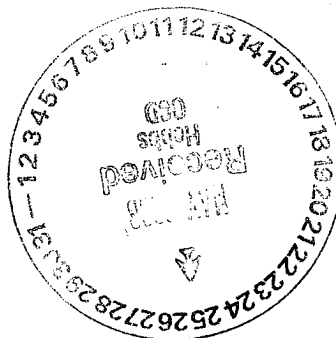

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 5/22/2006  
TYPE OR PRINT NAME Denise Pinkerton Telephone No. 432-687-7375

(This space for State Use)  
APPROVED Harry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER  
CONDITIONS OF APPROVAL, IF ANY: DATE

MAY 30 2006

