
State of New Mexico

Form C-103

District Office	Energy, Minera	ais and Naturai Re	esources Department		Revise	ed 1-1-89
DISTRICT I	OIL CONS	SERVATIO	ON DIVISION	WELL API NO.		
P.O. Box 1980, Hobbs, NM 88240				30-025-31784		
DISTRICT II	. Santa F	e, New Mexico		5. Indicate Type of Lea	ase	
P.O. Box Drawer DD, Artesia, NM 88210 DISTRICT III)	•			STATE 🗸	FEE [
1000 Rio Brazos Rd., Aztec, NM 87410				6. State Oil / Gas Leas	se No. B-2706	
	TICES AND REP	ORTS ON WEL	LS			
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI				7. Lease Name or Unit Agreement Name		
(FORM	C-101) FOR SUCH	PROPOSALS.	FERIVII	VACUUM GLORIE	TA WEST UNIT	
1. Type of Well: OIL GAS WELL WF		INJECTION				
WEEL OHIER WOLLDON				8. Well No.		
2. Name of Operator CHEVRON USA INC				o. Well No.	28	
3. Address of Operator 15 SMITH RD, MIDLAND, TX 79705				9. Pool Name or Wildo	cat	
4. Well Location	CO, MIDEL MO, TX			VAC	CCUM GLORIETA	
Unit Letter :	2304 Feet	From The SOUT	H Line and 1127	Feet From The V	VEST Line	
Offic Letter						
Section 25	Township <u>17-5</u>	<u> </u>	Range 34-E N	MPM:	LEA COUNTY	
	10. Elevation (Sho	ow whether DF, RKB,	RT,GR, etc.)		1016年7月4日	
11. Check A	Annronriate Rox	to Indicate Nat	ure of Notice, Report	or Other Data	The state of the s	<u>. Tarteration</u>
	• • •	to maloate real		,	DEDODT OF:	
NOTICE OF INTENTI		~·· □		UBSEQUENT F		
PERFORM REMEDIAL WORK	PLUG AND ABAND		REMEDIAL WORK		ERING CASING	. 📙
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRILLING OP		G AND ABANDONMENT	
PULL OR ALTER CASING			CASING TEST AND CEME	REPAIR OUT OF ZO	NE WITH IN I	
OTHER:		U	OTHER:	KEFAIR OUT OF ZOI	ME AA LIK IIA3	
proposed work) SEE RULE 1103. 4-27-06: MIRU. PU BIT TO TAG @ 59 4-28-06: DUMP 16 SX SAND DN TBG W/PKR & TBG TO 5778. SET PKR @ 5-02-06: TEST LINES TO 6000#. 5-03-06: PMP DN TBG TO ESTABLIS 5-05-06: TIH W/2 7/8" TBG TO 5850. BFW. REV CIRC 35 BBLS. 5-08-06: PU BIT & TBG TO TAG CMT 5-09-06: TIH W/BIT TO 5577. DRILL 9 5-10-06: TIH TO 5856. WASH SAND 5-11-06: TIH W/PKR TO 5850. REL P 5-12-06: TIH W/BIT TO 5954'. PUSH 5-15-06: PU PKR & SET @ 5804. 5-16-06: CHART & TEST FOR NMOOREPORT	G. TIH W/TBG TO TA 5778. SH RATE & PRESS. DISPL W/FW. SPO T @ 5494. BROKE C 5577-5856. FR 5856-5954. TIH KKR. PULL PKR TO DN TO 5974. TOH N	AG SAND @ 5885 REL PKR. TIH W T 50 SX CL C NE CIRC. DRILL CMT W/TRT PKR TO 3 5810. RU SWAB. W/WS TO 2850'.	TOH TO 5018'. DUMP 6 /TBG TO 5856. TAG. PULAT CMT TO SQZ HOLES FR 5494-5577. DRILLED 558. 8 RUNS. TIH W/TBG BAI	SX SAND. TIH TO T LL UP TO 5770. IN 5 1/2" CSG HOLE OUT 83' CMT. TOH ILUER & 8 JTS 2 7/8'	ES 5828-5840. DISPL TO 5514. " TBG TO 461.	W/30
SIGNATURE (MISE)	ge to the bast of my showledge Denise Pinkertor TITLE	١	ulatory Specialist	123456		13 15 W 27 27 1375
V		·			AV 2 A 200c	

MAY 3 0 2006

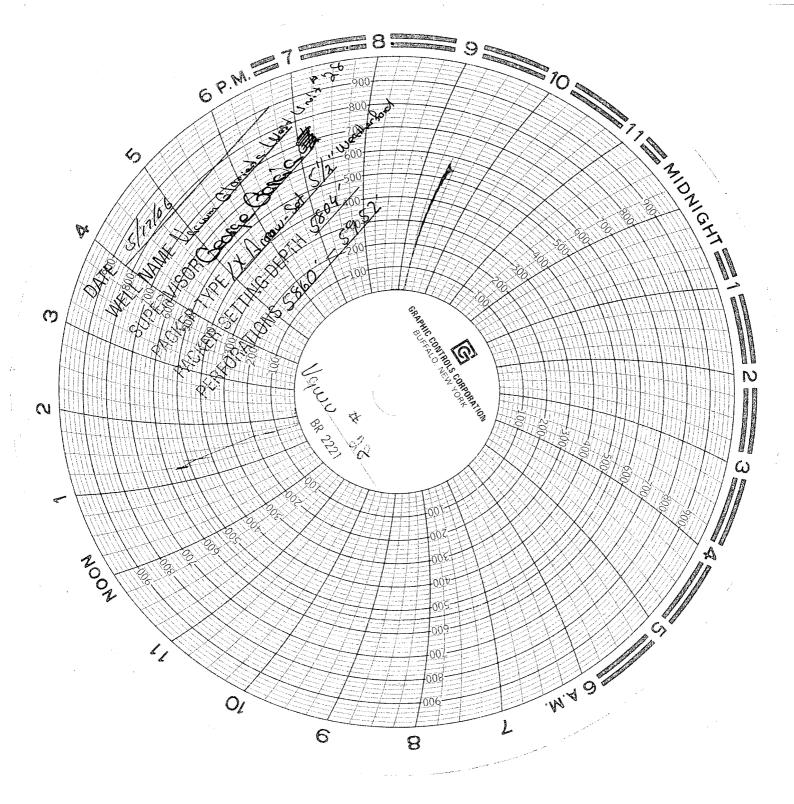

(80 5)5 2 4" Dualine The 578 (80 th 2)2 XI Arraw Set Phr 2 73.