

Submit 3 Copies To Appropriate District Office
District I
1620 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-31443
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. NM 86710

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name:

LOST TANK SWD

1. Type of Well:

Oil Well ☐ Gas Well ☐ Other **SWD**

2. Name of Operator

PENROCK OIL CORP.

8. Well No.

1

3. Address of Operator

PO Box 2769 Hobbs, NM 88241

9. Pool name or Wildcat

LOST TANK DELAWARE

4. Well Location

Unit Letter **E** : **1980** feet from the **N** line and **660** feet from the **W** line

Section **31** Township **21S** Range **32E** NMPM County **LEA**

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

3648 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: **MIT - PRESSURE TEST** ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

WELL FOUND TO BE COMMUNICATING. SI WELL 7-17-03

NOTIFIED GARY WINK WELL WORK TO COMMENCE 7-21-03


7-21-03: MIRU PU. RELEASE PKR. POH PKR + TBG. REDRESS PKR.

7-22-03: RIH PKR + TBG. TEST TBG TO 5000#. REPLACE 13 ITS TBG.

CIRC PKR FLUID. SET PKR @ 5047'. TEST BACKSIDE TO 460#.

HOLD PRESS 30 MIN. OK. BLEED PRESS TO 0#. PUT WELL ON.

CHART ATTACHED.

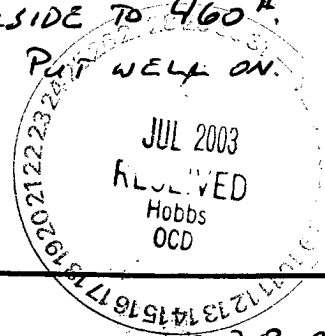

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE **Tracy Headstream** TITLE **PROD FOREMAN** DATE **7-28-03**

Type or print name **TRACY HEADSTREAM**

Telephone No. **505-492-1236**

This space for State use)

APPROVED BY **Gary W. Wink**

OC FIELD REPRESENTATIVE II/STAFF MANAGER
TITLE _____ DATE **JUL 31 2003**

Conditions of approval, if any

cc: SIP org slb.

