

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-24067
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil / Gas Lease No.
7. Lease Name or Unit Agreement Name W.A. RAMSEY 'B'
8. Well No. 6
9. Pool Name or Wildcat TUBB/DRINKARD


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator CHEVRON USA INC	
3. Address of Operator 15 SMITH RD, MIDLAND, TX 79705	
4. Well Location Unit Letter <u>H</u> : <u>2310'</u> Feet From The <u>NORTH</u> Line and <u>430'</u> Feet From The <u>EAST</u> Line Section <u>25</u> Township <u>21-S</u> Range <u>36-E</u> NMPM <u>LEA</u> COUNTY	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3531'</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPERATION ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐		CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☒	ADD PERFS IN TUBB & STIMULATE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

5-08-06: MIRU.
5-09-06: TIH W/BIT & TAG @ 6738.
5-10-06: NO OPERATIONS.
5-11-06: PERF 6228-36, 6248-56, 6268-74, 6284-88, 6296-6304, 6322-30, 6450-56, 6470-74, 6488-92, 6549-54, 6560-64, 6580-85, 6592-96, 6668-72, 6684-89, 6694-6702, 6710-16, 6728-32.
5-12-06: TIH W/PPI PKRS TO PBTD. PUH: MARK SETTINGS FOR PPI JOB. PU & SET PKRS.
5-15-06: ACIDIZE PERFS 6228-6732 W/6100 GALS 15% HCL. PUH & SET PKR @ 6218. RU SWAB.
5-16-06: REL PKR. TIH W/210 JTS 2 3/8" WS & PKR TO 6514. SET PKR @ 6514.
5-17-06: ACIDIZE PERFS 6546-6754 W/3750 GALS 20% & 4500 GALS 20% SUPER X ACID.
5-18-06: REL PKR. PUH TO 6200. SET PKR. PKR WILL NOT SET. KNOCK BALLS OFF. TIH W/NEW PKR TO 6200. SET PKR.
5-19-06: REL PKR. PUH JUST INSIDE LINER @ 5845. SET PKR. TIH W/RBP & PKR. SET RBP @ 5826. PUH SET PKR @ 5706. PUH SET PKR @ 5488. RU SWAB.
5-22-06: REL PKR. LATCH ON RBP @ 5826. REL RBP. PUH TO 5796. LEAVE PKR & RBP SWINGING. RU SWAB.
5-23-06: SWAB. TIH W/2 3/8" PROD TBG.
5-24-06: TIH W/SUB PUMP.
5-25-06: PU SEAL, PUMP. PU 2 7/8" TBG TO 5495'. CONNECT ELECT. CONNECT FLOW LINE & TEST PUMP.
5-26-06: RIG DOWN. FINAL REPORT

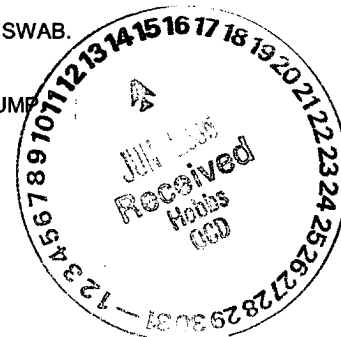

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 6/13/2006
TYPE OR PRINT NAME Denise Pinkerton Telephone No. 432-687-7375

(This space for State Use)

APPROVED [Signature] TITLE PETROLEUM ENGINEER
CONDITIONS OF APPROVAL, IF ANY:

DATE JUN 27 2006
Desoto/Richardson/ver 1.0