

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

OCD-HOBBS

FORM APPROVED  
OMB NO. 1004-0137  
Expires March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

**Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.**

**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

**EOG Resources Inc.**

3a. Address

**P.O. Box 2267 Midland, Texas 79702**

3b. Phone No. (include area code)

**432 686 3689**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

**660 FNL & 1980 FNL  
Sec 4, T-25-S, R-34-E**

5. Lease Serial No.

**NM 16139**

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

**Vaca Ridge 4 Fed Com 1**

9. API Well No.

**30-025-28491**

10. Field and Pool, or Exploratory Area

11. County or Parish, State

**NM**

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

☐ Acidize

☐ Alter Casing

☐ Casing Repair

☐ Change Plans

☐ Convert to Injection

☐ Deepen

☐ Fracture Treat

☐ New Construction

☒ Plug and Abandon

☐ Plug Back

☐ Production (Start/Resume)

☐ Reclamation

☐ Recomplete

☐ Temporarily Abandon

☐ Water Disposal

☐ Water Shut-Off

☐ Well Integrity


☐ Other

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

**Proposed plugging procedure:**

1. Set CIBP @ +/- 8950' + 35' cement cap to abandon Brushy Canyon perfs from 8970' to 8990'.
2. Spot 200' plug from 6100' to 6300'.
3. Spot 200' 9 5/8" shoe plug from 5100' to 5300'. Tag.
4. Cut & pull 7" casing @ +/- 4600'.
5. Spot 100' 7" casing stub plug from 4550' to 4650'.
6. Spot 100' 13 3/8" casing shoe plug from 545' to 645'. Tag.
7. Spot 50' surface plug from 0 to 50'.
8. Cut off wellhead, weld P&A marker. Clean and restore location.

SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

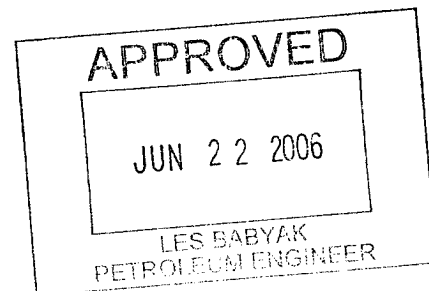

14. I hereby certify that the foregoing is true and correct  
Name (Printed/Typed)

**Stan Wagner**

Title

**Regulatory Analyst**

Date **06/15/2006**

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.