

New Mexico Oil Conservation Division, District I

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

1625 N. French Drive
Hobbs, NM 88240

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NMNM080219

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Hondo Federal #1

9. API Well No.

30-005-21013

10. Field and Pool, or Exploratory Area

SE Chaves Queen Gas Area Assoc

11. County or Parish, State

Chaves, NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Vintage Drilling LLC

3. Address and Telephone No.

R 310 S. Haldeman Rd, Artesia, NM 88210

4. Location of Well (Footage, Sec., T. R. M. or Survey Description)

1980' FNL 660' FEL
Sec 21, T13S, R31E

12 CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form)

13 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

APPROVED FOR 4 MONTH PERIOD
ENDING 12/14/06

Pull rods and tubing.

Set cast iron bridge plug at 2700'. Cap with 35' cement.


Perforate 4 1/2" casing at 1950' and squeeze, set 100' plug from 1950' - 1850', TAG.

Perforate 4 1/2" casing at 1100' and squeeze, set 100' plug from 1150' - 1050', TAG.

Perforate 4 1/2" casing at 350' and squeeze, set 100' plug from 300' - 400'. TAG.

Set 60' surface plug across all annuluses.

Set dry hole marker.

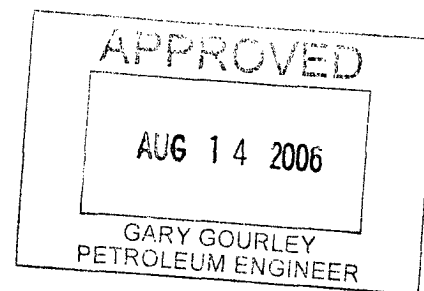

14. I hereby certify that the foregoing is true and correct

Signed [Signature] Title Secretary Date 7/14/06

(This space for Federal or State office use)


Approved by _____ Title _____ Date _____
Conditions of approval, if any:

Title 18 U.S.C Section 1001. makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representation & as to any matter within its jurisdiction

GNW

• See Instruction on Reverse Side

HONDO FEDERAL #1
H-21-138-31E

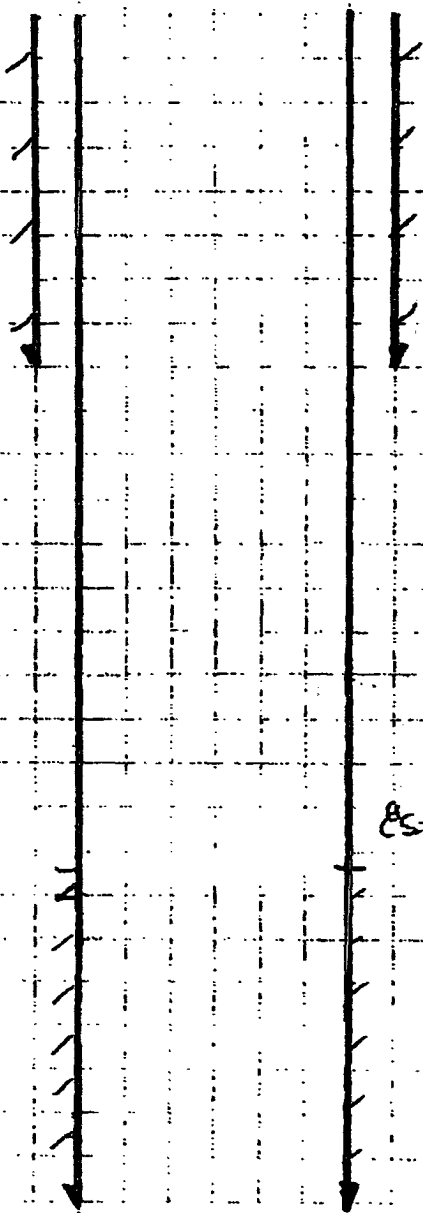

12 1/4" hole

8 5/8" @ 359' w/250
CIRCU

Est TOC @ 1930'

7 7/8" hole

4 1/2" 10.5" @ 2800'
w/ 300 w/ 50/50 pps

Perfs: Queen

~~2735-2745'~~
2742-2747'

TD 2800'
PBD 2782'

Tops -

Rustler	1162'
Salt	1250'
B/Salt	1840'
Yates	1992'
Queen	2742'

Q.C.V.
3/10/06