Form 3160-5 (August 1999)

## **UNITED STATES** DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

N.M. Oil Cons. Division 1625 N. French Dr. Hobbs, NM 88240

☐ Temporarily Abandon

☐ Water Disposal

FORM APPROVED OMB No. 1004-0135

Expires November 30, 2000

## SUNDRY NOTICES AND REPORTS ON WELLS

LC 030133B

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE - Other instructions on reverse side				If Unit or CA/Agreement, Name and/or No.	
1. Type of Well				8910115860	
Oil Well Gas Well Other INJECTION				Well Name and No.	
2. Name of Operator BRECK OPERATING CORP.				South Eunice Unit #35  9. API Well No.	
3a. Address		3b. Phone No. (include at	ea code)	30-025-09080	
P.O. BOX 911, BRECKENRIDGE, TX 76424 (254) 559-3355		10.	Field and Pool, or Explaratory Area		
4. Location of Well (Footage, Sec., 7	., R., M., or Survey Descri	ption)		Eunice 7 Rivers Queen, So.	
Sec 28, T22S, R36E, 660 FNL, 1980 FWL				County or Parish, State Lea, NM	
12. CHECK APPR	ROPRIATE BOX(ES)	TO INDICATE NATUR	E OF NOTICE, REPO	RT, OR OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				
	☐ Acidize	☐ Deepen	☐ Production (Start/Res	ume)	
☐ Notice of Intent	☐ Alter Casing	☐ Fracture Text	☐ Reclamation	☐ Well Integrity	
☑ Subsequent Report	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other	

M Plug and Abandon

☐ Plug Back Describe Proposed or completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days tollowing completion of the involved operations. If the operation results in a multiple completion of or recompletion in a new interval, a Form 3160-4 shall be tiled once testing has been completed. Final abandonment Notices shall be filed only after all requirements, including reclamation, have been commpleted, and the operator has determined that the site is ready for final inspection.

## **Plugging Procedure**

☐ Final Abandonment Notice


- 1. RIH w/tbg, displace hole w/9.5# mud
- 2. Place 25 sx plug 3560-2884' on top of CIBP.

☐ Change Plans

☐ Convert to Injection

- 3. Set 25 sx plug from 1525-825'
- BP 3560; to plugging of the well bure. Lability under bond is retained until SECTION IS A COMPOSED IN COMPOSED IN

- 4. Tag plug @ 825'
- 5. Perf csg @ 409' & pump 35 sx plug.
- 6. Tag plug @ 130' (Buddy Hill w/OCD on location)
- 7. Place surface plug 60' to surface.
- 8. Cut wellhead off & place P&A marker.
- 9. Will notify BLM when ready for final inspection.

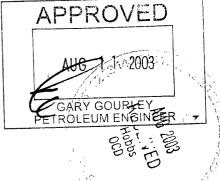

		√ <del>2</del> 25				
14. I hereby certify that the foregoing is true and correct Name ((Printed Typed)		15.05.57				
ERNIE UNDERWOOD	Title	DISTRICT ENGINEER				
Signature Emia Underwood	Date	August 11, 2003				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
Approved by Hayw. Wink	Title	Date				
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.						

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdicition.