

OCD-HOBBS

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0137
Expires: March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE- Other instructions on reverse side.

1. Type of Well
☐ Oil Well ☐ Gas Well ☒ Other *1*

2. Name of Operator **SMITH & MARRS, INC.**

3a. Address
P.O. BOX 863 KERMIT, TX 79745

3b. Phone No. (include area code)
432-586-3076

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
UNIT LETTER "I", SEC 28. T-26S, R-37E 1980' FSL, 660' FEL

5. Lease Serial No.

NMLC-030174B

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.
W H RHODES 'B' NCT-2

8. Well Name and No.
3

9. API Well No.
30-025-12075

10. Field and Pool, or Exploratory Area
RHODES YATES SEVEN RIVERS



11. County or Parish, State
LEA COUNTY, NEW MEXICO

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other MIT
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

SEE ATTACHMENT

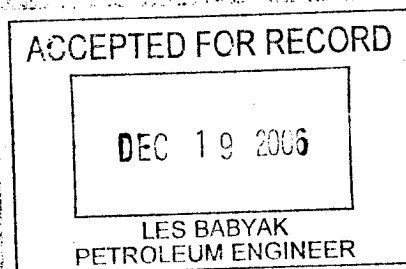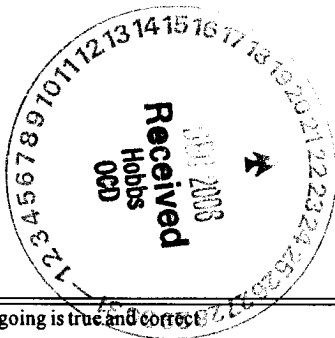

14. I hereby certify that the foregoing is true and correct.
Name (Printed/Typed)

Jerry Jennings

Title

Secretary / Agent

Signature

Jerry Jennings

Date

12-8-2006

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Hay W. Wind

FIELD REPRESENTATIVE II / STAFF MANAGER

Title

Date

2006 DEC 2

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

DEC 2 2006

(Instructions on page 2)

GWW

MAYO MARRS CASING PULLING INC.

Lease: Smith and Marrs
Project: Rhodes NCT2 # 3
ATTN: MIT
Ricky Smith

PUSHER - Sam
BID = Hourly
Tracking # 06-5438-5

10/20/2006 4 HRS
MI RU EQUIPMENT - SDFN

10/23/2006 10 HRS
ND WELLHEAD - NU BOP - RELEASE PACKER - POOH WITH 2-7/8" TUBING - REDRESS PACKER - RIH AND SET PACKER - SDFN

10/24/2006 11 HRS
RU KILL TRUCK - PRESSURED TESTED TO 500# - TESTED GOOD - RAN CHART @ 400# FOR 30 MIN. - PUMP DOWN
TUBING WELL BEGAN PRESSURING UP - CALL RICKEY AND JERRY LIVINGSTON - BOTH AGREE TO PUMP ACID - POOH
WITH PACKER - RIH WITH TUBING AND TAG TD @ 3145' - SDFN - ACID WILL BE ON LOCATION @ 7:30 AM

10/25/2006 11 HRS
OPEN UP WELL - TUBING PLUGGED - PUMP AND WORK TUBING - WORKED PLUGGED OUT OF TUBING - SPOT 500
GAL ACID @ 3150' - PUH TO 975' - CLOSE BOP - PRESSURE UP 3 TIMES TO 500# - HELD 500# - REVERSE OUT ACID -
PERFS TAKING FLUID SLOWLY - PRESSURE UP TO 500# - LEAVE SHUT IN OVER NIGHT

10/26/2006 11 HRS
MIX AND FLUSH WELL WITH 2% KCL - POOH - RIH WITH PACKER - ND BOP - NU WELL HEAD - LOAD BACK SIDE WITH
PACKER FLUID - TEST TO 500# - TESTED GOOD - GET READY TO RIG DOWN - SDFN

10/27/2006 4 HRS
RIG DOWN - CLEAN UP LOCATION - MOVE OUT
Sent original MIT chart to Buddy Hill at OCD in Hobbs.

