

Sub- 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-23852
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Chesapeake Operating Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 2010 Rankin Hwy Midland, TX 79701		7. Lease Name or Unit Agreement Name State L
4. Well Location Unit Letter L : 2310 feet from the South line and 330 feet from the West line Section 19 Township 17S Range 36E NMPM County Lea		8. Well Number 2
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3898 GR		9. OGRID Number 147179
Pit or Below-grade Tank Application <input type="checkbox"/> or Closure <input type="checkbox"/>		
Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____		
Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐


OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Chesapeake, respectfully, request permission to plug this well per the attached procedure.

SEE 2ND PAGE

THE OIL CONSERVATION DIVISION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS.

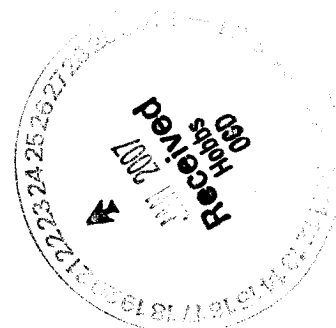

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☒.

SIGNATURE Shay Stricklin TITLE Regulatory Tech. DATE 01/18/2007

Type or print name Shay Stricklin
For State Use Only

E-mail address: sstricklin@chkenergy.com Telephone No. (432)687-2992
OCD FIELD REPRESENTATIVE II/STAFF MANAGER

APPROVED BY: Larry W. Wink TITLE _____ DA FEB 01 2007
Conditions of Approval (if any):

State L #2
Lea County, New Mexico
Plugging Procedure

Date: November 30, 2006

Location: 2,310' FSL & 330' FWL Sec. 19-T17S-R36E

Production Casing: 5 1/2" 17# N-80 & 20# X-Line 0-8,930'

PBTD/TD: 8,900' / 8,930'

Current Perfs: Abo 8,815-74'

Recommended Procedure:

1. MIRU PU. NDWH/NUBOP. POH w/ 2 7/8" tbgs, rods and pump.
2. RU wireline co. Tag PBTD w/ gauge ring and junk basket. Set CIBP @ 8,750' and dump 35' of cement on top of plug.

6250' PERF 5 1/2" 50' OUT IN TAG @ 6150'

3. RIH w/ open ended tbgs to ~~6000'~~ and set a 50 sxs cement plug.

4. Pull tbgs up to 3,250' and set a 50 sxs casing shoe plug. Tag plug.

PERF 5 1/2" @ 3250' 50' OUT IN TAG @ 3150' 8 5/8" SHOE
2900' TOSS POT 25 SX PLUG F/ 2950'

5. Pull tbgs up to ~~2400'~~ and set a 50 sxs cement plug.

6. *PERF 5 1/2" 50' OUT IN TAG @ 1840' (PERF @ 1940')*

- ~~7~~ Pull tbgs up to 400'. Fill casing back to surface with cement. POH w/ tbgs. Top off casing with cement.

- ~~8~~
~~4~~ RD and move off. Install dry hole marker and cut off dead men. Restore location.