

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-38210
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator ConocoPhillips Company		6. State Oil & Gas Lease No.
3. Address of Operator 3300 N. "A" Street, Bldg. 6 #247 Midland, TX 79705		7. Lease Name or Unit Agreement Name Vacuum Glorieta East Unit
4. Well Location Unit Letter <u>K</u> : 1350 feet from the <u>South</u> line and 1875 feet from the <u>West</u> line Section <u>27</u> Township <u>17S</u> Range <u>35E</u> NMPM Lea County <u>New Mexico</u>		8. Well Number 024
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3935' GR		9. OGRID Number 217817
		10. Pool name or Wildcat Vacuum; Glorieta

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐


OTHER: Commence Drilling Operations ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

03/05/07 - 03/18/07

Well Drilled Per attached Daily Operations Summary Report

*How much cement & top on prod. cog?
Please use current C103
from OED website! CGL*

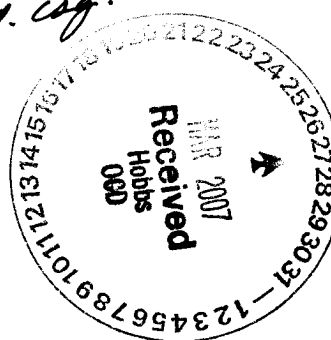

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Celeste G. Dale TITLE Regulatory Specialist DATE 03/23/2007

Type or print name Celeste G. Dale

E-mail address:

celeste.g.dale@conocophillips.com

Telephone No. (432)688-6884

(This space for State use)

APPROVED BY Chris Williams TITLE OCD DISTRICT SUPERVISOR/GENERAL MANAGER DATE 03/23/2007

Conditions of approval, if any:



Timelog Summary Report

VACUUM GLORIETA EAST UNIT 027-24

Common WellName VACUUM GLORIETA EAST UNIT 27-24		Primary Job Type DRILLING ORIGINAL		Job Category DRILLING	
Actual Start Date 3/6/2007	End Date 3/19/2007	Spud / KO Date 3/6/2007	Rig Accept Date 3/4/2007	Rig Release Date 3/18/2007	
Contractor SLEDGE DRILLING CORP			Rig Name/No SLEDGE 10		
Report Number 1		Report Start Date 3/5/2007		Report End Date 3/6/2007	

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	15:00	9.00	MOVE	MOB	MIRU	MOVE RIG TO THE VGEU PH 4 27-024. NOTE: AFTER LAYING DOWN DERRICK, BEAMS BELOW THE PULLEYS IN THE CROWN WERE FOUND CRUSHED. DECISION MADE TO MOVE TO LOCATION AND THE BEGIN REPAIRS.
15:00	21:00	6.00	MOVE	RGRP	MIRU	REPLACE/REPAIR DAMAGED EQUIPMENT IN THE CROWN.
21:00	06:00	9.00	MOVE	WODL	MIRU	WO DAYLIGHT TO RU.

Report Number 2		Report Start Date 3/6/2007			Report End Date 3/7/2007	
--------------------	--	-------------------------------	--	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	14:00	8.00	MOVE	RURD	SURFAC	FINISH RU.
14:00	15:00	1.00	DRILL	SFTY	SURFAC	RIG INSPECTION.
15:00	16:00	1.00	RIGMNT	RGRP	SURFAC	REPLACE WIRELINE FOR SURVEY TOOL.
16:00	17:00	1.00	DRILL	PULD	SURFAC	PU SURF BHA
17:00	00:15	7.25	DRILL	DRLG	SURFAC	SPUD WELL ON 03-06-2007 @ 1700 HRS. DRL F/70'-528'.
00:15	00:45	0.50	DRILL	SRVY	SURFAC	WLS @ 486' @ 0.25 DEG.
00:45	04:30	3.75	DRILL	DRLG	SURFAC	DRL F/528'-763'.
04:30	04:45	0.25	DRILL	SRVY	SURFAC	WLS @ 721' @ 0.5 DEG.
04:45	06:00	1.25	DRILL	DRLG	SURFAC	DRL F/763'-823'.

Report Number 3		Report Start Date 3/7/2007			Report End Date 3/8/2007	
--------------------	--	-------------------------------	--	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	08:45	2.75	DRILL	DRLG	SURFAC	DRL 12.25" HOLE F/823'-1014'.
08:45	09:00	0.25	DRILL	SRVY	SURFAC	WLS 972' @ 0.75 DEG.
09:00	13:45	4.75	DRILL	DRLG	SURFAC	DRL F/1014'-1266'.
13:45	14:00	0.25	DRILL	SRVY	SURFAC	WLS 1224' @ 0.75 DEG.
14:00	03:45	13.75	DRILL	DRLG	SURFAC	DRL F/1266'-1615' TD.
03:45	06:00	2.25	DRILL	CIRC	SURFAC	PUMP HIGH VIS SWEEP. CIRC & COND. ADD STARCH TO SYSTEM.

Report Number 4		Report Start Date 3/8/2007			Report End Date 3/9/2007	
--------------------	--	-------------------------------	--	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	10:30	4.50	DRILL	CIRC	SURFAC	CIRC & COND F/CSG.
10:30	13:15	2.75	DRILL	TRIP	SURFAC	WIPER TRIP.
13:15	14:45	1.50	DRILL	CIRC	SURFAC	CIRC SWEEP AND SPOT 50 BBL PILL ON BTM.
14:45	19:15	4.50	DRILL	TRIP	SURFAC	TOH W/BIT. LD STABILIZERS, REAMER & 8" DC'S.
19:15	19:30	0.25	CASING	SFTY	SURFAC	PJSM.
19:30	22:15	2.75	CASING	RNCS	SURFAC	RU CSG EQUIP. 8.625" 24# J-55 ST&C TOP TO BTM 36 CSG JTS PDC DRILLABLE FLOAT COLLAR @ 1556' 1 SHOE JT TX PATTERN GUIDE SHOE 15 CENTRALIZERS CSG SET @ 1602' RKB. RD CSG EQUIP.
22:15	22:30	0.25	CEMENT	SFTY	SURFAC	PJSM F/CMTG OPS. CIRC.
22:30	01:00	2.50	CEMENT	OTHR	SURFAC	TEST LINES TO 3000 PSI, PUMP 20 BBL FRSH WTR SPACER FOLLOWED W/650 SX 35/65 POZ C MIXED @ 12.8 PPG, 1.97 FT3/SX YIELD W/5% D44, 6% D20, 2% S1, 0.25 PPS D29 [CEMNET IN FIRST 50 BBLS] FOLLOWED W/260 SX CL C MIXED @ 14.8 PPG, 1.34 FT3/SX YIELD W/2% S1 & 0.25 PPS D29. DROP NON-ROTATING PLUG & DISP W/FRSH WTR. CIRC. 79 BBLS [225 SX] CMT TO SURE. BUMP PLUG TO 1054 PSI. REL PRESS. FLOAT HELD. RD SCHLUMBERGER.
01:00	04:00	3.00	CEMENT	WOC	SURFAC	WOC.
04:00	06:00	2.00	SURFEQ	NUND	SURFAC	CUTOFF CONDUCTOR-CSG. WELD ON CSGHEAD.

Report Number 5		Report Start Date 3/9/2007			Report End Date 3/10/2007	
--------------------	--	-------------------------------	--	--	------------------------------	--

Timelog Summary Report **VACUUM GLORIETA EAST UNIT 027-24**

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	08:00	2.00	TREBOP	OTHR	SURFAC	FINISH WELDING ON 8 5/8 x 11 5M CASING HEAD
08:00	12:45	4.75	TREBOP	NUND	SURFAC	NU BOP
12:45	14:45	2.00	TREBOP	WOEQ	SURFAC	WO BOP TESTER
14:45	15:00	0.25	TREBOP	SFTY	SURFAC	PJSM F/BOP TESTING.
15:00	20:00	5.00	TREBOP	PRTS	SURFAC	TEST ANNULAR, PIPE RAMS, BLIND RAMS, UPPER KELLY VALVES HIGH 3000 LOW 250 ALL TESTED OK
20:00	22:00	2.00	RIGMNT	RGRP	SURFAC	REPLACE WIRELINE.
22:00	03:00	5.00	DRILL	TRIP	PROD1	MU PDC BIT. TIH TO 1556'. TAG PLUG.
03:00	04:30	1.50	CEMENT	COCF	SURFAC	DRL PLUG & FLOAT COLLAR +20' CMT.
04:30	05:15	0.75	CASING	DHEQ	SURFAC	TEST CSG TO 1000 PSI- OK.
05:15	05:45	0.50	CEMENT	DRLG	SURFAC	FINISH DRLG SHOE.
05:45	06:00	0.25	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/1615'-1628'.

Report Number	6	Report Start Date	3/10/2007	Report End Date	3/11/2007
----------------------	---	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:15	0.25	CASING	SFEQ	PROD1	FIT TEST 250 PSI OK.
06:15	06:45	0.50	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/1628'-1637'.
06:45	07:15	0.50	DRILL	SRVY	PROD1	WLS 1595' @ 0.75 DEG.
07:15	11:30	4.25	DRILL	DRLG	PROD1	DRL F/1637'-1890'.
11:30	12:00	0.50	DRILL	SRVY	PROD1	WLS 1848' @ 0.5 DEG.
12:00	14:15	2.25	DRILL	DRLG	PROD1	DRL F/1890'-2112'.
14:15	14:45	0.50	DRILL	SRVY	PROD1	WLS 2070' @ 0.75 DEG.
14:45	17:30	2.75	DRILL	DRLG	PROD1	DRL F/2112'-2354'.
17:30	18:00	0.50	DRILL	SRVY	PROD1	WLS 2323' @ 0.5 DEG.
18:00	21:15	3.25	DRILL	DRLG	PROD1	DRL F/2354'-2617'.
21:15	21:45	0.50	DRILL	SRVY	PROD1	WLS 2575' @ 0.25 DEG.
21:45	01:30	3.75	DRILL	DRLG	PROD1	DRL F/2617'-2869'.
01:30	02:00	0.50	DRILL	SRVY	PROD1	WLS 2827' @ 0.5 DEG.
02:00	06:00	4.00	DRILL	DRLG	PROD1	DRL F/2869'-3030'.
DAYLIGHT SAVINGS TIME - MOVE CLOCK FORWARD 1 HR @ 0200 HRS.						

Report Number	7	Report Start Date	3/11/2007	Report End Date	3/12/2007
----------------------	---	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:30	0.50	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/3030'-3217'.
06:30	07:00	0.50	DRILL	SRVY	PROD1	WLS 3046' @ 1.75 DEG.
07:00	12:45	5.75	DRILL	DRLG	PROD1	DRL F/3090'-3217'.
12:45	14:00	1.25	RIGMNT	RGRP	PROD1	REPAIR KELLY SPINNER
14:00	14:15	0.25	WELCTL	BOPE	PROD1	BOP DRILL.
14:15	18:30	4.25	DRILL	DRLG	PROD1	DRL F/3217'-3311'.
18:30	19:00	0.50	DRILL	SRVY	PROD1	WLS 3269' @ 0.75 DEG.
19:00	02:00	7.00	DRILL	DRLG	PROD1	DRL F/3311'-3565'.
02:00	02:30	0.50	DRILL	SRVY	PROD1	WLS 3523' @ 1 DEG.
02:30	06:15	3.75	DRILL	DRLG	PROD1	DRL F/3565'-3725'.

Report Number	8	Report Start Date	3/12/2007	Report End Date	3/13/2007
----------------------	---	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	09:00	3.00	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/3725'-3850'.
09:00	09:45	0.75	DRILL	SRVY	PROD1	WLS 3774' @ 1 DEG.
09:45	18:00	8.25	DRILL	DRLG	PROD1	DRL F/3850'-4071'.
18:00	18:45	0.75	DRILL	SRVY	PROD1	WLS 4029' @ 1.5 DEG.
18:45	06:00	11.25	DRILL	DRLG	PROD1	DRL F/4071'-4330'.

Report Number	9	Report Start Date	3/13/2007	Report End Date	3/14/2007
----------------------	---	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	14:00	8.00	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/4330'-4608'.
14:00	14:45	0.75	DRILL	SRVY	PROD1	WLS 4566' @ 1 DEG.
14:45	20:30	5.75	DRILL	DRLG	PROD1	DRL F/4608'-4860'.
20:30	21:15	0.75	DRILL	SRVY	PROD1	WLS 4818' @ 1 DEG.
21:15	02:00	4.75	DRILL	DRLG	PROD1	DRL F/4860'-5080'.

Timelog Summary Report **VACUUM GLORIETA EAST UNIT 027-24**

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
02:00	02:45	0.75	DRILL	SRVY	PROD1	WLS 5035' @ 0.75 DEG.
02:45	06:00	3.25	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/5080'-5330'.

Report Number	10	Report Start Date	3/14/2007	Report End Date	3/15/2007
----------------------	----	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:45	0.75	DRILL	SRVY	PROD1	WLS @ 5286' - .75"
06:45	11:15	4.50	DRILL	DRLG	PROD1	DRILL F/ 5330' TO 5553'
11:15	12:00	0.75	DRILL	SRVY	PROD1	WLS @ 5509' - .75"
12:00	04:45	16.75	DRILL	DRLG	PROD1	DRILL F/ 5553' TO 6289'
04:45	06:00	1.25	DRILL	CIRC	PROD1	CIRC AND COND HOLE

Report Number	11	Report Start Date	3/15/2007	Report End Date	3/16/2007
----------------------	----	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	11:00	5.00	DRILL	CIRC	PROD1	MUD UP TO RUN ELOGS
11:00	19:00	8.00	DRILL	CIRC	PROD1	CIRC WHILE WAITING ON CORING TRUCK
19:00	23:00	4.00	DRILL	TRIP	PROD1	TOOH TO RUN ELOGS
23:00	00:00	1.00	EVALFM	SFTY	PROD1	PJSM- RU LOGGING CREW
00:00	06:00	6.00	EVALFM	ELOG	PROD1	RUN PLATFORM EXPRESS

Report Number	12	Report Start Date	3/16/2007	Report End Date	3/17/2007
----------------------	----	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	11:30	5.50	DRILL	SLKL	PROD1	PU TOOL'S F/ PLATFORM EXPRESS AND SIDEWALL CORE'S.
11:30	12:15	0.75	DRILL	WOEQ	PROD1	CORE TOOL'S WOULD'NT POWER UP. CHANGE TOOL'S.
12:15	13:00	0.75	DRILL	SLKL	PROD1	GIH W/ LOGGING TOOL'S F/ SIDEWALL CORE'S.
13:00	14:30	1.50	DRILL	SLKL	PROD1	CUT SIDEWALL CORE'S.
14:30	15:00	0.50	DRILL	SLKL	PROD1	PULL TOOL'S CHANGE CORE BIT.
15:00	18:00	3.00	DRILL	SLKL	PROD1	GIH W/ CORE TOOL'S. FINISH CUTTING CORE'S.
18:00	18:30	0.50	DRILL	PULD	PROD1	RD LOGGER'S.
18:30	22:00	3.50	DRILL	TRIP	PROD1	PJSM. TIH TO CIRC. F/ 5 1/2" CSG.
22:00	05:00	7.00	DRILL	TRIP	PROD1	PJSM. LDDP & DC'S.
05:00	06:00	1.00	CASING	RNCS	PROD1	PJSM. RU AND START RUNNING 5 1/2" CSG. PRODUCTION STRING.

Report Number	13	Report Start Date	3/17/2007	Report End Date	3/18/2007
----------------------	----	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	10:00	4.00	CASING	RNCS	PROD1	RUN 148 JT'S. J-55 5 1/2" 15.50# CASING. SET @ 6,279.0.
10:00	12:30	2.50	CEMENT	CIRC	PROD1	CIRC / WORK STRING
12:30	14:45	2.25	CEMENT	DISP	PROD1	PUMP CEMENT. DISPLACE W/ 2% KCL. PLUG DOWN @ 2:45 CST.
14:45	21:00	6.25	SURFEQ	NUND	PROD1	ND BOPE SET SLIPS ON 5 1/2 CSG. NU TUBING HEAD.
21:00	22:00	1.00	RIGMNT	RURD	PROD1	FINISH JETTING PIT'S. RIG RELEASED @ 10:00 PM CST.
22:00	06:00	8.00	RIGMNT	RURD	PROD1	RIG DOWN AND REPAIR.

Report Number	14	Report Start Date	3/18/2007	Report End Date	3/19/2007
----------------------	----	--------------------------	-----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:00	24.00	RIGMNT	RURD	PROD1	READY TO MOVE.