

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30-025-24914	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No. LG 1736	
7. Lease Name or Unit Agreement Name: Hugh 689-C	
8. Well No. 4	
9. Pool name or Wildcat Bagley N. Permo Penn	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
2. Name of Operator BTA Oil Producers	
3. Address of Operator 104 S. Pecos, Midland, TX 79701	
4. Well Location Unit Letter <u>O</u> : <u>660</u> feet from the <u>south</u> line and <u>1980</u> feet from the <u>east</u> line Section <u>6</u> Township <u>12S</u> Range <u>33E</u> NMPM Lea County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 4293' GL 4303 KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

BTA Oil Producers plans to P&A this well as follows:

1. Spot 50 sx cmt plug @ 8400-8300' - tag plug with wireline.
2. Cut and pull 5-1/2" casing @ est 7100' (top cmt @ 7250'; top scab liner @ 7178').
3. Spot 50 sx cmt plug @ 7050-6950' (5-1/2" stub). - TAG
4. Spot 65 sx @ 3775-3675' (8-5/8" shoe). - TAG
5. Spot 50 sx @ 2500-2400' (Yates).
6. Cut and pull 8-5/8" casing. Est top of cmt @ 1100'.
7. Spot 125 sx @ 450-350' (13-3/8" shoe). - TAG
8. Spot 10 sx @ surface.
9. Install dry hole marker.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

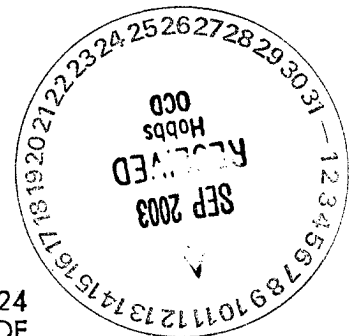

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Pam Inskeep TITLE Regulatory Administrator DATE 09/10/2003

Type or print name Pam Inskeep Telephone No. (432) 682-3753

(This space for State use)

APPROVED BY Larry W. Wink OCFIELD REPRESENTATIVE II/STAFF MANAGER DATE SEP 12 2003

Conditions of approval, if any: