

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-37852
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator ConocoPhillips Company		6. State Oil & Gas Lease No.
3. Address of Operator 3300 N. "A" St., Bldg. 6 Midland, TX 79705-5490		7. Lease Name or Unit Agreement Name Vacuum Glorieta East Unit
4. Well Location Unit Letter <u>G</u> : 1765 feet from the <u>N</u> line and <u>1585</u> feet from the <u>E</u> line Section <u>32</u> Township <u>17S</u> Range <u>35E</u> NMPM County <u>Lea</u>		8. Well Number 022
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3958 GR		9. OGRID Number 217817
Pit or Below-grade Tank Application ☐ or Closure ☐		
Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____		
Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Commence Drilling Operations/Set Casing/Cement ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

04/02/07 - 04/15/07

Well drilled per attached Daily Operations Summary Report. Rig released @ 0100 CST 04/15/07

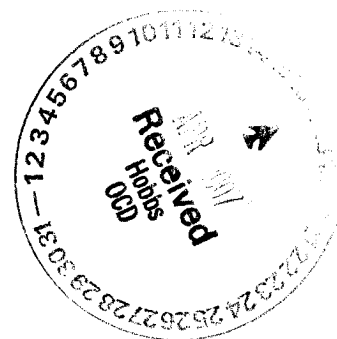

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Celeste G. Dale TITLE Regulatory Specialist DATE 04/16/2007

Type or print name Celeste G. Dale
For State Use Only

E-mail address: celeste.g.dale@conocophillips.com Phone No. (432) 688-6884
OC FIELD REPRESENTATIVE II/STAFF MANAGER

APPROVED BY: Harry W. Jink TITLE _____ DATE APR 23 2007
Conditions of Approval (if any):



Timelog Summary Report

VACUUM GLORIETA EAST UNIT PH 4 2-022

Common WellName VACUUM GLORIETA EAST UNIT PH 4 2-022		Primary Job Type DRILLING ORIGINAL		Job Category DRILLING	
Actual Start Date 4/2/2007	End Date 4/15/2007	Spud / KO Date 4/2/2007	Rig Accept Date 3/31/2007	Rig Release Date 4/15/2007	
Contractor SLEDGE DRILLING CORP			Rig Name/No SLEDGE RIG # 10		
Report Number 1		Report Start Date 4/2/2007		Report End Date 4/3/2007	

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	16:00	10.00	MOVE	MOB	MIRU	MIRU ON THE VGEU PH 4 2-022.
16:00	17:00	1.00	MOVE	SFTY	MIRU	RIG INSPECTION.
17:00	21:00	4.00	DRILL	DRLG	SURFAC	DRL 12.25" HOLE F/50'-286'.
21:00	21:15	0.25	DRILL	SRVY	SURFAC	WLS 244' @ 0.25 DEG.
21:15	23:45	2.50	DRILL	DRLG	SURFAC	DRL F/286'-483'.
23:45	00:00	0.25	DRILL	SRVY	SURFAC	WLS 483' @ 0.25 DEG.
00:00	02:30	2.50	DRILL	DRLG	SURFAC	DRL 7.875" F/483'-757'.
02:30	02:45	0.25	DRILL	SRVY	SURFAC	WLS 715' @ 1 DEG.
02:45	06:00	3.25	DRILL	DRLG	SURFAC	DRL F/757'-990'.

Report Number 2		Report Start Date 4/3/2007		Report End Date 4/4/2007	
--------------------	--	-------------------------------	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:30	0.50	DRILL	DRLG	SURFAC	DRL 12.25" HOLE F/990'-1010'.
06:30	06:45	0.25	DRILL	SRVY	SURFAC	WLS 965' @ 1 DEG.
06:45	13:00	6.25	DRILL	DRLG	SURFAC	DRL F/1010'-1231'.
13:00	13:15	0.25	DRILL	SRVY	SURFAC	WLS 1187' @ 1 DEG.
13:15	17:15	4.00	DRILL	DRLG	SURFAC	DRL F/1231'-1358'.
17:15	18:30	1.25	RIGMNT	RGRP	SURFAC	WORK ON PUMP #1. SWAB WASHED OUT.
18:30	23:45	5.25	DRILL	DRLG	SURFAC	DRL F/1358'-1484'.
23:45	00:00	0.25	DRILL	SRVY	SURFAC	WLS 1442' @ 0.5 DEG.
00:00	06:00	6.00	DRILL	DRLG	SURFAC	DRL F/1484'-1575'.

Report Number 3		Report Start Date 4/4/2007		Report End Date 4/5/2007	
--------------------	--	-------------------------------	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	09:00	3.00	DRILL	DRLG	SURFAC	DRL 12.25" HOLE F/1575'-1610'.
09:00	14:15	5.25	DRILL	CIRC	SURFAC	PUMP 50 BBL HIGH VIS SWEEP. STARCH UP. CIRC & COND F/CSG.
14:15	17:30	3.25	DRILL	TRIP	SURFAC	WIPER TRIP.
17:30	18:30	1.00	DRILL	CIRC	SURFAC	CIRC. DROP SURVEY.
18:30	21:00	2.50	DRILL	TRIP	SURFAC	TOH W/BIT. LD STABILIZERS, SHOCK SUB, REAMER & 8" DC'S. SURVEY 1610' @ 0.5 DEG.
21:00	21:15	0.25	CASING	SFTY	SURFAC	PJSM F/CSG OPS.
21:15	00:15	3.00	CASING	RNCS	SURFAC	RU CSG EQUIP. 8.625" 24# J-55 ST&C TOP TO BTM 36 CSG JTS PDC DRILLABLE FLOAT COLLAR @ 1559' 1 SHOE JT TX PATTERN GUIDE SHOE 13 CENTRALIZERS CSG SET @ 1606' RKB. RD CSG EQUIP.
00:15	02:00	1.75	CEMENT	WOSP	SURFAC	WO HES TO OFFLOAD CMT TO STORAGE UNITS.
02:00	02:15	0.25	CEMENT	SFTY	SURFAC	PJSM F/CMTG OPS. CIRC.
02:15	04:45	2.50	CEMENT	OTHR	SURFAC	RU HES. TEST LINES TO 3000 PSI, PUMP 20 BBL FRSH WTR SPACER FOLLOWED W/620 SX LIGHT PREM+ MIXED @ 12.8 PPG, 1.85 FT3/SX YIELD W/2% CACL2 & 0.125 PPS FLAKES FOLLOWED W/230 SX PREM+ MIXED @ 14.8 PPG, 1.35 FT3/SX YIELD W/2% CACL2 & 0.125 PPS FLAKES. DROP NON-ROTATING PLUG & DISP W/100 BBLs FRSH WTR. CIRC. 60 BBLs [182 SX] CMT TO SURF. BUMP PLUG TO 1130 PSI. REL PRESS. FLOAT HELD. RD HES.
04:45	06:00	1.25	CEMENT	WOC	SURFAC	WOC.

Report Number 4		Report Start Date 4/5/2007		Report End Date 4/6/2007	
--------------------	--	-------------------------------	--	-----------------------------	--

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	08:00	2.00	CEMENT	WOC	PROD1	WOC
08:00	09:45	1.75	TREBOP	OTHR	SURFAC	FINISH WELDING ON 8 5/8 x 11 5M CASING HEAD. TEST 750 PSI 15 MINS. OK.
09:45	15:00	5.25	TREBOP	NUND	SURFAC	NU BOP

Timelog Summary Report **VACUUM GLORIETA EAST UNIT PH 4 2-022**

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
15:00	15:15	0.25	TREBOP	SFTY	SURFAC	PJSM F/BOP TESTING.
15:15	22:00	6.75	TREBOP	PRTS	SURFAC	PIPE RAMS, BLIND RAMS, UPPER KELLY VALVES HIGH 3000 LOW 250 ANNULAR 2000 HIGH 250 LOW TEST ACCUMULATOR TEST PUMP VALVES ALL TESTED OK
22:00	02:45	4.75	DRILL	TRIP	PROD1	MU PDC BIT. TIH TO 1559'. TAG PLUG.
02:45	03:15	0.50	CEMENT	COCF	SURFAC	DRL PLUG & FLOAT COLLAR +20' CMT.
03:15	03:45	0.50	CASING	DHEQ	SURFAC	TEST CSG TO 1000 PSI- OK.
03:45	04:00	0.25	CEMENT	DRLG	SURFAC	FINISH DRLG SHOE.
04:00	04:15	0.25	DRILL	DRLG	PROD1	DRL 7.875" HOLE F/1610'-1620'.
04:15	04:30	0.25	DRILL	FIT	PROD1	FIT 250 PSI.
04:30	06:00	1.50	DRILL	DRLG	PROD1	DRL F/1620'-1687'.

Report Number	5	Report Start Date	4/6/2007	Report End Date	4/7/2007
----------------------	---	--------------------------	----------	------------------------	----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	10:00	4.00	DRILL	DRLG	PROD1	DRL F/1687'-1884'
10:00	10:30	0.50	DRILL	SRVY	PROD1	WLS @ 1846'- .05 DEG.
10:30	13:30	3.00	DRILL	DRLG	PROD1	DRL F/1888'-2111'
13:30	13:45	0.25	DRILL	SRVY	PROD1	WLS @ 2070'- .75 DEG
13:45	16:45	3.00	DRILL	DRLG	PROD1	DRL F/2111'-2366'
16:45	17:00	0.25	DRILL	SRVY	PROD1	WLS @ 2323'- 1.50 DEG
17:00	20:00	3.00	DRILL	DRLG	PROD1	DRL F/2366'-2620'
20:00	20:15	0.25	DRILL	SRVY	PROD1	WLS @ 2576'-1.75 DEG
20:15	22:30	2.25	DRILL	DRLG	PROD1	DRL F/2620'-2716'
22:30	22:45	0.25	DRILL	SRVY	PROD1	WLS @ 2713'- 1.75 DEG
22:45	02:30	3.75	DRILL	DRLG	PROD1	DRL F/2716'-2843'
02:30	03:00	0.50	DRILL	SRVY	PROD1	WLS @ 2797'- 2.25 DEG
03:00	06:00	3.00	DRILL	DRLG	PROD1	DRL F/2843'-2902'

Report Number	6	Report Start Date	4/7/2007	Report End Date	4/8/2007
----------------------	---	--------------------------	----------	------------------------	----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	09:00	3.00	DRILL	DRLG	PROD1	DRL F/2902'-2933'
09:00	09:30	0.50	DRILL	SRVY	PROD1	WLS @ 2890'-1.75 DEG.
09:30	15:30	6.00	DRILL	DRLG	PROD1	DRL F/2933'-3024'
15:30	16:00	0.50	DRILL	SRVY	PROD1	WLS @ 2987'-2.00 DEG.
16:00	20:00	4.00	DRILL	DRLG	PROD1	DRL F/3024'-3079'-3122'
20:00	20:15	0.25	DRILL	SRVY	PROD1	WLS @ 3081'-1.75 DEG.
20:15	05:45	9.50	DRILL	DRLG	PROD1	DRL F/3122'-3280'
05:45	06:00	0.25	DRILL	SRVY	PROD1	WLS @ 3240'-1.25 DEG.

Report Number	7	Report Start Date	4/8/2007	Report End Date	4/9/2007
----------------------	---	--------------------------	----------	------------------------	----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	13:00	7.00	DRILL	DRLG	PROD1	DRL F/3280'-3407'
13:00	13:30	0.50	DRILL	SRVY	PROD1	WLS 3366' @ 1.50DEG.
13:30	19:00	5.50	DRILL	DRLG	PROD1	DRL F/3407'-3531'
19:00	19:30	0.50	DRILL	SRVY	PROD1	WLS 3493' @ 1.00 DEG.
19:30	02:30	7.00	DRILL	DRLG	PROD1	DRL F/3531'-3785'
02:30	03:00	0.50	DRILL	SRVY	PROD1	WLS 3746' @ 0.75 DEG.
03:00	06:00	3.00	DRILL	DRLG	PROD1	DRLF/3785'-3911'

Report Number	8	Report Start Date	4/9/2007	Report End Date	4/10/2007
----------------------	---	--------------------------	----------	------------------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	08:45	2.75	DRILL	DRLG	PROD1	DRL F/3911'-4042'
08:45	09:30	0.75	DRILL	SRVY	PROD1	WLS @ 3999'-1.0 DEG.
09:30	17:15	7.75	DRILL	DRLG	PROD1	DRL F/4042'-4291'
17:15	18:00	0.75	DRILL	SRVY	PROD1	WLS @ 4253'-1.0 DEG.
18:00	23:45	5.75	DRILL	DRLG	PROD1	DRL F/4291'-4548'
23:45	00:30	0.75	DRILL	SRVY	PROD1	WLS @ 4505'-1.25 DEG.
00:30	05:15	4.75	DRILL	DRLG	PROD1	DRL F/4520'-4800'

Timelog Summary Report

VACUUM GLORIETA EAST UNIT PH 4 2-022

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
05:15	06:00	0.75	DRILL	SRVY	PROD1	WLS @ 4759'-1.0 DEG.
Report Number 9			Report Start Date 4/10/2007			Report End Date 4/11/2007

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	12:45	6.75	DRILL	DRLG	PROD1	DRILL F/4800'-5117'
12:45	13:30	0.75	DRILL	SRVY	PROD1	WLS @ 5075'-1.25 DEG.
13:30	19:30	6.00	DRILL	DRLG	PROD1	DRILL F/5117'-5370'
19:30	20:15	0.75	DRILL	SRVY	PROD1	WLS @ 5328'-1.75 DEG.
20:15	01:30	5.25	DRILL	DRLG	PROD1	DRILL F/5370'-5532'
01:30	02:15	0.75	DRILL	SRVY	PROD1	WLS @ 5478'-1.75 DEG.
02:15	06:00	3.75	DRILL	DRLG	PROD1	DRL F/5532'-5651'
Report Number 10			Report Start Date 4/11/2007			Report End Date 4/12/2007

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	09:30	3.50	DRILL	DRLG	PROD1	DRL F/5651'-5783'
09:30	10:15	0.75	DRILL	SRVY	PROD1	WLS @ 5737'-1.0 DEG.
10:15	16:45	6.50	DRILL	DRLG	PROD1	DRL F/5737'-5939'
16:45	17:30	0.75	DRILL	SRVY	PROD1	WLS @ 5895'-1.25 DEG.
17:30	22:30	5.00	DRILL	DRLG	PROD1	DRL F/5936'-6094'
22:30	23:15	0.75	DRILL	SRVY	PROD1	WLS @ 6052'-1.75 DEG.
23:15	06:00	6.75	DRILL	DRLG	PROD1	DRL F/6052'-6288'
Report Number 11			Report Start Date 4/12/2007			Report End Date 4/13/2007

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	08:45	2.75	DRILL	DRLG	PROD1	DRILL F/ 6288' TO 6350'
08:45	14:45	6.00	DRILL	CIRC	PROD1	PUMP SWEEPS & MUD UP FOR ELOGS
14:45	19:15	4.50	DRILL	TRIP	PROD1	TOOH & LD BHA FOR ELOGS
19:15	23:00	3.75	EVALFM	WOEQ	PROD1	WAIT ON LOGGING CREW
23:00	00:30	1.50	EVALFM	SFTY	PROD1	PJSM & RU LOGGING CREW
00:30	04:00	3.50	EVALFM	DHEQ	PROD1	TEST TOOLS- WAIT ON NEW TOOL
04:00	06:00	2.00	EVALFM	ELOG	PROD1	LOG WELL W/ PLATFORM EXPRESS
Report Number 12			Report Start Date 4/13/2007			Report End Date 4/14/2007

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	10:30	4.50	EVALFM	ELOG	PROD1	LOG WELL W/ PLATFORM EXPRESS- SONIC TOOL NOT WORKING
10:30	11:45	1.25	EVALFM	SFTY	PROD1	PJSM- RD LOGGING CREW
11:45	13:00	1.25	WELCTL	KLWL	PROD1	WELL KICKED W/ DS OUT OF HOLE
13:00	21:00	8.00	WELCTL	STRP	PROD1	TIH W/ DS- INTERMITTENTLY STOPPING TO CIRCULATE GAS OUT TO CONTINUE TIH
21:00	00:00	3.00	WELCTL	CIRC	PROD1	CIRC HOLE- WAIT ON 12# MUD & LD CREW
00:00	01:15	1.25	WELCTL	OTHR	PROD1	SPOT HI VISC & WEIGHTED MUD- PJSM- RU LD MACHINE
01:15	01:30	0.25	DRILL	RURD	PROD1	FINISH RU LD MACHINE
01:30	06:00	4.50	DRILL	PULD	PROD1	LD DP & DC'S
Report Number 13			Report Start Date 4/14/2007			Report End Date 4/15/2007

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	07:30	1.50	DRILL	PULD	PROD1	FINISH LD DC'S
07:30	09:00	1.50	CASING	SFTY	PROD1	PJSM- RU CASING CREW
09:00	13:30	4.50	CASING	RNCS	PROD1	RUN 156 JTS OF 5.500" 15.5# J-55 LT&C CASING AS FOLLOWS FROM TOP TO BOTTOM: 104- JTS 5.500" CASING 2- MARKER JOINTS 38- JTS 5.500" CASING 2- MARKER JOINTS 9- JTS 5.500" CASING 1- FLOAT COLLAR 1- JT 5.500" CASING (SHOE JOINT) 1- FLOAT SHOE CASING SET @ 6339'
13:30	15:00	1.50	CASING	SFTY	PROD1	PJSM- RD CASING CREW & LD MACHINE



Timelog Summary Report

VACUUM GLORIETA EAST UNIT PH 4 2-022

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
15:00	15:30	0.50	CEMENT	SFTY	PROD1	PJSM- RU CEMENT CREW
15:30	17:30	2.00	CEMENT	DISP	PROD1	CEMENT 5.500" CSG AS FOLLOWS: 20 BBLS FRESH WATER AHEAD 1150 SKS INTERFILL C + ADDITIVES 11.8 PPG- 2.52 YIELD- 14.6 GAL/SK 500 SKS 50/50 POZ H + ADDITIVES 14.2 PPG- 1.35 YIELD- 6.13 GAL/SK 150 BBLS 2% KCl DISPLACEMENT BUMPED PLUG W/ 2268 PSI CIRC 152 SKS 68 BBLS TO SURFACE
17:30	18:00	0.50	CEMENT	SFTY	PROD1	PJSM- RD CEMENT CREW & WATCH WELL FOR FLOW
18:00	18:30	0.50	TREBOP	SFTY	PROD1	PJSM- RU LIFT WINCHES
18:30	21:30	3.00	TREBOP	NUND	PROD1	LIFT BOP- SET SLIPS- CUT OFF CSG- ND BOP- NU TBG HEAD
21:30	22:00	0.50	TREBOP	PRTS	PROD1	TEST TBG HEAD- OK
22:00	01:00	3.00	MOVE	RURD	PROD1	JET & CLEAN PITS- RELEASE RIG @ 0100 CST 4/15/07
01:00	06:00	5.00	MOVE	RURD	PROD1	RD RT

Report Number	14	Report Start Date	4/15/2007	Report End Date	4/16/2007
---------------	----	-------------------	-----------	-----------------	-----------

Time Log

Start Time	End Time	Dur (hrs)	Op Code	OpSub-Code	Phase	Operation
06:00	06:00	24.00	MOVE	RURD	PROD1	PREP RIG TO MOVE TO THE VGEU PH4 02-21