

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-25246
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	H.T. MATTERN NCT-B
8. Well No.	22
9. Pool Name or Wildcat	BLINEBRY OIL AND GAS (OIL)
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3496' GL

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI
(FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>B</u> : <u>785'</u> Feet From The <u>NORTH</u> Line and <u>2310'</u> Feet From The <u>EAST</u> Line Section <u>31</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3496' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ ADD PERFS & STIMULATE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-27-07: MIRU.
3-28-07: PU TBG & TAG UP @ 5863. DRILL LIKE SCALE FOR 10'. COULDN'T GET CIRC.
3-30-07: MIRU FOAM AIR UNIT. TAG @ 5863. BREAK CIRC. DRILL TO 5872. FELL OUT OF PLUG. TAG @ 6112. DRILL TO 6130.
4-02-07: TAG @ 6130'.
4-03-07: PERF BLINEBRY 5954-62, 5868-76, 5824-32, 5784-92, 5757-65, 5732-38, 5718-22, 5696-5704, 5676-84, 5660-68, 5645-53, 5620-28, 5592-5600, 5566-74, 5552-60, 5540-46, 5520-28, 5494-5502, 5464-72.
4-04-07: TIH W/PKR & SET @ 6000. REL PKR.
4-05-07: ACIDIZE PERFS 5464-5962 W/3800 GALS 15% HCL. TIH W/PKR & SET @ 5424. SN @ 5418.
4-06-07: SWABBING.
4-09-07: REL PKR. MI 3 1/2" FRAC TBG. TIH W/FRAC PKR. SET PKR @ 5005.
4-11-07: FRAC PERFS W/3000 GALS 2% KCL WTR, & 88,000 GALS YF130.
4-12-07: REL PKR. TIH & TAG SAND @ 5940.
4-13-07: C/O SAND FR 5940-6144. PUH TO ABOVE PERFS.
4-16-07: TIH W/PKR & SET @ 5400. RU SWAB.
4-17-07: RUN PRISM LOG THRU PERFS. TAG @ 6129.
4-18-07: REL PKR.
4-19-07: PUT SUB PUMP TOGETHER. TIH W/176 JTS 2 7/8" TBG. LAND SUB PUMP. RIG DOWN. FINAL REPORT

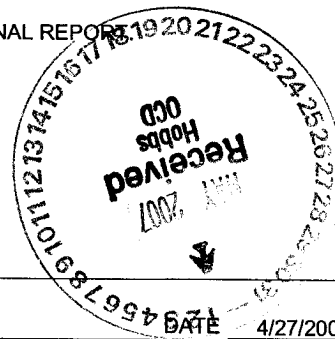

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist

TYPE OR PRINT NAME Denise Pinkerton

Telephone No. 432-687-7375

(This space for State Use)

APPROVED Lucy W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER
CONDITIONS OF APPROVAL, IF ANY:

DATE

MAY 07 2007
DeSoto/Nichols 12-93 ver 1.0