

Submit 3 Copies To Appropriate District

Office

District I

1625 N. French Dr., Hobbs, NM 87240

District II

811 South First, Artesia, NM 87210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-03288
1. Type of Well: Oil Well ☐ Gas Well ☐ Other ☐ Injection ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Xeric Oil & Gas Corporation		6. State Oil & Gas Lease No. E5841
3. Address of Operator P. O. Box 352 Midland, TX 79702		7. Lease Name or Unit Agreement Name: West Pearl Queen Unit
4. Well Location Unit Letter <u>F</u> : 1980 feet from the <u>North</u> line and 1980 feet from the <u>West</u> line Section <u>33</u> Township <u>19S</u> Range <u>35E</u> NMPM <u>Lea</u> County		8. Well No. 146
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3702' GL		9. Pool name or Wildcat Pearl Queen

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☒	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- 1) MIRU Pulling Unit.
- 2) Circulate hole w/+/- 60 bbls mud.
- 3) Spot 25 sx of Class C cement @ 4650' & tag.
- 4) Spot 25 sx of Class C cement @ 1700'.
- 5) Perforate @ 175' & squeeze 50' out and circulate to surface.
- 6) Circulate 10 sx Class C cement @ 60' to surface.
- 7) RD. Install dry hole marker & clean location.

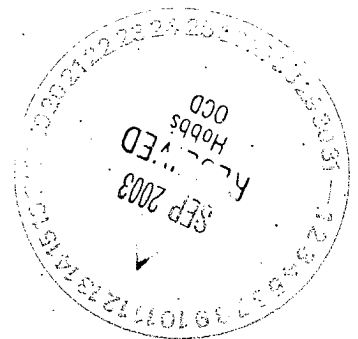

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Angie Crawford TITLE Production Analyst DATE 9/10/03
Angie Crawford

Type or print name Telephone No.

(This space for State use)

APPROVED BY Harry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE SEP 15 2003
Conditions of approval, if any

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

XERIC OIL & GAS CORP.
WELLBORE DIAGRAM

WELL: West Pearl Queen #146


COUNTY: Lea

STATE: NM

HOLE SIZE: 12 1/4"
CASING: 8 5/8" @ 146'
CEMENTED WITH: 100 SX
CEMENT TOP: Surface

TUBING: _____
RODS: _____
PUMP: _____
PACKER: _____

HOLE SIZE: 7 7/8"
CASING: 4 1/2" @ 4965'
CEMENTED WITH: 250 SX
CEMENT TOP: 3823'

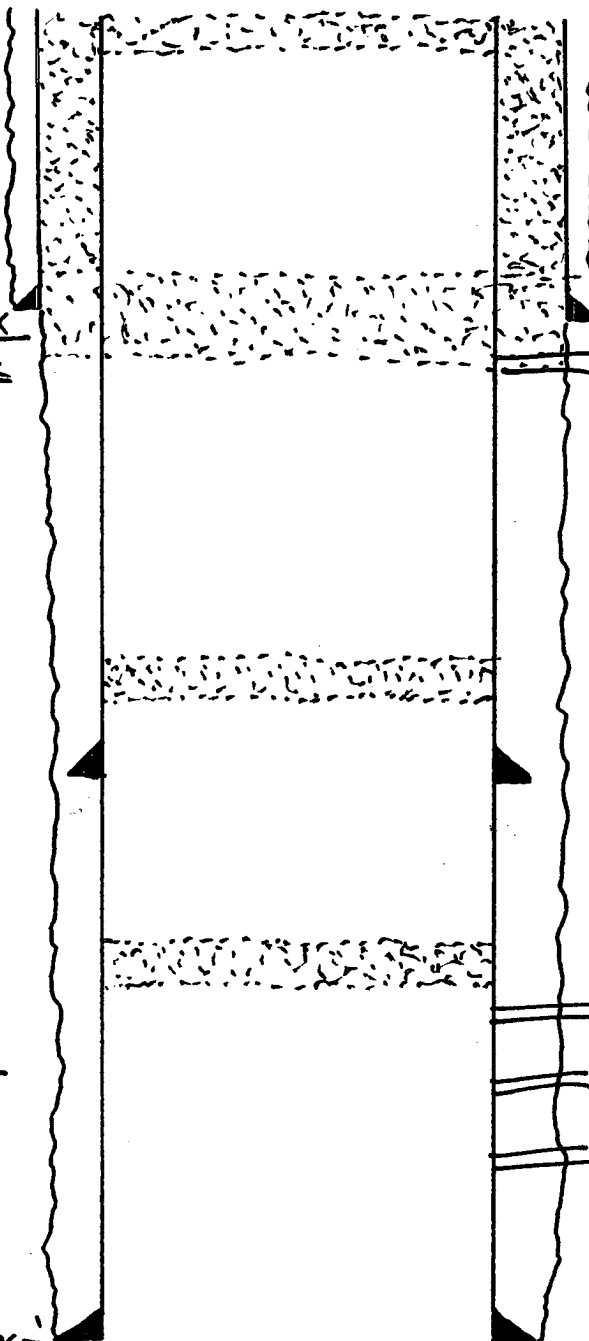

Perf @ 175'

DV Tool @ 1883' w/ 50 SX
TOC @ 1598'

PERFS:
4767'-82'
4880'-82'
4927'-29'

PBTD: 4961'
TD: 4970'