State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 5-27-2004

FILE IN TRIPLICATE	OIL CONSERVA	TION DIVISION		
DISTRICT I 1625 N. French Dr., Hobbs, NM 88240	1220 South S Santa Fe, 1		WELL API NO. 30-025-0	7469
DISTRICT II			5. Indicate Type of Lease	
1301 W. Grand Ave, Artesia, NM 88210			STATE	FEE X
DISTRICT III			6. State Oil & Gas Lease No.	
1000 Rio Brazos Rd, Aztec, NM 87410	3 42			
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit Agreem	ent Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			North Hobbs (G/SA) Unit	
DIFFERENT RESERVOIR. USE "APLICATION FOR PERMIT" (Form G101) for such proposals.)			Section 30	
1. Type of Well: Oil Well	Gas Well Other Ten	porarily Abandoned	8. Well No. 311	
2. Name of Operator			9. OGRID No. 157984	
Occidental Permian Ltd. 3. Address of Operator			10. Pool name or Wildcat	Hobbs (G/SA)
HCR 1 Box 90 Denver City, TX 793.	323			110003 (0/5/1)
4. Well Location				
Unit Letter B : 330 F	Feet From The North	2310 Feet	From The East	Line
Section 30	Township 18-S	Range 38-E	NMPM	Lea County
	 Elevation (Show whether DF, RKE 3658' GL 	t, RI GR, etc.)		PRESENTATION OF THE PERSON OF
Pit or Below-grade Tank Application	or Closure			
Pit Type Depth of Ground Water Distance from nearest fresh water well Distance from nearest surface water				
Pit Liner Thickness mil Below-Grade Tank: Volume bbls; Construction Material				
12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data				
NOTICE OF INTENT	FION TO:	SUBS	EQUENT REPORT OF	•
PERFORM REMEDIAL WORK PL	UG AND ABANDON	REMEDIAL WORK	ALTERING	CASING
TEMPORARILY ABANDON CH	HANGE PLANS	COMMENCE DRILLING OP	IS. DLUG & A	BANDONMENT
PULL OR ALTER CASING Mu	ultiple Completion	CASING TEST AND CEMEN	Т ЈОВ	
OTHER:		OTHER: Squeeze casir	ig leak/TA status	X


 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. RUPU. ND wellhead/NU BOP. Test CIBP @3950' to 1000#. OK. 				
3. RIH w/tension packer. Locate leak in casing from 157-188'.				
4. RU wireline & perforate squeeze @500'		i Dlag som out av/20/ Co	1 Chlorida Diamboo A/1 1/2	hhl of fresh water
5. RIH w/packer set @474'. RU HES. Mixed & pumped 350 sxs of Premium Plus cement w/3% Cal Chloride. Displace \(\frac{\psi}{1-1/2}\) bbl of fresh water. Top of cement approx 30'. RD HES. This Approval of Temporary				
6. RIH w/bit & drill collars. Tag @94'. Abandonment Expires				
7. Drill on cement from 94'-550'. Circ we	ell clean.	ADAIIGDIIII -	, , ,	
8. RIH & tag @3943'. Test casing to 500#				
9. POOH w/bit & drill collars. Lay down t	tubing.	***see additional data on	attached cheet***	
10. ND BOP/NU blind flange.		See additional data of	anabileu sileet	
I hereby certify that the information above is true as	and complete to the best of my knowle	edge and belief. Ifurther certify	hat any pit or below-grade tank ha	s been/will be
constructed or closed according to NMOCD guidelines	, a general permit	or an (attached) alternative	OCD-approved	
Mand 1	The Colombia	plan TITLE Administrative	Associate DATE	05/02/2007
SIGNATURE I I I I I I I I I I I I I I I I I I I	7 91 U 100 V		135001.000	05/02/2007
TYPE OR PRINT NAME Mendy A. Johnson		mendy_johnson@oxy.com	TELEPHONE NO.	806-592-6280
APPROVED BY LAW WINE OCTHELD REPRESENTATIVE II/STAFF MANAGER DATE MAY 1 6 2007				
CONDITIONS OF APPROVAL F ANY:			·····	
√				

NHU 30-311 05/02/2007

- 11. Test casing to 520# for 30 minutes and chart for the NMOCD.12. RDPU. Clean location.

Well is temporarily abandoned.

RUPU 02/13/07 RDPU 04/23/07

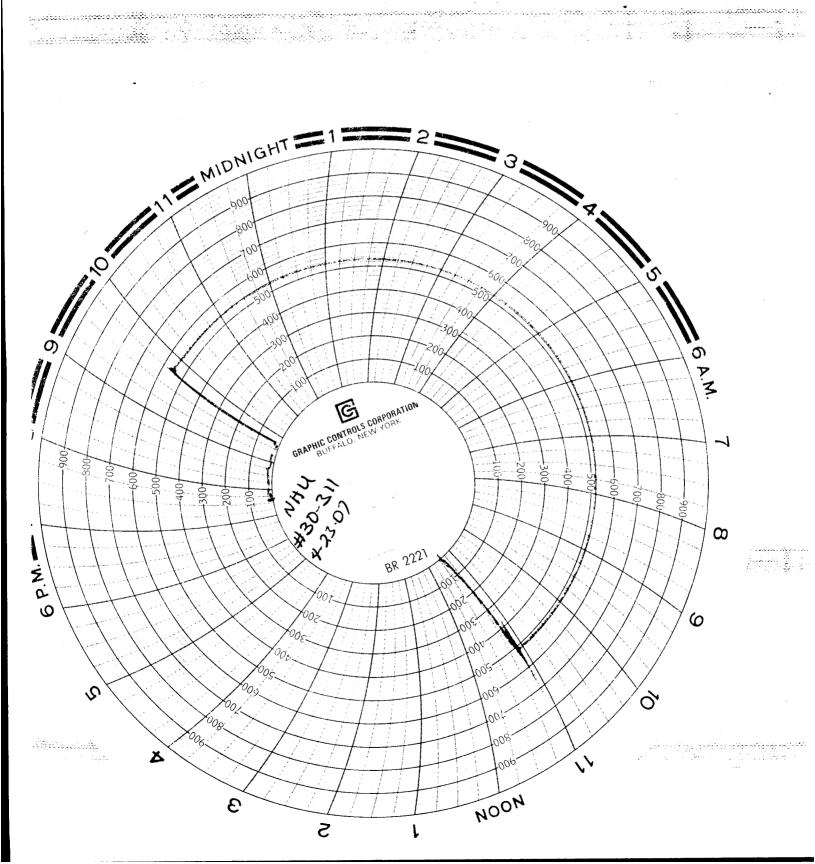

C. 2 / isology with a crown of the strict of