

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-00519
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Mar Oil and Gas Corp.		6. State Oil & Gas Lease No.
3. Address of Operator PO Box 5155, Santa Fe, NM 87502		7. Lease Name or Unit Agreement Name: MalMar Unit
4. Well Location Unit Letter I 1980 feet from the South line and 660 feet from the East line Section 12 Township 17S Range 32E NMPM County: Lea		8. Well No. 309
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 151228
Pit or Below-grade Tank Application ☐ or Closure ☐		10. Pool name or Wildcat Maljamar Grayburg/ San Andres
Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____		
Pit Liner Thickness: _____ mil. Below-Grade Tank: Volume _____ bbls; Construction Material _____		


12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P. AND A. ☒
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING/CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

6/15/07 MIRU.
6/18/07 RIH w/ tbg. to 4100'. Circulate hole with mud laden fluid. Spot 25 sx @ 4100. POH w/ 30 jts. tbg. WOC overnight.
6/19/07 Tagged plug @ 4060' POH to 2100. WIH w/ wireline and perf. csg. @ 2550. Set packer and Sqz. 50 sx. WOC overnight.
6/20/07 Tagged plug @ 2430'. COH to 900 ft. RIH w/ wireline and perf csg. @ 1470'. Set packer and Sqz. 50 sx. cement. WOC 4 hrs. Tagged plug @ 1390'. POH w/ tbg. and packer. Perf csg. @ 300'. Put flange on head and Sqz. 110 sx. and circulated to surface. Cut off wellhead and Weld on Dry Hole Marker. Rig down and clean location.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

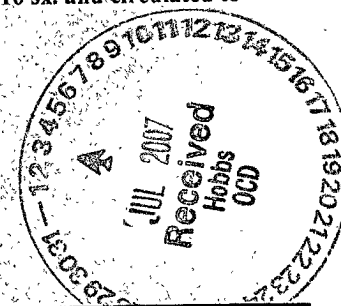

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOC guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Billy E. Prichard TITLE Foreman DATE 6/29/07
Type or print name Billy E. Prichard E-mail address: shabillron01@warpdiveonline.com Telephone No. 505-390-9100

APPROVED BY Ray W. Wink FIELD REPRESENTATIVE II/STAFF MANAGER DATE _____
Conditions of Approval (if any): _____

JUL 05 2007