

Eugene Coates No. 5
Lea County, New Mexico
Temporary Abandonment Procedure
October 9, 2003

Charge Work To: UWPNM-R3117

1. MIRUSU. Install 3000 psi manual BOP.
2. Pull rods, pump and tubing.
3. RIH with casing scrapper on a 2-7/8" workstring. Clean out casing to 3,180'. TOH.
4. RIH w/ 7" CIBP and set plug at 3,180'. Spot 35' of cement on top of CIBP. Notify OCD and perform casing integrity test to 1,000 psi.
5. RDMOSU.
6. File reports with the OCD.

Langlie Mathis

CURRENT WELL DATA SHEET

Field: Jalmat Well Name: Eugene Coates #5
Location: 1980' FSL & 660' FEL Sec: 3-1 Township: 24S
County: Lea State: New Mexico Refno: FB0547 API: 30-025-09509
Current Status: PS
Current Producing Formation(s): Seven Rivers-Queen-Grayburg

Lease Type: Fee
Range: 36E
Cost Center: UCU338500

Surface Csg.

Size: 13"
Wt.: 45#
Set @: 299'
Sxs cmt: 225
Hole: 15 1/2"
TOC: surface


Intermediate Csg.

Size: 9 5/8"
Wt.: 36#
Set @: 2921'
Sxs cmt: 775
Hole: 11"
TOC: surface

Production Csg.

Size: 7"
Wt.: 24#
Set @: 3496'
Sxs Cmt: 200
Hole: 8 1/4"
TOC: 1227'

| | |
|-----------|-------|
| Top Salt | 1510' |
| Base Salt | 2717' |

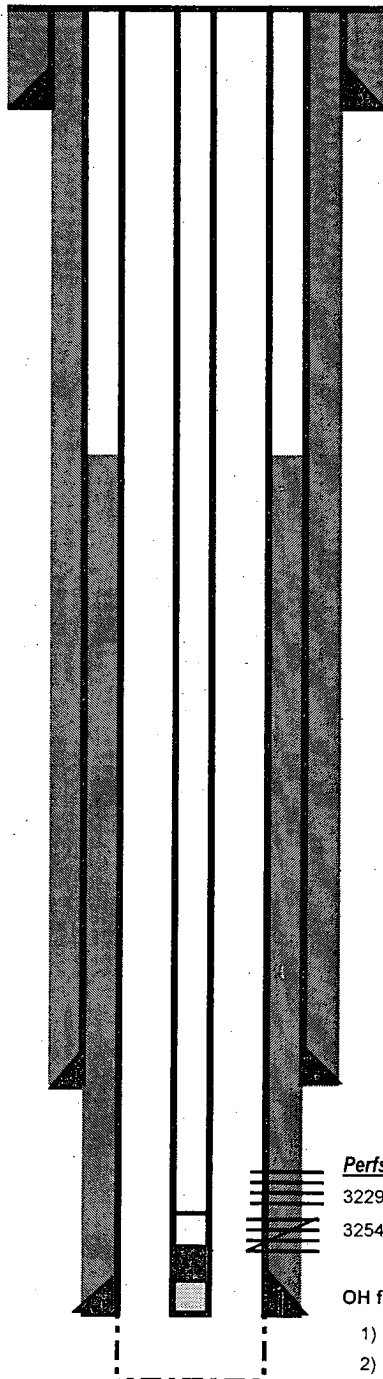

KB:
DF: 3385'
GL:
Spud Date: 5/25/1936
Compl. Date: 7/23/1936

Perfs

3229-3237' - open
3254-3258' - squeezed

OH fr/ 3496-3689'

- 1) TD to 3659' (7/23/36)
- 2) TD to 3689' (7/13/66)

PBTD:
TD: 3689'

Prepared by: K M Jackson
Date: 10/8/2003