

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-025-35235
Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
State Oil & Gas Lease No. V-2512
Lease Name or Unit Agreement Name Shell State
Well No. 6
Pool name or Wildcat W. Red Tank Delaware

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
Name of Operator Pogo Producing Company	
Address of Operator P. O. Box 10340, Midland, TX 79702-7340	
Well Location Unit Letter <u>L</u> : <u>2310</u> Feet From The <u>South</u> Line and <u>330</u> Feet From The <u>West</u> Line Section <u>36</u> Township <u>22</u> Range <u>32</u> NMPM <u>Lea</u> County <u></u>	
Elevation (Show whether DF, RKB, RT, GR, etc.) 3757'	

11

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ANBANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Add Pay ☒

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

09/15/03 POH w/ rods, pump & tbq. Set CIBP @ 8450'.
09/16/03 Test CIBP to 3000# ok. Acdz w/ 1200 gals 7-1/2 % acid.
09/17/03 Perf Delaware 7608-16 w/ 2 spf.
09/18/03 RIH w/ RBP & set @ 7800'. Test to 3000# ok. Acdz w/ 750 gals 7-1/2% acid. Swab.
09/19/03 Perf Delaware 7350-56 w/ 2 spf. Rel RBP @ 7800' & PUH to 7469'. Test to 3000# ok.
09/20/03 Acdz w/ 750 gals 7-1/2% acid. Swab.
09/22/03 Perf Delaware 7024-30 w/ 2 spf.
09/23/03 Latch onto RBP @ 7469' & PUH to 7200'. Test to 3000# ok. Acdz w/ 750 gals 7-1/2% acid.
09/24/03 Perf Delaware 6352-62 w/ 2 spf. Latch onto RBP @ 7200' & PUH to 6715'. Test to 3000# ok.
09/25/03 Acdz w/ 1000 gals 7-1/2% acid. Swab.
09/27/03 Latch onto RBP @ 6715' & POOH.
09/29/03 Knock out CIBP @ 8450' & push down to 8864'.
09/30/03 TIH w/ production equipment and return well to production.

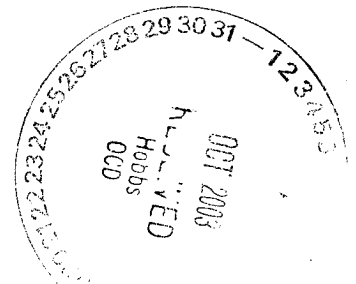

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Cathy Wright TITLE Sr. Operation Tech DATE 10/07/03
TYPE OR PRINT NAME Cathy Wright 432-685-8100 TELEPHONE NO.

(This space for State Use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY
GARY W. WINK
OC FIELD REPRESENTATIVE II/STAFF MANAGER

OCT 16 2003