

Submit 3 Copies To Appropriate District  
Office  
District I  
1625 N French Dr., Hobbs, NM 88240  
District II  
1301 W Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
May 27, 2004

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-025-20245
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH  
PROPOSALS)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other

2. Name of Operator  
Petrohawk Operating Company

3. Address of Operator  
1000 Louisiana, Suite 5600 Houston TX 77002

4. Well Location

Unit Letter P : 660 feet from the South line and 660 feet from the East line  
Section 10 Township 23S Range 36E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
3420 GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type \_\_\_\_\_ Depth to Groundwater \_\_\_\_\_ Distance from nearest fresh water well \_\_\_\_\_ Distance from nearest surface water \_\_\_\_\_

Pit Liner Thickness: \_\_\_\_\_ mil Below-Grade Tank: Volume \_\_\_\_\_ bbls; Construction Material \_\_\_\_\_

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

8-21-07 RU pluggers. LD 4" FJ liner. Set CIBP @ 2930'. Circulate w/ gel brine & spot 30 sks cmt 2930'-2641'. WOC. Tag TOC @ 2746'. Inform Buddy Hill & he OK. Perf @ 1380'. Squeeze perf @ 1380' w/ 65 sks cmt & displace to 1180'. WOC. Tag TOC @ 2515'. Inform Maxie Brown & he OK. Squeeze perf. @ 1380' w/ 65 sks cmt & displace to 1180'. WOC. Tag TOC @ 1155'. Inform Maxie Brown & he OK. Perf @ 450'. Squeeze perf @ 450' w/ 150 sks cmt. Circulate cmt out surface valve. WOC. Top off csg w/ 35 sks cmt. Inform Buddy & he OK. Cut off wellhead & anchors. Weld on dry hole marker. Request PA status.

Approved as to plugging of the Well Bore.  
Liability under bond is retained until  
surface restoration is completed.

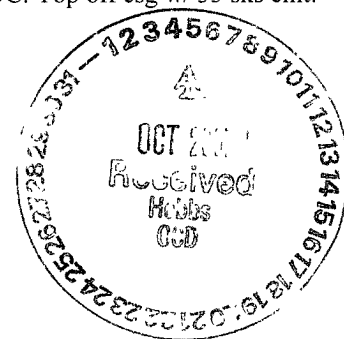

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Joel Sisk TITLE Production Foreman DATE 10-2-07

Type or print name Joel Sisk E-mail address: jsisk@petrohawk.com

Telephone No. 394-2574

For State Use Only

APPROVED BY: Harry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of Approval (if any)

DATE OCT 09 2007