

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30 025 23387
1. Type of Well: Oil Well ☒ Gas Well ☐ Other (Injection) ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Shinnery Oil Co., Inc.		6. State Oil & Gas Lease No. K 3846
3. Address of Operator 606 W. Tennessee, Suite 107, Midland, TX 79701		7. Lease Name or Unit Agreement Name Baum "D" State
4. Well Location (Surface) Unit Letter <u>J</u> : <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>East</u> line Section <u>4</u> Township <u>14S</u> Range <u>33E</u> NMPM Lea County		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.): <u>4232.3</u>		9. OGRID Number 20713
10. Pool name or Wildcat Baum, Upper Penn		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
 OTHER:

SUBSEQUENT REPORT OF:


REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☐
 CASING TEST AND CEMENT JOB ☐
 OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Propose to P & A as follows:

1. CIBP @ 9700 w/35' cement on top, tag.
2. Cut & pull 5 1/2" casing @ 8000', 30 sx plug - 50' above & below csg cut, tag.
3. 40 sx plug 4030-4130' (8 5/8" casing @ 4080'), tag.
4. Cut & pull 8 5/8" casing @ 2900', 50 sx plug, tag.
5. 50 sx plug from 1400-1500', tag.
6. 80 sx plug from 314-414', (13 3/8" @ 364'), tag.
7. 10 sx plug @ surface - WOC & set P & A Marker.
 Class C/Poz cement or type as specified by OGD.
 Wellbore Diagram attached.

THE OIL CONSERVATION DIVISION
 BE NOTIFIED 24 HOURS PRIOR TO
 BEGINNING OF PLUGGING OPERATIONS.

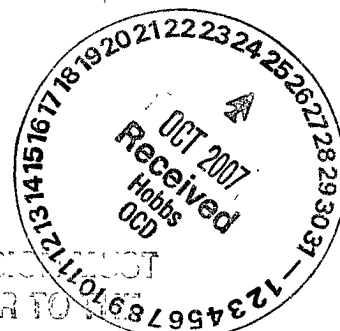

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Regulatory Agent DATE: 10-15-07

Type or print name Ann E. Ritchie E-mail address: ann.ritchie@wtor.net Telephone No. 432 684-6381

(This space for State use)

APPROVED BY [Signature] TITLE FIELD REPRESENTATIVE / STAFF MANAGER DATE OCT 26 2007

Conditions of approval, if any:

Baum "D" State #1 Wellbore
1980' ESL + 1980' FEL Proposed P&A

KB Elev. @ 4243'

Sec 4, T-14-S, R-33E

TD @ 9986'

Lea Co. NM

PBTD @ 9909'

SPUD 12-5-69

Surface

10 SX

Note: Hole filled
w/ salt gel mud,

17 1/2"

Hole

~ 80 SX

TAG

314'

414'

1400'

1500'

2850' ±

13 3/8" csg set @ 364' cement
w/ 400 SX. (48 # H-40) Circ.

50 SX

Plug 50' Above SALT @ 1500'

~ 50 SX Plug TAG

TPC @ 3075' by Temp Survey

w/ stretch

8 5/8" @

Cut & pull

2900' ±

11"

Hole

2950'

4090'

4130'

TAG

~ 40 SX

plug →

8 5/8" csg set @ 4080' cement
w/ 300 SX. (24 # + 32 # - K-55)
TPC @ 3075' by Temp Survey

(w/ stretch
csg free

determine
point

Cut & pull
@ 8000' ±

7 7/8"

Hole 35' Cmt on Top
CIBP @

TAG 9700'

9665'

35' Cmt on top

50' above & below csg cut. TAG.
~ 30 SX

TPC @ 9000' by Temp. Survey

Penn Perfs 9763-9823

Penn Perfs 9853-9876

5 1/2" csg set @ 9985' (17 # N-80)
cement w/ 300 SX K-55

TD @ 9986'

PBTD @ 9949'