

Submit 3 Copies To Appropriate
District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised June 10, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30 025 28350 23595
5. Indicate Type of Lease STATE ☒ FEE
6. State Oil & Gas Lease No. K 3290
7. Lease Name or Unit Agreement Name Baum "E" State
8. Well Number 1
9. OGRID Number 20713
10. Pool name or Wildcat: Baum, Upper Penn

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well ☒ Gas Well ☐ Other (Injection) ☐	
2. Name of Operator Shinnery Oil Co., Inc.	
3. Address of Operator 606 W. Tennessee, Suite 107, Midland, TX 79701	
4. Well Location (Surface) Unit Letter _____ : _____ feet from the _____ North _____ line and _____ feet from the _____ West _____ line Section 9 Township 14S Range 33E NMPM Lea County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.): 4248	


12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER:	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Propose to P & A as follows:

1. CIBP @ 9780 w/35' cement on top, tag.
2. Cut & pull 5 1/2" casing @ 4100', 40 sx plug, tag.
3. Cut & pull 8 5/8" casing @ 3200', 50 sx plug, tag.
4. 50 sx plug from 1400-1500', tag.
5. 80 sx plug from 312-412', (13 3/8" @ 362'), tag.
6. 10 sx plug @ surface
Class C/Poz cement or type as specified by OCD.
Wellbore Diagram attached.
Set marker.

THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.

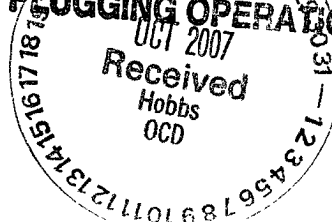

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Ann E. Ritchie* TITLE Regulatory Agent DATE: 10-15-07

Type or print name Ann E. Ritchie E-mail address: ann.ritchie@wtor.net Telephone No. 432 684-6381

(This space for State use)

APPROVED BY *Gary W. Wink* TITLE _____ DATE OCT 26 2007

Conditions of approval, if any:

OCD FIELD REPRESENTATIVE W/STAFF MANAGER

Baum "E" State #1 Wellbore /
Intent to
330' FNL + 2310' FWL
P/A

KB Elev. @ 4248

Sec 9, T-14-S, R-33E

TD @ 10,025'

Lea Co. NM

PBTD @ 9990'

SPUD 10-2-70

10 SX

@ Surface

17 1/2"

Hole

~ 80 SX

TAG

Note: Fill Hole
w/ Salt Gel Mud.

13 3/8" CSG set @ 362' cement
w/ 400 SX. (48# H-40) Circ.

100' Plug 50 SX
@ Salt 1500' - 1400'

TPC @ 3330 by Temp Survey

~ 50 SX TAG

cut & pull
@ 3200'

11"
Hole

~ 40 SX

cut & pull

@ 4100' TAG

8 5/8" CSG set @ 4100' cement
w/ 300 SX. (24# + 32# - K-55)

HIC 4610 - 4724' CR @ 4350' + 582 w/ 200 SX

7 7/8"

Hole 35' Cmt on top
CIBP @

TAG 9780'

Est TOL @ 8500'

~ 10 SX

Penn Perfs 9842' - 9861'

Penn Perfs 9910' - 9936'

5 1/2" CSG set @ 10,024' (17# N-80)
cement w/ 200 SX K-55

TD @ 10,025