

Submit 3 Copies To Appropriate
District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised June 10, 2003

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30 025 01126
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE
6. State Oil & Gas Lease No. B-9505
7. Lease Name or Unit Agreement Name New Mexico "AT" State
8. Well Number 5
9. OGRID Number 213190
10. Pool name or Wildcat. Saunders Permo Upper Penn
11. Elevation (Show whether DR, RKB, RT, GR, etc.): 4228'

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well Other (Injection)

2. Name of Operator
CrownQuest Operating, LLC

3. Address of Operator
P.O. Box 53310, Midland, TX 79710

4. Well Location (Surface)
Unit Letter M : 660 feet from the West line and 660 feet from the South line
Section 10 Township 14S Range 33E NMPM Lea County

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: Test Cisco/Canyon

SUBSEQUENT REPORT OF:

REMEDIAL WORK ALTERING CASING ☐

COMMENCE DRILLING OPNS PLUG AND ☐

CASING TEST AND
CEMENT JOB

OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Request to renew plugging procedure approved on 12-20-2006. Plan on plugging this well prior to 12-31-07.
Plugging Procedure:
Set 2" CIBP @ 9700' & cap with 20' of cement tag.
Circulate hole w/plugging mud. Spot 25 sx cement from 8500-9300' & tag.
Unscrew 5 1/2" casing @ approx. 3441' & POH w/casing. Spot 40 sx cement plug @ 3285-3572' and tag.
Spot 30 sx cement @ 1450-1600'.
Spot 100' plug from 320-420' 10 3/4" shoe & fresh water plug - tag.
Spot 100 sx cement plug from 50' to surface, weld on steel cap & install P & A marker.
Top wolfcamp - 9144'; Top Abo-7682'; Top San Andres-4037'; Top Queen-3389'; Top Rustler-1650'.
Capacity 2 7/8" 0.00579 bbl/ft.; capacity 7 5/8" 0.0475 bbl/ft.
Diagram attached.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ann E. Ritchie TITLE Regulatory Agent DATE 11-14-07


Type or print name Ann E. Ritchie E-mail address: ann.ritchie@wtor.net Telephone No. 432 684-6381

(This space for State use)

APPROVED BY Harry W. Wink TITLE OC FIELD REPRESENTATIVE II, STATE MANAGER DATE NOV 19 2007
Conditions of approval, if any:

THE OIL CONSERVATION DIVISION MUST
BE NOTIFIED 24 HOURS PRIOR TO THE
BEGINNING OF PLUGGING OPERATIONS.

New Mexico AT State #5

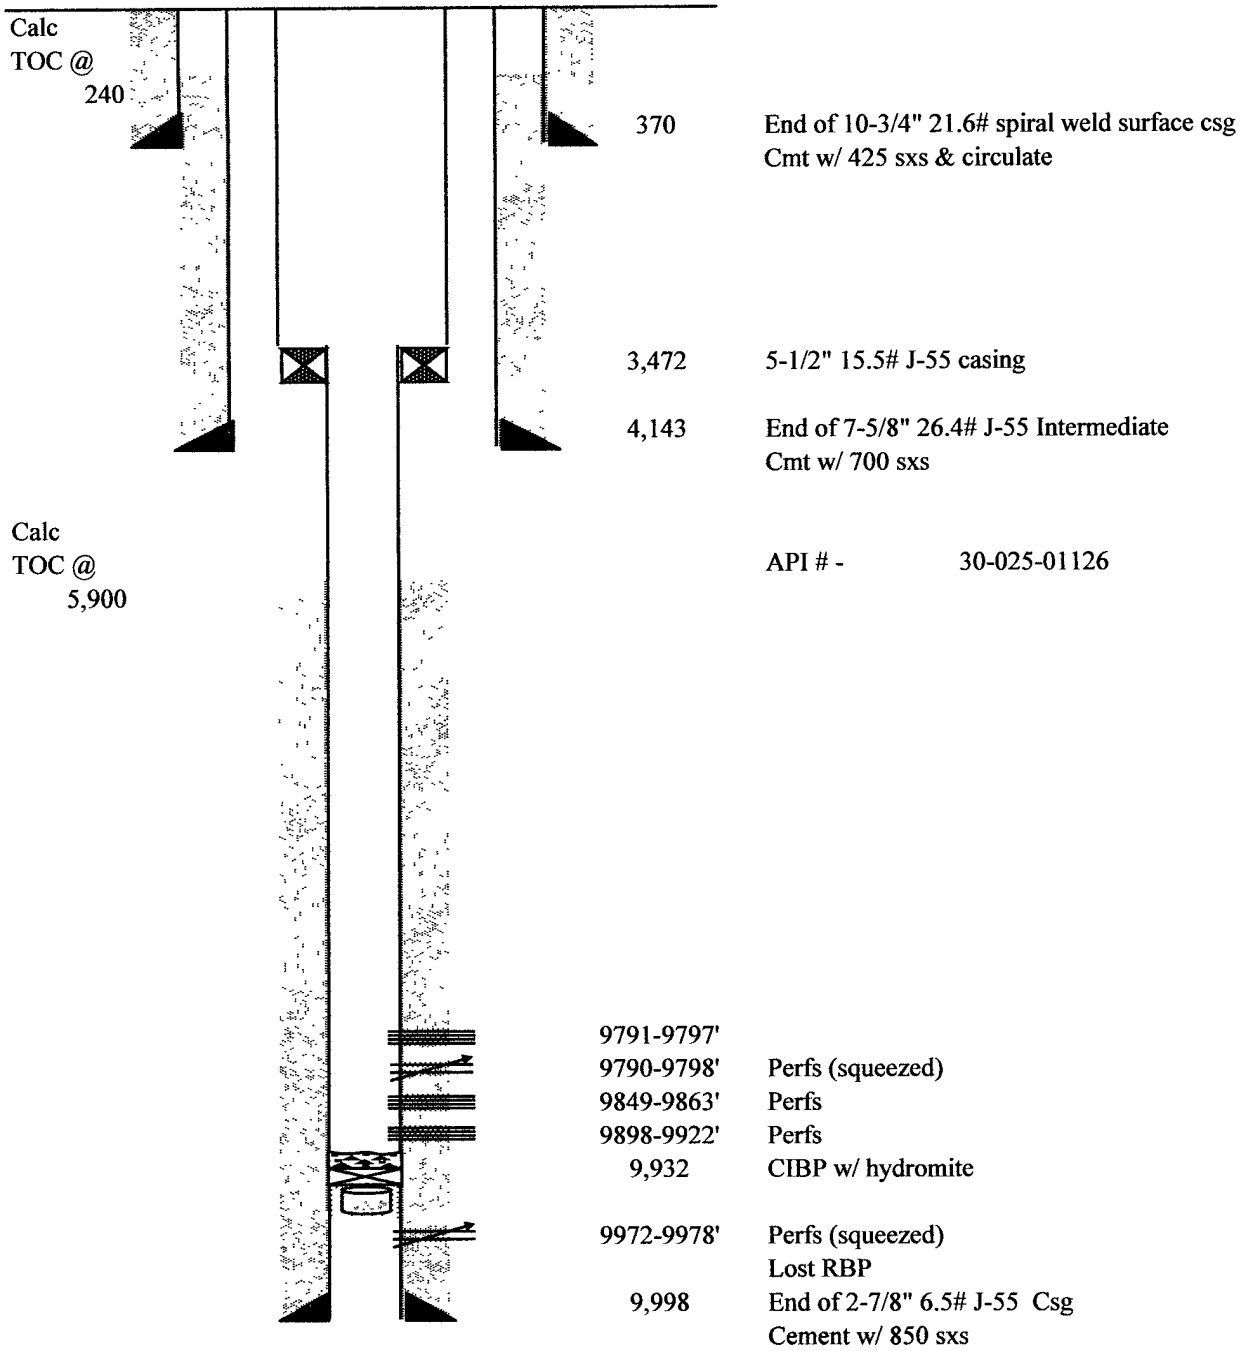

WI
NRI
Drilled

1
0.875
May-1962