Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

OCD-HOBBA

FORM APPROVED OMB NO 1004-0135

Expires: November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

891038170 - NM7488 6 If Indian, Allottee or Tribe Name

5. Lease Serial No.

SUBMIT IN TRIPLICATE - Other instructions on reverse side				7 If Unit or CA/Agreement, Name and/or No Myers Langlie Mattix Unit		
1. Type of Well Oll Well Gas Well X Other Injection				8. Well Name and No.		
2 Name of Operator		192463				
OXY USA WTP Limited Partnership 3a. Address 3b. Phone N				9. API Well No).	
	3b Phone No. (<i>include are</i>	ea code)	30-025-1104			
P.O. Box 50250, Midland, TX 79710-4. Location of Well (Footage, Sec., T., R. M., or Survey L	432 - 685 - 5717		10 Field and P	ool, or Exploratory Area		
2310 FNL 660 FWL SWNW(E) Sec 7 T24	• •			Langile Mat	tix 7Rvr Qn-GB /	
				11. County or I	'arısh, State	
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REP				Lea	NM	
12. CHECK APPROPRIATE	BOX(ES) TO IND	ICATE NATURE OF I	NOTICE, REPO	ORT, OR OTH	ER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION					
X Notice of Intent	Acidize	Deepen	Production	(Start/Resume)	Water Shut-Off	
_	Alter Casing	Fracture Treat	Reclamatio	` ' [
Subsequent Report	-		一			
<u></u>	Casing Repair	New Construction	Recomplete	te X Other Re-Submit		
Final Abandonment Notice	Change Plans	X Plug and Abandon	Temporaril	y Abandon	Approved 9/18/07	
	Convert to Injection	Plug Back	Water Disp	osal		
TD-3595' OH-3480-3595' 13" 40# csg @ 303' w/250sx, 17" ho 8-5/8" 28-32# csg @ 2748' w/600sx, 5-1/2" 14# csg @ 3480' w/185sx, 6-2/78-Perf @ 1900', Sqz w/ 2600 1. RIH & set CIBP @ 3430', w/250s2. M&P 25sx cmt @ 2798-2698 2. M&P 25sx cmt @ 1950 1850' 4. M&P 25sx cmt @ 1250 11500'- w/000 5. M&P 60sx cmt @ 353'-Surface 10# MLF between plugs	ole, TOC-Surf-Ci	THE OIL CO	FI	PRIOR TO THE	OCD ST	
14 I hereby certify that the foregoing is true and correct Name (Printed/Typed)		Title	-	-		
David Stewart		Sr. Red	ulatory Ana	lvst		
On Staff		Date (29			ROVED	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
Approved by Conditions of approval, if any, are attached Approval of certify that the applicant holds legal or equitable title to the conditions of the conditions of the certification of the certif	hose rights in the subject	rant or Office	TERAL MANA	GER PE	B 1 4 2008	
which would entitle the applicant to conduct operations the		<u> </u>		WESL	EY W INGRAM	
Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section	1212, makes it a crime for	or any person knowingly an	d willfully to mak	e to an PEED RONG	#PARENCHAFFER THE	


Myers Langlie Mattix Unit #210 OXY USA WTP Limited Partnership February 14, 2008 Plug and Abandon Conditions of Approval

- 1. RIH and tag bottom of hole. Set 25 sack plug 50 feet below shoe joint at 3480'. Tag plug at 3400' or shallower.
- 2. Ok plug to be tagged at 2668' or shallower. Shoe plug and Base of Salt plug.
- 3. Ok
- 4. Ok top of Salt plug.
- 5. Ok
- 6. Cut off wellhead and casing. Check 8-5/8" x 13" annulus to verify cement at surface since TOC is calculated. If not, one inch cement from a depth of 60' to surface.
- 7. Install dry hole marker, and clean location.

WWI 021408

OXY USA WTP LP - Proposed Myers Langlie Mattix Unit #210 API No. 30-025-11043

60sx @ 353'-Surface

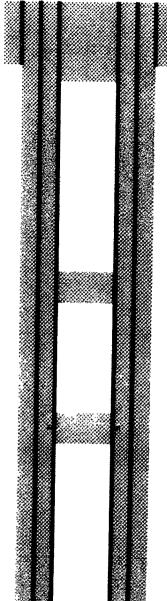


17" hole @ 303' 13" csg @ 303' w/250sx-TOC-Surf-Circ

25sx @ 1250-1150' WOC-Tag

25sx @ 1950-1850'

25sx @ 2798-2698'

CIBP @ 3430' w/ 25sx to 3330'

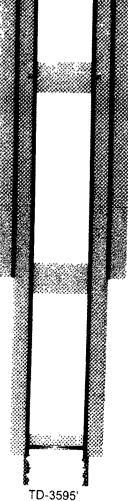

*2/78-Perf @ 1900'sqz 260sx cmt, circ 36sx

11" hole @ 2748' 8-5/8" csg @ 2748' w/600sx-TOC-Surf-Calc

6-3/4" hole @ 3480' 5-1/2" csg @ 3480' w/185sx-*TOC-1920'-CBL

4-3/4" OH @ 3480-3595'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.



UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, NM 88220

Interim Reclamation Procedures for Permanently Abandoned Federal Wells

- 1. After Subsequent Report of Abandonment, Form 3160-5, is filed and approved by the BLM the surface protection specialist (SPS) will conduct a surface inspection of the abandonment. The SPS will establish the reclamation requirements the operator will need to complete. **DO NOT START RECLAMATION UNTIL THE SPS HAS INSPECTED THE LOCATION.**
- 2. The reclamation requirements will be given to an environmental protection specialist (EPS). The EPS will issue the operator a Notice of Written Order outlining the reclamation requirements. **DO NOT START**RECLAMATION UNTIL A NOTICE OF WRITTEN ORDER FOR RECLAMATION HAS BEEN RECEIVED. The EPS will be responsible for all further abandonment work and inspections.
- 3. Notification: CONTACT THE EPS 3 DAYS PRIOR TO RECLAMATION WORK. This notification gives the EPS an opportunity to discuss by phone or on location the reclamation requirements, any special concerns and the timeframes. It also allows the EPS an opportunity to witness various aspects of the reclamation work to determine if an adequate seedbed has been prepared and all reclamation requirements have been completed. CONTACT THE EPS AT LEAST 3 DAYS PRIOR TO SEEDING. This allows the EPS to witness the seeding operation to make sure the location is seeded properly and with the appropriate seed mixture. DO NOT START RECLAMATION UNTIL THE EPS HAS BEEN NOTIFIED.
- 4. After reclamation work has been completed, submit the I & E copy of the Notice of Written Order to the BLM. It will need to be signed by a company representative and dated. Also submit one original and five copies of the Final Abandonment Notice, Form 3160-5. The report should state that all reclamation work has been completed, and the location is ready for a final abandonment inspection.
- 5. The BLM will continue to monitor the location to ensure the location vegetates successfully, and salts from the reserve pit do not leach to the surface. The location will be monitored until such time as vegetation (20%) is established evenly across the location (including the reserve pit and access road). Once EPS determines that vegetation (20%) is evenly spread across the location, final abandonment will be authorized.

If there are any questions please feel free to contact any of the following:

Jim Amos Supervisory Environmental Protection Specialist (575) 234-5909

Barry Hunt Surface Protection Specialist (575) 234-5965

Todd Suter Surface Protection Specialist (575) 234-5987

Trishia Bad Bear Natural Resource Specialist – Lea County (575) 393-3612 Cody Layton Natural Resource Specialist (575) 234-5959

Paul Evans Environmental Protection Specialist (575) 234-5977

Terry Gregston Environmental Protection Specialist (575) 234-5958

10/18/2006