Form 3160-5 (September 2001)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT <

FORM APPROVED OMB NO 1004-0135 Expires January 31, 2004

5 Lease Serial No.

NM-052

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill of the enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

6. If Indian, Allottee or Tribe Name

		 -			
SUBMIT IN TRIPLICATE - 0	7. If Unit or CA/Agreement, Name and/or No NM70989X				
1 Type of Well X Oil Well Gas Well Other 2 Name of Operator MERIT ENERGY COMPANY 3a Address 13727 NOEL ROAD, SUITE 500, DALLAS, 4 Location of Well (Footage, Sec., T., R., M., or Survey L UNIT LETTER L 1980' FSL & 990' FWL SEC. 35, T-19S, R-34E	8. Well Name and No MESCALERO RIDGE #13 UNIT "35" 9 API Well No. 30-025-21267 10. Field and Pool, or Exploratory Area PEARL (QUEEN), SEVEN RIVERS 11. County or Parish, State LEA NM				
12. CHECK APPROPRIATE	BOX(ES) TO INDICATE NATURE OF NOTICE, RE	PORT, OR OTHER DATA			
TYPE OF SUBMISSION	TYPE OF ACTION				
X Notice of Intent	Acidize Deepen Products	on (Start/Resume) Water Shut-Off			
Subsequent Report Final Abandonment Notice	Alter Casing Fracture Treat Reclama Casing Repair New Construction Recomp Change Plans X Plug and Abandon Tempora Convert to Injection Plug Back Water D	olete Other			

Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof lf the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

COMPLY WITH ALL COMPANY & GOVERNMENT ENVIRONMENT & SAFETY REGULATIONS. ANYONE ON JOB LOCATION HAS THE AUTHORITY TO SHUT DOWN UNSAFE OPERATIONS.

- 1) SET 5-1/2" CIBP @ 3,950'; DUMP BAIL 35' OMT. ON TOP OF CIBP; CIRC. WELL W/ PXA MUD.
- 2) PERF. & SQZ. A 35 SX. CMT. PLUG @ 3,435'-3,330' (B/SALT); WOC & TAG TOP OF CMT. PLUG.
- 3) PERF. & SQZ. A 35 SX. CMT. PLUG @ 1,785'-1,685' (B/ANHY); WOC & TAG TOP OF CMT. PLUG.
- 4) PERF. @ 255' & CIRC. A 90 SX. OMT. PLUG TO SURFACE.
- 5) DIG OUT & OUT OFF WELLHEAD 3' B.G.L.; INSTALL DRY HOLE MARKER.


SEE ATTACHED FOR CONDITIONS OF APPROVAL

14. I hereby certify that the foregoing is true and correct Name (<i>Printed/Typed</i>)	Title	Title			
DAVID A. EYLER	AGENT				
Day A Crusch	Date 02/26/08	APPROVED			
THIS SPACE FOR I	FEDERAL OR STATE OFFICE USE				
Approved by	Title	WAR 2 6 2008			
Conditions of approval, if any, are attached. Approval of this notice does n certify that the applicant holds legal or equitable title to those rights in the which would entitle the applicant to conduct operations thereon.	ot warrant or subject lease Office	WESLEY W. INGRAM			
Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a	crime for any person knowingly and willfully to	make to any denationer of abency Style English			

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department of agency of the Unite States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

DEVON ENERGY CORPORATION WELLBORE SCHEMATIC

WELL NAME MESCALERO RIDGE UNIT "35" #13		FIELD PEARL (7 RIVERS)				
LOCATION 1980' FSL & 990' FWL, SEC 35-T19S-R34E			COUNTY LEA			STATE NM
ELEVATION GL=3701', KB=3711'			SPUD DATE 08/16/65		COMP DATE 02/03/2004	
API# 30-025-21267 PREPARED BY C HOLLEY		[DATE 2/14/2	DATE 2/14/2006	
	DEPTH	SIZE	WEIGHT	GRADE	THREAD	HOLE SIZE
CASING	0' - 202'	8 5/8"	24#	H-40	ST&C	12"
CASING [.]	0' - 5192'	5 1/2"	15 5#	J-55	LT&C	7 7/8"
CASING						
TUBING	0' - 3638'	2 3/8	6 5#	J-55	EUE 8rd	
TUBING.						
TUBING	0' - 3638'	2 3/8	6 5#	J-55	EUE 8rd	

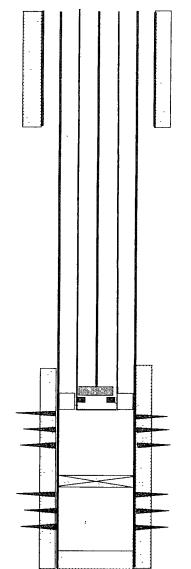

CURRENT

PROPOSED

OPERATOR: MERIT ENERGY

8 5/8" CASING @ 202' W/125 SXS TOC @ SURFACE.

DETAIL OF PERFORATIONS

7 Rivers: 3978-3994', 3996-3999', 4002-4018', & 4021-4038'

CIBP @ 4535 Capped w/ 35 Cmt

U. QUEEN: 4576', 95', 97, 4605', 17', 19'

M. QUEEN: 4745'
L. QUEEN: 4881', 85'
U. PENROSE: 4929', 31'
M. PENROSE: 5024', 36'



MAR 2 8 2008

HOBBS OCD

PERFORATIONS. 3978 - 4038' (2 SPF)

SEAT NIPPLE @ 4855'
TOP OF FILL (AS OF 3/94) @ 5080'
PBTD @ 5189'

5 1/2" CASING @ 5192' W/350 SXS TOC @ 3720 (TEMP SURVEY)

TD @ 5200'

Mescalero Ridge Unit 35 – 13 Merit Energy Company March 26, 2008 Plug and Abandonment Conditions of Approval

- 0. On future P&A procedures, include current and proposed schematics.
- 1. WOC and perform pressure test of plug to be done after placing cement to verify that perforations are sealed.
- 2. Ok
- 3. Ok
- 4. Ok
- 5. In addition, clean location.

WWI 032608



MAR 2 8 2008

HOBBS OCD

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

MAR 2 8 2008 HOBBS OCD

Permanent Abandonment of Federal Wells **Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker; well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.



UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT Corlebed Field Office

Carlsbad Field Office 620 E. Greene St. Carlsbad, NM 88220

MAR 2 R 2008

Interim Reclamation Procedures for Permanently Abandoned Federal Wells

- 1. After Subsequent Report of Abandonment, Form 3160-5, is filed and approved by the BLM the surface protection specialist (SPS) will conduct a surface inspection of the abandonment. The SPS will establish the reclamation requirements the operator will need to complete. **DO NOT START RECLAMATION UNTIL THE SPS HAS INSPECTED THE LOCATION.**
- 2. The reclamation requirements will be given to an environmental protection specialist (EPS). The EPS will issue the operator a Notice of Written Order outlining the reclamation requirements. **DO NOT START**RECLAMATION UNTIL A NOTICE OF WRITTEN ORDER FOR RECLAMATION HAS BEEN RECEIVED. The EPS will be responsible for all further abandonment work and inspections.
- 3. <u>Notification</u>: **CONTACT THE EPS 3 DAYS PRIOR TO RECLAMATION WORK.** This notification gives the EPS an opportunity to discuss by phone or on location the reclamation requirements, any special concerns and the timeframes. It also allows the EPS an opportunity to witness various aspects of the reclamation work to determine if an adequate seedbed has been prepared and all reclamation requirements have been completed. **CONTACT THE EPS AT LEAST 3 DAYS PRIOR TO SEEDING.** This allows the EPS to witness the seeding operation to make sure the location is seeded properly and with the appropriate seed mixture. **DO NOT START RECLAMATION UNTIL THE EPS HAS BEEN NOTIFIED.**
- 4. After reclamation work has been completed, submit the I & E copy of the Notice of Written Order to the BLM. It will need to be signed by a company representative and dated. Also submit one original and five copies of the Final Abandonment Notice, Form 3160-5. The report should state that all reclamation work has been completed, and the location is ready for a final abandonment inspection.
- 5. The BLM will continue to monitor the location to ensure the location vegetates successfully, and salts from the reserve pit do not leach to the surface. The location will be monitored until such time as vegetation (20%) is established evenly across the location (including the reserve pit and access road). Once EPS determines that vegetation (20%) is evenly spread across the location, final abandonment will be authorized.

If there are any questions please feel free to contact any of the following:

Jim Amos Supervisory Environmental Protection-Specialist (575) 234-5909

Barry Hunt Surface Protection Specialist (575) 234-5965

Todd Suter Surface Protection Specialist (575) 234-5987

Trishia Bad Bear Natural Resource Specialist – Lea County (575) 393-3612 Cody Layton • Natural Resource Specialist (575) 234-5959

Paul Evans Environmental Protection Specialist (575) 234-5977

Terry Gregston Environmental Protection Specialist (575) 234-5958

10/18/2006