

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999


OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-20164
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Chevron USA Inc		6. State Oil & Gas Lease No. B-1583
3. Address of Operator 15 Smith Rd, Midland, TX, 79705		7. Lease Name or Unit Agreement Name: New Mexico BZ State NCT 10
4. Well Location Unit Letter <u>L</u> : <u>1980</u> feet from the <u>South</u> line and <u>989</u> feet from the <u>West</u> line Section <u>2</u> Township <u>25-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County		8. Well No. 3
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Blinebry Tubb Drinkard

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. RU on X-String, set 2 7/8 CIBP at 5150, spot 65sx, plug from 5150 to 2600 (Justis Blinebry), Tag at 2590.
2. RU on Y-String, set 2 7/8 CIBP at 5600, spot 75sx, plug from 5600 to 2600 (Justis Tubb Drinkard), Tag at 2618.
3. Cut 2 7/8 csg at 2600 L/D, spot 85sx, plug from 2600 to 2350 (Stub, B-Salt), Tag at 2331.
4. Displace hole with MLF 9.5# Brine w/12.5 gel P/BBL.
5. Perf 8 5/8 csg at 1050, sqz 60sx from 1050 to 950 (T-Salt), Tag at 882.
6. Perf 8 5/8 csg at 300, sqz 425sx in 3-stage 8 5/8 x 11 3/4 csg behind 11 3/4 (11 3/4 Shoe), Tag 43' fr Surf.
7. Fill 8 5/8 csg from 30 to Surf w/15sx. Install dry hole marker 10-23-03.

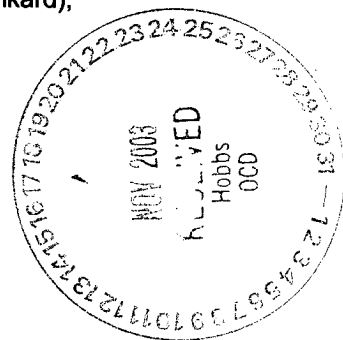

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER/SUNSET DATE 10/23/03

Type or print name Jimmy BABLEY Telephone No. 432 561-8600
(This space for State use)

APPROVED BY [Signature] OC FIELD REPRESENTATIVE II/STAFF MANAGER
Conditions of approval, if any TITLE DATE NOV 18 2003