Form 316045 (Älügust 1999)

5. M&P 25sx cmt @ 150'-Surface

10# MLF between plugs

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

RECEIVED

FORM APPROVED OMB NO. 1004-0135

Expires: November 30, 2000 5. Lease Serial No.

DEC U 4 YOUR SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an OBBSOCD

LC029489B 6. If Indian, Allottee or Tribe Name

abandoned well. Use Form 3160-3 (APD) 1	for such proposals.
SUBMIT IN TRIPLICATE - Other instruction	ons on reverse side 7. If Unit or CA/Agreement, Name and/o
1. Type of Well X Oil Well Gas Well Other	NM 84603 V 8. Well Name and No. Central Corbin #210
2. Name of Operator OXY USA Inc.	Central Corbin #210 Oueen Unit 9. API Well No.
3a. Address P.O. Box 50250, Midland, TX 79710-0250	3b. Phone No. (<i>include area code</i>) 30-025-29781
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1980 FNL 660 FWL SWNW(E) Sec 4 T18S R33E	10. Field and Pool, or Exploratory Area Corbin Queen, Central
	11. County or Parish, State Lea NM
12. CHECK APPROPRIATE BOX(ES) TO II	NDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION
X Notice of Intent Subsequent Report Final Abandonment Notice Acidize Alter Casing Casing Repair Change Plans Convert to Inject	
If the proposal is to deepen directionally or recomplete horizontally, give Attach the Bond under which the work will be performed or provide the following completion of the involved operations. If the operation results	etails, including estimated starting date of any proposed work and approximate duration therever subsurface locations and measured and true vertical depths of all pertinent markers and zone e Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 das in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed on only after all requirements, including reclamation, have been completed, and the operator h
TD-4275' PBTD-4226' Perfs-4134-4138' 8-5/8" 24# csg @ 394' w/300sx, 12-1/4" hole, TO 5-1/2" 14# csg @ 4273' w/ 900sx, 7-7/8" hole, T	
 RIH & Set CIBP @ 4085', M&P 25sx cmt to 3935 M&P 40sx cmt @ 2950-2700' WOC-Tag M&P 35sx cmt @ 1640-1470' WOC-Tag M&P 25sx cmt @ 444-344' 	JAMES A. AMOS SUPERVISOR-EPS

SEE ATTACHED FOR **CONDITIONS OF APPROVAL**

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) David Stewart	Title	Sr. Regulatory Analyst		
la: Stat	Date	11/18/08		
THIS SPACE FOR FEDERAL OR STATE OFFICE USE				
Approved by	Title	Date		
Conditions of approval, if any, are attached. Approval of this notice does not warrant certify that the applicant holds legal or equitable title to those rights in the subject lewhich would entitle the applicant to conduct operations thereon.	or Office	K O		

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

OXÝ USA Inc. Central Corbin Queen Unit #210 API No. 30-025-29781

25sx @ 150-Surface

25sx @ 444-344'

35sx @ 1640-1470' WOC-Tag

40sx @ 2950-2700' WOC-Tag

CIBP @ 4085' w/ 25sx

TD-4275'


12-1/4" hole @ 394' 8-5/8" csg @ 394' w/ 300sx-TOC-Surf-Circ

7-7/8" hole @ 4275' 5-1/2" csg @ 4273' w/ 1400sx-TOC-Surf-Circ

Perfs @ 4134-4138'

PB-4226'

OXY USA Inc. Central Corbin Queen Unit #210 API No. 30-025-29781

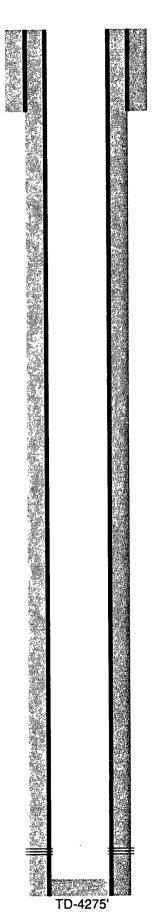

12-1/4" hole @ 394' 8-5/8" csg @ 394' w/ 300sx-TOC-Surf-Circ

7-7/8" hole @ 4275' 5-1/2" csg @ 4273' w/ 1400sx-TOC-Surf-Circ

Perfs @ 4134-4138'

PB-4226'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.