

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO. 30-025-26703
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	7. Lease Name or Unit Agreement Name: State HU
2. Name of Operator Chevron USA Inc.	8. Well No. 1
3. Address of Operator 15 Smith Rd. Midland, Tx. 79705	9. Pool name or Wildcat Young South San Andres
4. Well Location Unit Letter <u>J</u> : 1980 feet from the <u>South</u> line and 1980 feet from the <u>East</u> line Section <u>32</u> Township 18S Range <u>32</u> NMPM Lea County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	


11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. MI & RU Plugging Equipment. 10-22-03.
2. Set 5 1/2 CIBP @5000'. 10-23-03.
3. Spot 100sx Class C Cmt @5000'. 10-24-03. Tag TOC @3970'. 10-27-03.
4. Circulate 100 BBL MLF 3970'- Surface. 10-27-03.
5. Cut 5 1/2 Csg @1800'. Spot 50sx Class C Cmt @1860'. 10-27-03. Tag TOC @1658'. 10-28-03.
6. Circulate 170sx Class C Cmt @475'- Surface In 9 5/8 Csg. 10-28-03.
7. Tag TOC @ Surface. 10-29-03. Install Dry Hole Marker. P & A Complete 10-29-03.

Approved as to plugging of the Well Bore. Liability under bond is retained until surface restoration is completed.

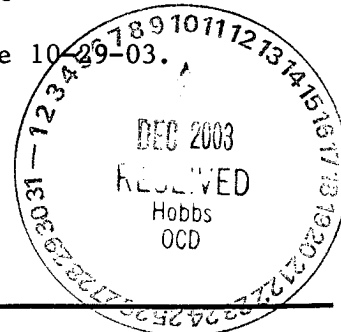

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE MANAGER / SUNSET DATE 10/29/03

Type or print name Jimmy BAGLEY Telephone No. 432561-8600
(This space for State use)

APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR/GENERAL MANAGER DATE DEC 12 2003
Conditions of approval, if any: