

RECEIVED

1625 N. French Drive

Hobbs, NM 88249

Form 3160-5
(September 2001)

APR 20 2009

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
OMB No 1004-0135
Expires January 31, 2004**HOBBS****SUNDRY NOTICES AND REPORTS ON WELLS**Do not use this form for proposals to drill or re enter an
abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.

NMNM15890 9043 P

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1 Type of Well



Oil Well



Gas Well



Other

Water Injection Well

2. Name of Operator

Yates Drilling Company

3a Address

105 S. 4th Str., Artesia, NM 88210

3b Phone No (include area code)

505-748-8663

4 Location of Well (Footage, Sec., T., R., M., OR Survey Description)

1980' FSL & 660' FWL Section 34-12S-31E

7. If Unit or CA/Agreement, Name and/or No.

Cactus Queen Ut

8 Well Name and No.

Cactus Queen Unit #10

9 API Well No.

30-005-20880

10. Field and Pool, or Exploratory Area

SE Chaves QN Gas Area Assoc

11 County or Parish, State

Chaves Co., NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**TYPE OF SUBMISSION**☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice**TYPE OF ACTION**☐ Acidize☐ Alter Casing☐ Casing Repair☐ Change Plans☐ Convert to Injection☐ Deepen☐ Fracture Treat☐ New Construction☒ Plug and Abandon☐ Plug Back☐ Production (Start/Resume)☐ Reclamation☐ Recomplete☐ Temporarily Abandon☐ Water Disposal☐ Water Shut-Off☐ Well Integrity☐ Other

13 Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

See Attachment.

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

Karen J. Leishman

Title Operations Tech

Signature

Karen J. Leishman

Date 4/8/2009

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

/S/ DAVID R. GLASS

Title RETROLEUM ENGINEER

Date APR 10 2009

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

SEE ATTACHED FOR

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

CONDITIONS OF APPROVAL

Yates Drilling Company
Cactus Queen Unit #10
Unit L, Section 34-12S-31E
Chaves County, NM
30-005-20880
Sundry attachment
April 8, 2009


- 1. Set CIBP @ 2,700', mix and circulate 10# mud inside 5 1/2" casing to surface
- * ~~2. Spot 25 sxs Class "C" cement plug on top of CIBP~~
- 3. Perforate 5 1/2" casing @ 1,100', TOS
- 4. Set packer @ 1,050'. Mix and pump 10# mud, establish rate and circulate to surface out 5 1/2" annulus.
- 5. Set cement retainer @ 1050'. Mix Class "C" cement & pump cement to surface out 5 1/2" annulus. *+ 5 sxs. cnt. on top of CIBP.*
- 6. Pump cement plug in 5 1/2" casing 450' to surface
- 7. Erect dry hole marker, remove all equipment and clean location.

* Perf. @ 1890', squeeze w/ MINIMUM 25 sxs. cnt.
WOC + TAG

CACTUS QUEEN UNIT #10

(DeLUNA FED #1)

Sec 34, T12S-R31E CHAVES CO., NM
30-005-20880

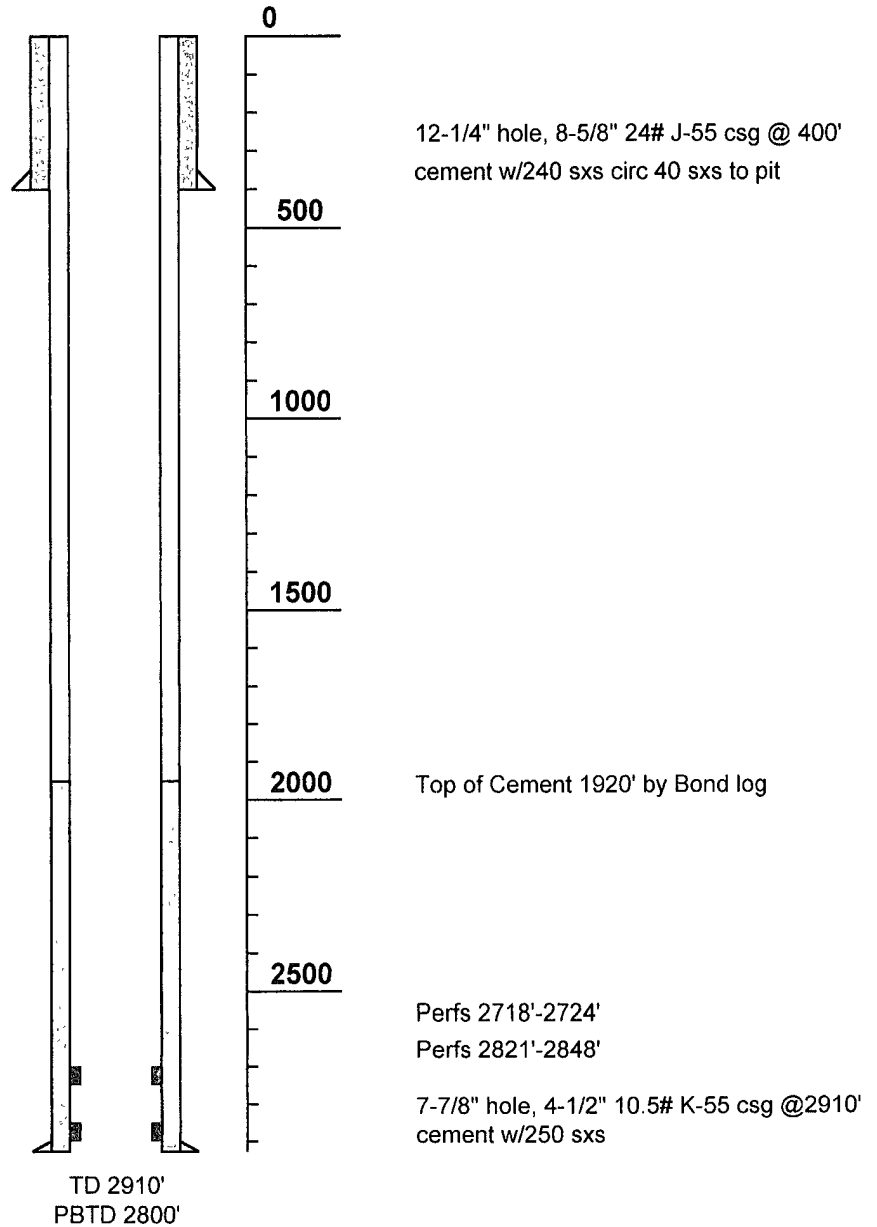

8/17/1982 Perfs 2821'-2948'
8/18/1982 Set cement retainer 2800'
8/18/1982 Perfs 2718'-2724' Queen

Formation Tops
1139' Rustler Top of Salt
1838' Base of Salt
1957' Yates
2093' 7-Rivers
2693' Top of Queen

BUREAU OF LAND MANAGEMENT

**Roswell Field Office
2909 West Second Street
Roswell, New Mexico 88201
(575) 627-0272**

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. **Plugging operations** shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. **If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office, prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action.**

2. **Notification:** Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours call (575) 627-0205 or after office hours call (575) 910-6024. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. **Dry Hole Marker:** All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. **Subsequent Plugging Reporting:** Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.