

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
1301 W Grand Ave., Artesia, NM 87110
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

RECEIVED

APR 01 2009

HOBBSOCD

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

June 19, 2008

WELL API NO. 30-025-04425
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
8. Well Number 140 WIW
9. OGRID Number 005380
10. Pool name or Wildcat Eunice Monument; Grayburg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other Injection ☒
2. Name of Operator XTO Energy, Inc.
3. Address of Operator 200 N. Loraine, Ste. 800 Midland, TX 79701
4. Well Location Unit Letter C : 660' feet from the North line and 1980' feet from the West line Section 36 Township 20S Range 36E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: Acid Stimulation ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

07/17/08 MIRU PU "Chapo". Prep to pull IPC tbg. BWTT, ND WH & NU BOP. RU. Scan out of hole w/119 jts of 2-3/8" J-55 IPC tbg. RD. MI rack 4,100' of 2-7/8" N-80 tbg. PU & RIH w/2-7/8" notch collar on 2-7/8" N-80 tbg. Tag @ 4,061'. POOH w/2-7/8" N-80 tbg.

07/18/08 RU. Pmp dwn TCA while dumping 1,730# 20/40 mesh sand. RU JW WL trk. PU & RIH w/3-1/2" cmt bailer. Tag sand @ 3,895'. RD. PU & RIH w/2-7/8" notch collar on 2-7/8" N-80 tbg. Tag @ 3,895'. RU. Brk circ & CO fr 3,895'-3,923'. Circ hole clean. RD. PU & RIH w/3-1/2" cmt bailer & dump 2-1/2 sks of class "C" cmt on top of sand. RD.

Procedure Cont'd. on next Page.

Spud Date:

07/17/08

Rig Release Date:

07/22/08

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Kristy Ward

TITLE Regulatory Analyst

DATE 03/31/09

kristy_ward@xtoenergy.com

Type or print name Kristy Ward

E-mail address: PHONE 432-620-6740

For State Use Only

APPROVED BY

Tom W. Hill

TITLE

DISTRICT 1 SUPERVISOR


DATE

APR 27 2009

Conditions of Approval (if any):

Eunice Monument South Unit #140
Acid Stimulation Cont'd.

- 07/19/08 PU & RIH w/sonic hammer tool on 2-7/8" N-80 tbg. Tag @ 3,886'. PUH to 3,703'. RU acidizing equipment. Wash GB OH fr 3,703'-3,886' w/190 BBW. Acidize GB OH fr 3,886'-3,703' w/1,500 gals of 15% NEFE acid @ 1.5 BPM. Flushed w/50 BFW @ 2 BPM, 700 psig. ISIP-395 psig, 5" "Vac". RD.
- 07/22/08 POOH LD 2-7/8" N-80 tbg & sonic hammer tool. RU tbg tester. PU & RIH w/5-1/2" AS 1x injection pkr testing 2-3/8" 4.7#, J-55, EUE, 8rd, IPC tbg below slips to 5,000 psig. RD. RU pmp trk. Circ 100 bbls of packer fluid. ND BOP. Set pkr @ 3,614'. NU WH. RU pmp trk & chart recorder. RD. RDMO PU. RWTI.

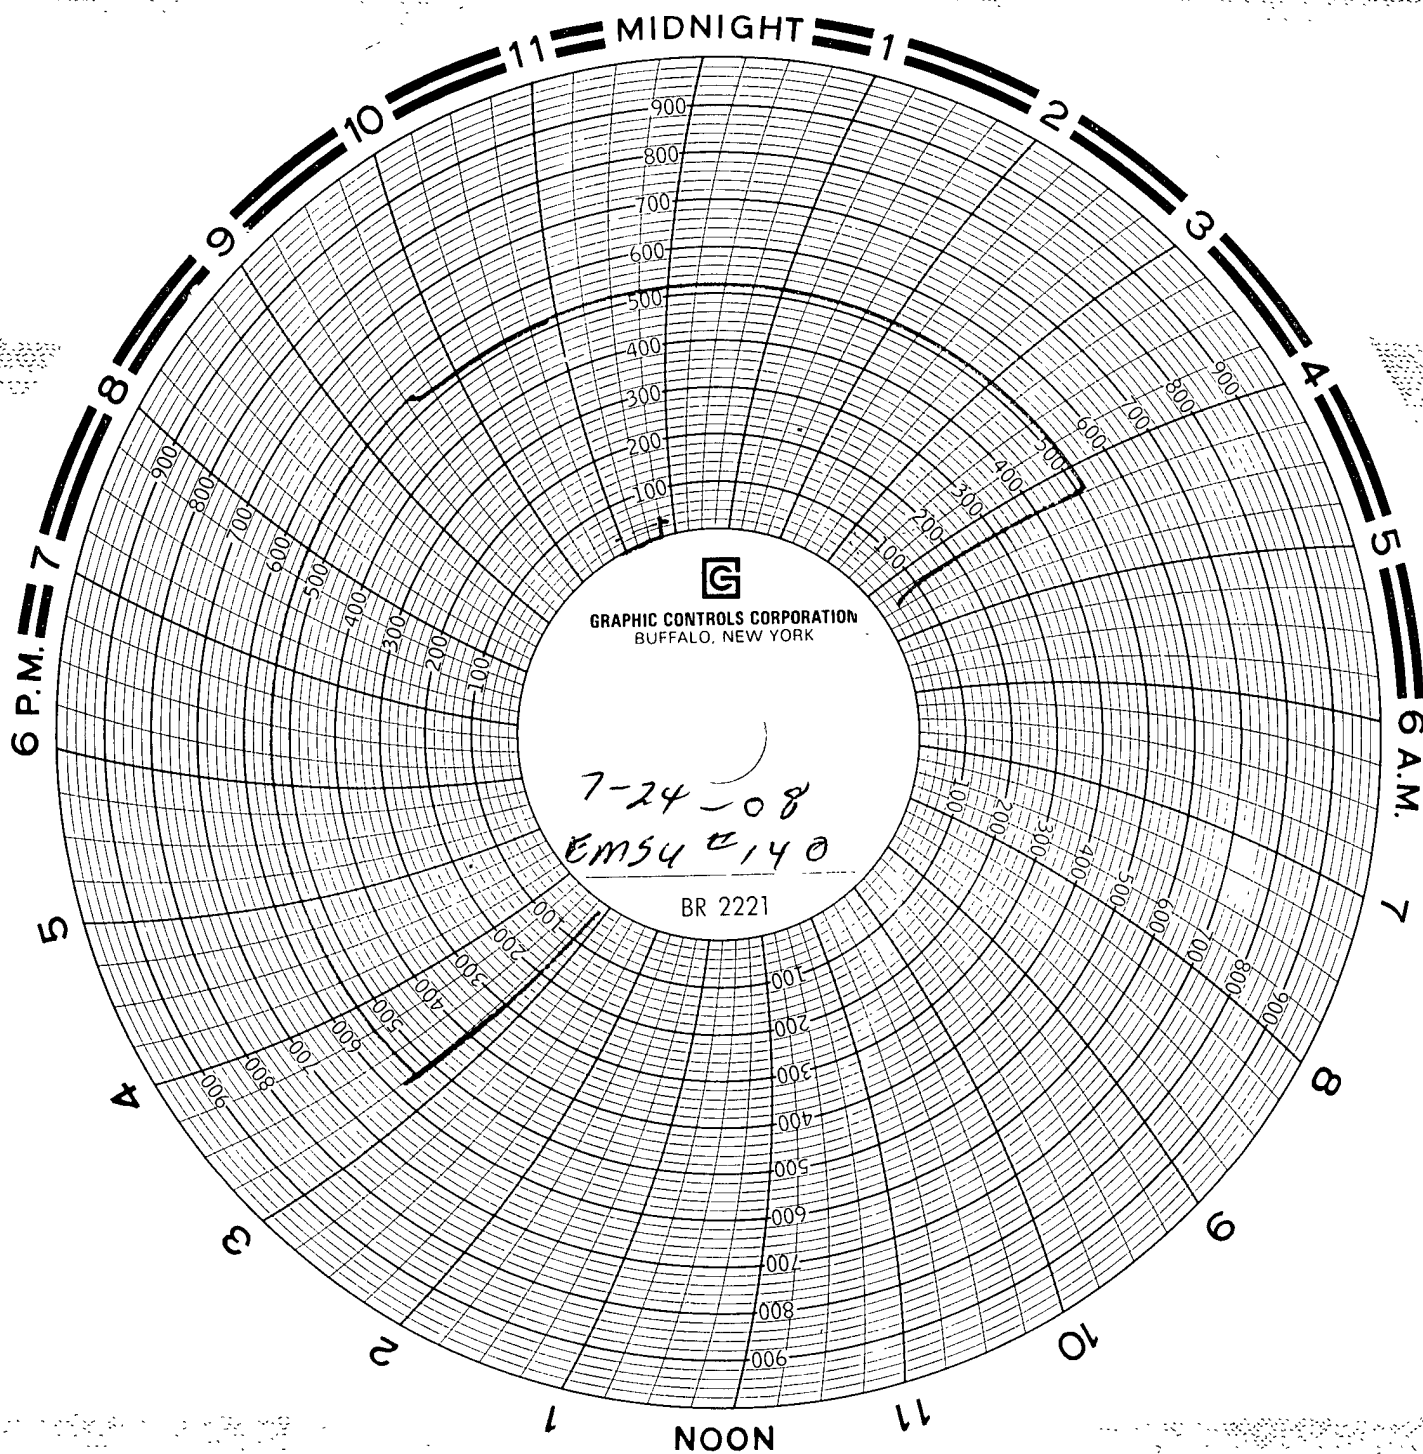

Alan Miller
XTO

7-24-08
EMSU #140

Unit C sec 36
T20S R36E

API# - 30-025-04425

Joe Quacho

T # 0105951

KEY

0 PSI casing
0 PSI surf.
0 Tubing