



# NEW MEXICO ENERGY, MINERALS and NATURAL RESOURCES DEPARTMENT

**BILL RICHARDSON**

Governor

**Joanna Prukop**

Cabinet Secretary

**Mark E. Fesmire, P.E.**

Director

**Oil Conservation Division**

**\*Response Required – Deadline Enclosed\***

***Underground Injection Control Program***

***"Protecting Our Underground Sources of Drinking Water"***

14-May-09

**XTO ENERGY, INC**

200 N LORAIN STE 800

MIDLAND TX 79701-0000

## **LETTER OF VIOLATION and SHUT-IN DIRECTIVE Failed Mechanical Integrity Test**

Dear Operator:

The following test(s) were performed on the listed dates on the following well(s) shown below in the test detail section.

The test(s) indicates that the well or wells failed to meet mechanical integrity standards of the New Mexico Oil Conservation Division. To comply with guidelines established by the U.S. Environmental Protection Agency, the well(s) must be shut-in immediately until it is successfully repaired. The test detail section which follows indicates preliminary findings and/or probable causes of the failure. This determination is based on a test of your well or facility by an inspector employed by the Oil Conservation Division. Additional testing during the repair operation may be necessary to properly identify the nature of the well failure.

Please notify the proper district office of the Division at least 48 hours prior to the date and time that the well(s) will be retested so the test may be witnessed by a field representative.

### ***MECHANICAL INTEGRITY TEST DETAIL SECTION***

#### **EUNICE MONUMENT SOUTH UNIT B No.918**

**30-025-04302-00-00**

Active Injection - (All Types)

M-23-20S-36E

Test Date: 5/5/2009

Permitted Injection PSI:

Actual PSI:

Test Reason: Annual IMIT

Test Result: F

Repair Due: 8/8/2009

Test Type: Std. Annulus Pres. Test

FAIL TYPE: Other Internal Failure

FAIL CAUSE:

Comments on MIT: PRESSURED UP ON WELL TO 560 OPENED INT. STRING AND PT STARTED TO DROP;  
POSSIBLE COMMUNICATION BETWEEN FLANGE FROM INT. STRING AND PROD. CASING;  
\*\*\*OPERATOR IN VIOLATION OF NMOCD RULE 703 \*\*\*\*\*

#### **EUNICE MONUMENT SOUTH UNIT No.199**

**30-025-04510-00-00**

Active Injection - (All Types)

H-5-21S-36E

Test Date: 5/4/2009

Permitted Injection PSI:

Actual PSI:

Test Reason: Annual IMIT

Test Result: F

Repair Due: 8/7/2009

Test Type: Std. Annulus Pres. Test

FAIL TYPE: Other Internal Failure

FAIL CAUSE:

Comments on MIT: CASING WOULD NOT BLEED DOWN; NO PRESSURE TEST; \*\*\*OPERATOR IN VIOLATION OF  
NMOCD RULE 703\*\*\*\*\*

**EUNICE MONUMENT SOUTH UNIT No.283****30-025-04569-00-00**

Active Injection - (All Types)

B-8-21S-36E

Test Date: 5/7/2009      Permitted Injection PSI:      Actual PSI:  
Test Reason: Annual IMIT      Test Result: F      Repair Due: 8/10/2009  
Test Type: Bradenhead Test      FAIL TYPE: Other Internal Failure      FAIL CAUSE:  
Comments on MIT: BHT FAILURE; 580# ON CASING OILY FLUID DID NOT BLEED DOWN; PER OPER. WITHIN 1.5  
WEEKS TRUCK BLED CASING DOWN FROM 460# TO 0 IN 1 HOUR; \*\*\*\*\*CASING PROBLEM--  
\*\*\*OPERATOR IN VIOLATION OF NMOCD RULE 703\*\*\*\*\*

**EUNICE MONUMENT SOUTH UNIT No.343****30-025-04589-00-00**


Active Injection - (All Types)

M-10-21S-36E

Test Date: 5/5/2009      Permitted Injection PSI:      Actual PSI:  
Test Reason: Annual IMIT      Test Result: F      Repair Due: 8/8/2009  
Test Type: Std. Annulus Pres. Test      FAIL TYPE: Other Internal Failure      FAIL CAUSE:  
Comments on MIT: PER OPERATOR DURING PRE TEST WELL WOULD NOT HOLD PRESSURE- IMMEDIATELY  
DROPS TO 0 PRESSURE; \*\*\*\*FAILURE \*\*\* OPERATOR IN VIOLATIO OF NMOCD RULE 703\*\*\*\*


In the event that a satisfactory response is not received to this letter of direction by the "Repair Due:" date shown above, or if the well(s) are not immediately shut-in, further enforcement will occur. Such enforcement may include this office applying to the Division for an order summoning you to a hearing before a Division Examiner in Santa Fe to show cause why you should not be ordered to permanently plug and abandon this well. Such a hearing may result in imposition of CIVIL PENALTIES for your violation of OCD rules.

Sincerely,

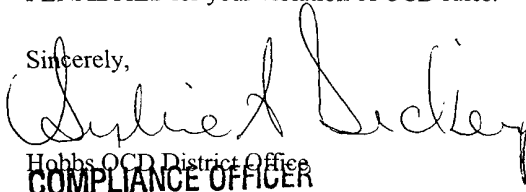Hobbs OCD District Office  
**COMPLIANCE OFFICER**


Note: Pressure Tests are performed prior to initial injection, after repairs and otherwise, every 5 years; Bradenhead Tests are performed annually. Information in Detail Section comes directly from field inspector data entries - not all blanks will contain data. "Failure Type" and "Failure Cause" and any Comments are not to be interpreted as a diagnosis of the condition of the wellbore. Additional testing should be conducted by the operator to accurately determine the nature of the actual failure. \* Significant Non-Compliance events are reported directly to the EPA, Region VI, Dallas, Texas.

EMNRD  
OIL CONSERVATION DIVISION  
1625 N FRENCH DRIVE  
HOBBS NM 88240

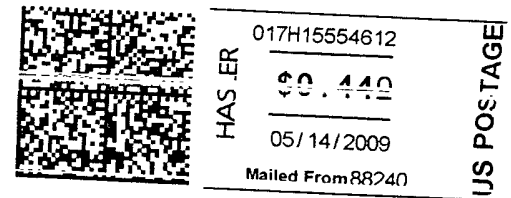

XTO ENERGY - BUCKEYE FIELD OFFICE  
ATTN: DAVID PASCHAL  
P.O. BOX 700  
EUNICE, NM 88231

EMNRD  
OIL CONSERVATION DIVISION  
1625 N FRENCH DRIVE  
HOBBS NM 88240

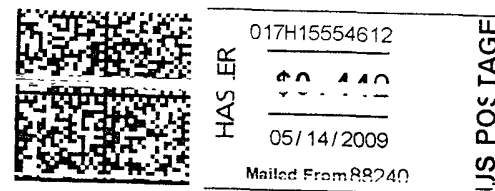

XTO ENERGY INC.  
200 N. LORAIN, STE. 800  
MIDLAND, TX 79701