

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Sante Fe, NM 87505

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-02125

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.
8015

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator

Mobil Producing TX. & N.M. Inc.

3. Address of Operator **P.O. Box 4358**

Houston

TX 77210-4358

7. Lease Name or Unit Agreement Name

Bridges State

8. Well No.

35

9. Pool name or Wildcat

Vacuum; Grayburg-San Andres

4. Well Location

Unit Letter **K** : **1980** Feet From The **south** Line and **1980** Feet From The **west** Line

Section **26**

Township **17S**

Range **34E**

NMPH

Lea

County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
GL 4032

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG & ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: **Temporarily abandon** ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion)

11-12-03 Drive Crew & WSU to location. Spot Rig. Hold safety meeting. Inspect Rig. Check H2S monitor. RU WSU. SDFN

11-13-03 Hold safety meeting. Inspect Rig. Check H2S monitor. Unhang well. Unseat pump. POOH while LD rods. Unflange well head. Unset TAC, NU BOP. CWI & SDFN

11-14-03 Hold safety meeting. Inspect Rig. Check H2S monitor. RU Tbg Scanner. POOH with Tbg while scanning Tbg. RD Tbg scanner. RU WL Truck. RIH with CIBP and set on WL @ 4100'. Drop Cmt on top of plug. RD WL Truck. RIH with 5 Jts Tbg. Dropped 5 Jts in hole on top of CIBP. PU Jt. CWI & SDFWE * Left 5 Jts in hole on Cmt on top of Plug.*

11-17-03 Hold safety meeting. Inspect Rig. Check H2S monitor. Bleed well down. RIH with Tbg and tag top of dropped Tbg. RU pump truck. Tried to test Csg. Found hole in Csg near surface. CWI & SDFN

SEE ATTACHMENT FOR ADDITIONAL REMARKS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Tiffany A. Stebbins*

TITLE **Staff Office Assistant**

DATE **12/12/2003**

TYPE OR PRINT NAME **Tiffany A. Stebbins**

TELEPHONE NO. **(281) 654-1936**

(This space for State Use)

APPROVED BY *Gay W. Wink*

TITLE

DATE

CONDITIONS OF APPROVAL IF ANY:

OC FIELD REPRESENTATIVE II/STAFF MANAGER

This Approval of Temporary
Abandonment Expires **12/23/08**

Submit 3 Copies
to Appropriate
District Office

ATTACHMENT

State of New Mexico

Energy, Minerals and Natural Resources Department

Form C-103
Revised March 25, 1999

DISTRICT I
1625 N. French Dr., Hobbs, NM 88240
DISTRICT II
811 South First, Artesia NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410
DISTRICT IV
2040 South Pacheco, Sante Fe, NM 87505

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-025-02125

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

8015

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Mobil Producing TX. & N.M. Inc.

3. Address of Operator **P.O. Box 4358**

Houston TX 77210-4358

7. Lease Name or Unit Agreement Name

Bridges State

8. Well No.

35

9. Pool name or Wildcat

Vacuum; Grayburg-San Andres

4. Well Location

Unit Letter **K** : **1980** Feet From The **south** Line and **1980** Feet From The **west** Line

Section **26** Township **17S** Range **34E** NMPH **Lea** County


10. Elevation (Show whether DR, RKB, RT, GR, etc.)
GL 4032

Additional Remarks

11-18-03 Hold safety meeting. Inspect Rig. Check H2S monitor. Bleed well down. POOH with Tbg. PU RTBP. RIH with RTBP and 5 stands Tbg. Set RTBP. Load Csg. Weld patch on Csg. POOH with RTBP. RIH with Kill String. CWI & SDFN

11-19-03 Hold safety meeting. Inspect Rig. Run in hole with Tbg. Circulate hole with packer fluid. Nipple down the BOP. Nipple up the wellhead, rig unit down.

11-20-03 Run mechanical integrity test. Witnessed by NM OCD rep Johnny Robinson. Well temporarily abandoned.

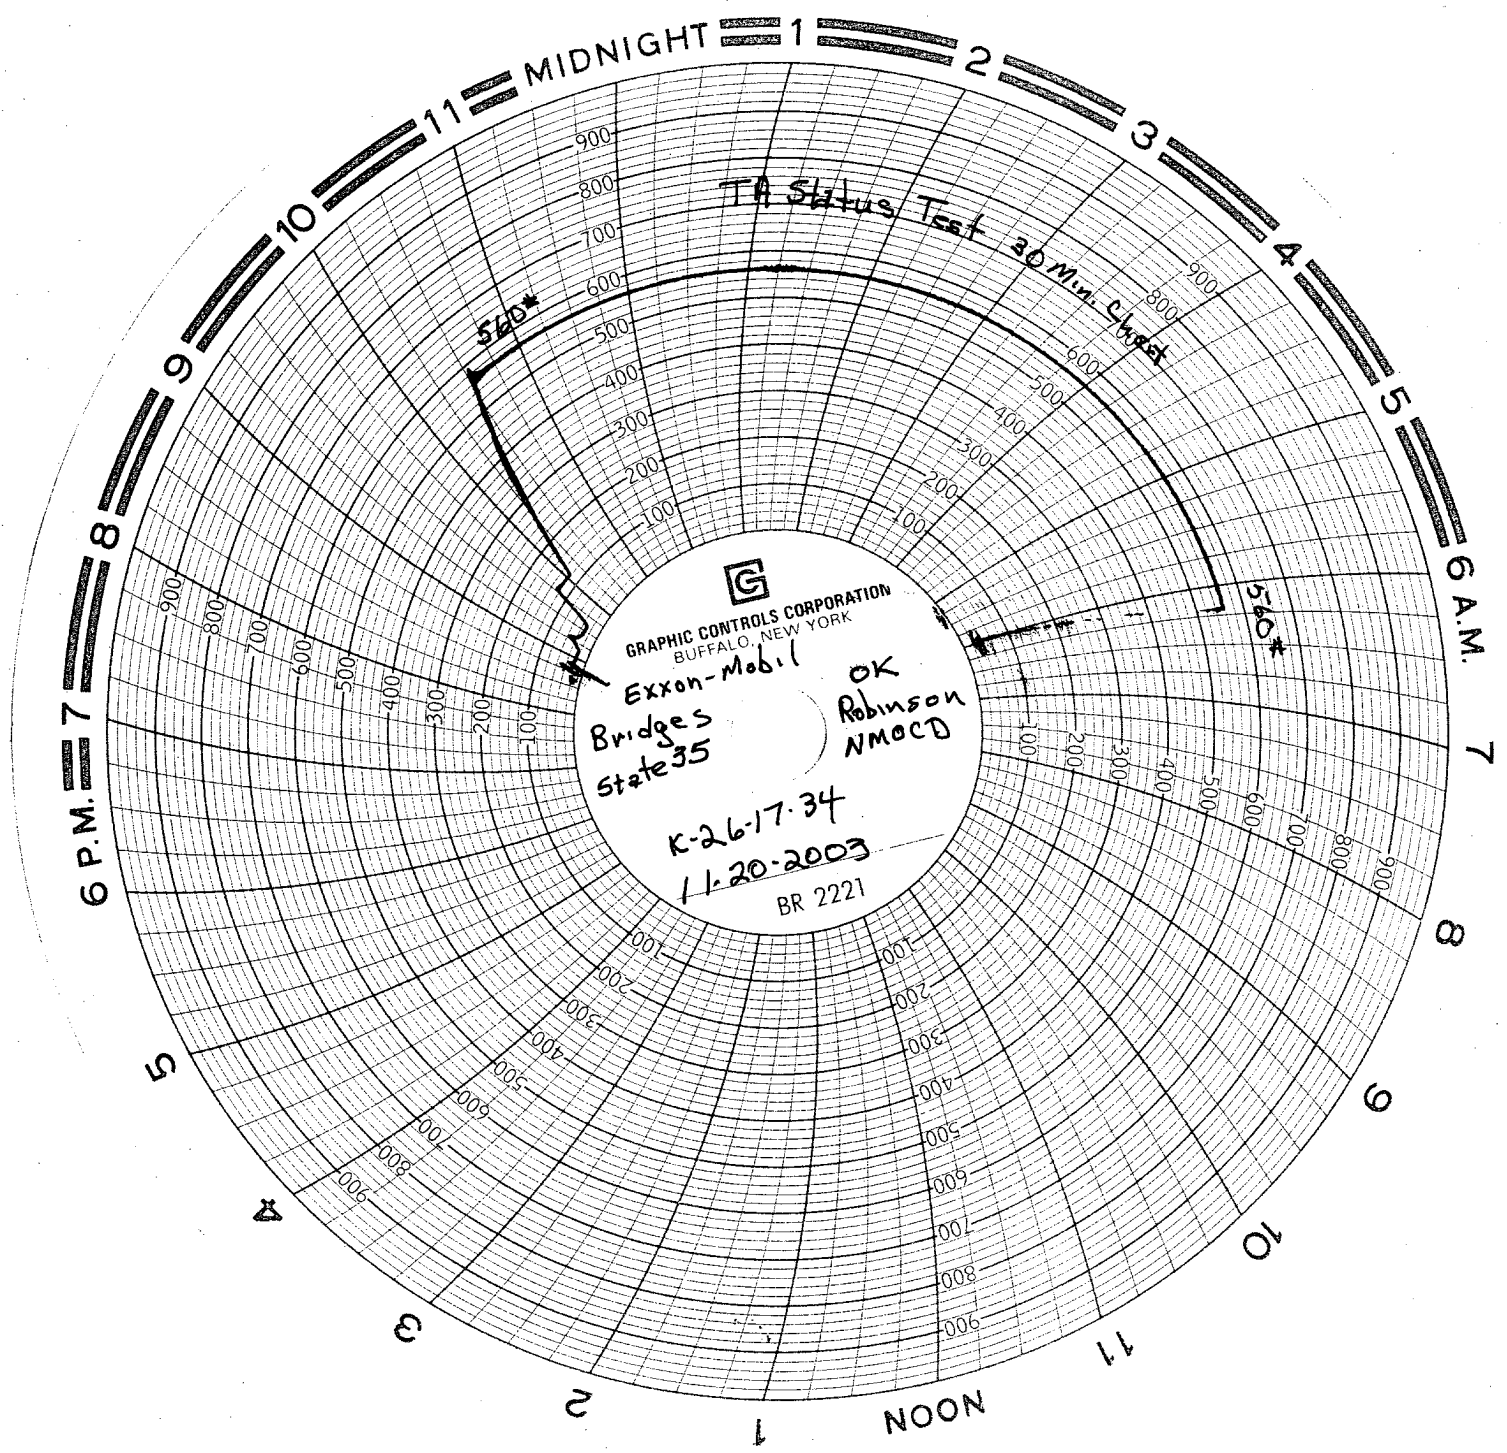

GRAPHIC CONTROLS CORPORATION
BUFFALO, NEW YORK

Exxon-Mobil
Bridges
State 35

OK
Robinson
NMOC

K-26-17-34
11-20-2003
BR 2221

TA Status Test

30 Min. Chart