

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-04770
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	H.T. MATTERN NCT-A
8. Well No.	3
9. Pool Name or Wildcat	PENROSE SKELLY GRAYBURG
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3509' GL

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.	
1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER
2. Name of Operator	CHEVRON USA INC
3. Address of Operator	15 SMITH ROAD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>P</u> : <u>660'</u> Feet From The <u>SOUTH</u> Line and <u>660'</u> Feet From The <u>EAST</u> Line Section <u>24</u> Township <u>21-S</u> Range <u>36-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3509' GL

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐


SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☒ ADD PERFS, & ACIDIZE

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-11-03: MIRU.
11-12-03: MIRU REV UNIT. TIH TO 3656'. DRILL CIBP. LOST CIRC. PU TBG TO 5085'.
11-13-03: RUN GR/NEUTRON/CCL FR 5080-3100. CAME OUT OF FLUID @ 3990. RUN CBL FR 5080-3940. CAME OUT OF FLUID @ 3982. TIH W/RBP & SET @ 3950'.
11-14-03: RUN CBL FR 3950-2400. TIH W/PKR & SET @ 3946'. RU SWAB.
11-15-03: SWABBING.
11-17-03: SPOT 3 SX SAND ON RBP. PERF 3862-68, 3826-32, 3790-97, 3737-31, 3642-50.
11-18-03: ACIDIZE GRAYBURG PERFS 3642-3868 W/1600 GALS 15% ANTI-SLUDGE HCL. SET PKR @ 3638. RU SWAB. 4 HR TEST.
11-19-03: 10 HR SWAB TEST.
11-20-03: REL PKR. TIH W/RBP & SET @ 3689. SET PKR @ 3616. RU SWAB.
11-21-03: MOVE TOOLS. SET RBP @ 3852 & PKR @ 3810. MOVE TOOLS. SET RBP @ 3689 & PKR @ 3616.
11-24-03: MOVE TOOLS. SET RBP @ 3809. PKR @ 3785. MOVE TOOLS. SET RBP @ 3745 & PKR @ 3716.
11-25-03: RU SWAB. SET RBP @ 3714. PKR @ 3673. MOVE TOOLS. SET RBP @ 3769, PKR @ 3742.
11-26-03: REL TOO.S LD PKR & RBP. TIH W/RBP RETR HEAD. WASH SAND OFF RBP @ 3950. REL RBP.
12-01-03: TIH W/WS. RIG DOWN. CLEAN LOCATION. TURN WELL OVER TO PRODUCTION.

FINAL REPORT

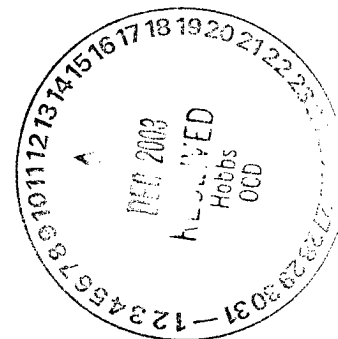

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Leake TITLE Regulatory Specialist

DATE 12/3/2003

TYPE OR PRINT NAME Denise Leake

Telephone No. 915-687-7375

(This space for State Use)

APPROVED

CONDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNED BY
GARY W. WINK
TITLE QC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE

DEC 23 2003