

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.

30-025-25090

5. Indicate Type of Lease

STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

LG-0272

7. Lease Name or Unit Agreement Name:

Aztec State

8. Well No.

3

9. Pool name or Wildcat

Corbin, ABO

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

EOG Resources, Inc.

3. Address of Operator

P.O. Box 2267 Midland, Tx 79702

4. Well Location

Unit Letter b : 710 feet from the North line and 2110 feet from the East line

Section 36 Township 17-S Range 32-E NMPM County Lea

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Sqz. 600sx cmt Press test 1000psi. for 30 minutes Held Ok tag top of cmt. @4200.
2. Circ. hole w/mlf 9.5# Brine
3. Cut 5 1/2" csg. plug @ 4003, l/d csg.
4. Spot 65sx, plug @ 4057-3900 woc tag @3897.
5. Spot 100sx, plug @ 3100-2800 woc tag @ 2786
6. Spot 65sx, plug @ 2400-2200 (B-salt).
7. Spot 65sx, plug @ 1500-1300 (T-salt).
8. Spot 110sx, plug @ 375-surf (13 3/8 shoe) woc tag @ surf.
9. Install dry hole marker 12-9-03

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

TITLE Manager/Sunset

DATE 12/10/03

Type or print name Jimmy Bagley

Telephone No. (432) 561-8600


(This space for State use)

APPROVED BY

OC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE

Conditions of approval, if any:

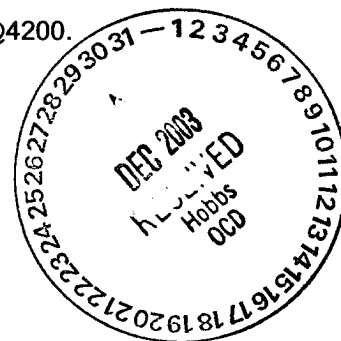

JAN 02 2004