

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

Energy, Minerals and Natural Resources

RECEIVED

SEP 15 2009

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

HOBBSOCD Santa Fe, NM 87505

June 19, 2008

| |
|---|
| WELL API NO. 30-025-11675 |
| 5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> |
| 6. State Oil & Gas Lease No. |
| 7. Lease Name or Unit Agreement Name Hadfield |
| 8. Well Number 2 / |
| 9. OGRID Number 264953 |
| 10. Pool name or Wildcat Jalmat |

| | |
|--|--|
| <p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p> | |
| <p>1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other</p> | |
| <p>2. Name of Operator Herman L. Loeb LLC /</p> | |
| <p>3 Address of Operator P O Box 838 Lawrenceville, IL 62439</p> | |
| <p>4. Well Location Unit Letter P : 660 feet from the south line and 660 feet from the east line Section 21 Township 25S Range 37E NMPM County Lea</p> | |
| <p>11 Elevation (Show whether DR, RKB, RT, GR, etc.) 3051' GL</p> | |

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- Set cast iron bridge plug @ 2670', pressure test casing to 500#. RIH w/ tubing to 2,670', spot 25 sk of cement on plug. POH w/ 7 jts of tubing, spot 31 bbl of mud-laden water, POH w/ tbg.
- Perforate 5 1/2" casing w/ 2 holes @ 1250', RIH w/ tbg & packer, set pkr @ 800', attempt to squeeze w/ 100 sk cement to fill from 1250' to 1000'. Displace cement to 1000'. WOC release pkr, RIH w/ tbg & tag.
- Perforate 5 1/2" casing w/ 2 holes @ 330', attempt to circulate cement to the surface. WOC.
- Cut off well head 3' below ground level, top off casing & annulus as necessary.

The Oil Conservation Division **Must be notified 24 hours prior** to the beginning of plugging operations

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE



TITLE Petroleum Engineer

DATE 9/11/09


Type or print name G. A. Payne

E-mail address: gapayne@sigecom.net

PHONE: 812.453.0385

For State Use Only

APPROVED BY:

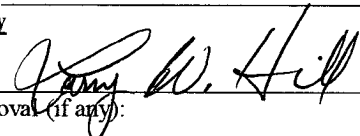

TITLE DISTRICT 1 SUPERVISOR

DATE SEP 15 2009

Conditions of Approval (if any):

Lease: Hadfield
Well #: 2

Diagram: 09/11/2009
Elev KB: 3051
TD: 3487

Comp Date: 12/01/1948
Elev GL: 3051
PBD: 3487

Permit: 30-025-11675
Location: P 660 FSL 660 FEL 21-25S-37E
County: Lea
State: New Mexico
Field: Jalmat
Operator: Herman L Loeb LLC 264953

