

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-06310
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Chevron USA Inc		6. State Oil & Gas Lease No.
3. Address of Operator 15 Smith Rd, Midland, TX, 79705		7. Lease Name or Unit Agreement Name: Eunice Monument South Unit
4. Well Location Unit Letter <u>J</u> : <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>East</u> line Section <u>31</u> Township <u>20-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County		8. Well No. 159
10. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. Pool name or Wildcat Eunice Monument Grayburg S A

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒


CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Set 7" CIBP at 3550, spot 30sx from 3550-3400 (Grayburg-S A), Tag at 3385.
2. Displace hole w/MLF 9.5# Brine w/25# gel P/BBL.
3. Spot 40sx, plug from 2700-2500 (Yates, B-Salt), Tag at 2458.
4. Perf 4 holes at 1200, sqz 75sx, plug from 1200-1000 (9 5/8 shoe, T-Salt), Tag at 1011.
5. Perf 4 holes at 300, sqz 100sx from 300-150 (13 shoe - Surf), Tag at 140.
6. Perf 4 holes at 140, CIRC cmt from 140-Surf w/75sx, Tag at Surf.
7. Install dry hole marker 12-02-03.

Approved as to plugging of the Well Bore.
 Liability under bond is retained until
 surface restoration is completed.

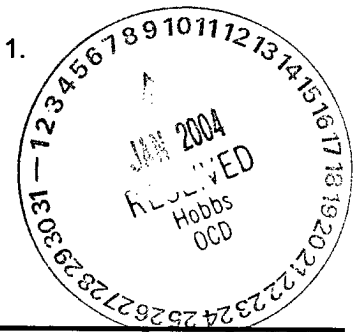

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Manager/Sunset DATE 12/2/03

Type or print name Jimmy Bagley Telephone No. (432) 561-8600

(This space for State use)

APPROVED BY [Signature] TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER

Conditions of approval, if any:

JAN 12 2004