

Submit 3 Copies To Appropriate District
Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Avenue, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO. 30-025-10449
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name: Amanda

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other	
2. Name of Operator Chevron USA Inc	
3. Address of Operator 15 Smith Rd, Midland, TX, 79705	

8. Well No. 1
9. Pool name or Wildcat Paddock


4. Well Location Unit Letter <u>J</u> : 1980 feet from the <u>South</u> line and 1980 feet from the <u>East</u> line Section <u>25</u> Township <u>22-S</u> Range <u>37-E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

1. Tag RBP at 5360, spot 60sx, plug from 5360-4900 (Blinbry-Paddock), Tag at 4781.
2. Spot 25sx, plug from 3800-3600 (Queen).
3. Cut 5 1/2" csg at 3460, unable to pull and unable to sqz, spot 30sx, plug from 3510-3400 (7" Shoe, Yates), Tag at 3178.
4. perf at 2500, unable to sqz, spot 30sx, plug from 2700-2450 (B-Salt), Tag at 2412.
5. Perf at 1300, sqz with 50sx from 1300-1100 (T-Salt), Tag at 1079.
6. Perf at 350, sqz 240sx from 350-Surf 5 1/2 x 7 x 10 3/4 (10 3/4 Shoe - Surf), Tag at Surf.
7. Install dry hole marker 12-10-03.

Approved as to plugging of the Well Bore.
Liability under bond is retained until
surface restoration is completed.

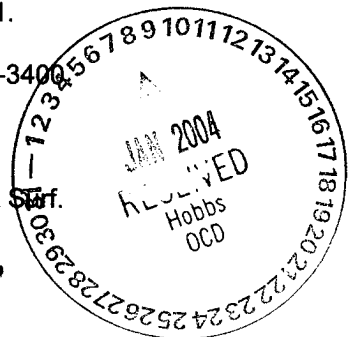

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE Manager/Sunset DATE 12/10/03

Type or print name Jimmy Bagley Telephone No. (432) 561-8600
(This space for State use)

OC FIELD REPRESENTATIVE II/STAFF MANAGER.

APPROVED BY Hayden Wink TITLE _____ DATE JAN 12 2004

Conditions of approval, if any.