

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Box Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-06837
5. Indicate Type of Lease	STATE ☐ FEE ☒
6. State Oil / Gas Lease No.	
7. Lease Name or Unit Agreement Name	EUNICE KING
8. Well No.	1
9. Pool Name or Wildcat	PENROSE SKELLY GRAYBURG

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.

1. Type of Well:	OIL WELL ☒ GAS WELL ☐ OTHER ☐
2. Name of Operator	Chevron U.S.A. Inc.
3. Address of Operator	15 SMITH RD, MIDLAND, TX 79705
4. Well Location	Unit Letter <u>E</u> : <u>1980'</u> Feet From The <u>NORTH</u> Line and <u>660'</u> Feet From The <u>WEST</u> Line Section <u>28</u> Township <u>21-S</u> Range <u>37-E</u> NMPM <u>LEA</u> COUNTY
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3458' GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPERATION ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: DEEPEN IN GRAYBURG & FRAC ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-01-03: MIRU KEY #462.
12-02-03: TAG FILL @ 3775.
12-03-03: C/O FILL FR 3775-3792 & HYDROMITE PLUG TO 3804. DRILL NEW HOLE FR 3804-3834.
12-04-03: DRILL NEW HOLE FR 3834-3904.
12-05-03: TIH W/PKR & SET @ 3600. RU SWAB. 7 HR TEST.
12-08-03: REL PKR @ 3600. TIH W/GR/CBL/CCL TOOL. TIH W/RBP & SET @ 3595. SPOT 1 SX SAND ON TOP OF RBP. TIH W/GR/CBL/CCL.
PULL LOG FR 3582-3080. TOC @ 3300.
12-09-03: TIH W/RBP RETR HEAD. WASH SAND OFF RBP.
12-10-03: REL RBP @ 3595. TIH W/PKR & SET @ 3600. ACIDIZE GRAYBURG OPENHOLE FR 3622-3904 W/3000 GALS 15% ANTI-SLUDGE HCL.
12-11-03: 4 HR SWAB TEST. REL PKR @ 3600. TAG SALT FILL @ 3894.
12-12-03: TIH W/PKR & SET @ 3600'. RU SWAB. 6 HR TEST.
12-15-03: SWABBING.
12-16-03: REL PKR @ 3600. PU FRAC PKR & ATTEMPT TO SET @ 3499. WOULD NOT SET.
12-17-03: PULL PKR INTO 5 1/2" CSG. SET & REL PKR. LOST PKR WHILE POOH. TAG PKR @ 3599. REL PKR. TIH W/FRAC PKR & SET @ 3499.
12-18-03: FRAC GRAYBURG OH FR 3622-3904 W/66,000 GALS YF135 & SAND.
12-19-03: REL FRAC PKR @ 3499. TAG SAND FILL @ 3690.
12-22-03: TAG BRIDGE @ 3566. DO BRIDGE. C/O HOLE TO 3658. PUH INTO CSG @ 3565.
12-23-03: TAG SAND FILL @ 3680. C/O SAND TO TD @ 3904. TAG TD @ 3904. NO SAND ENTRY.
12-24-03: TIH W/PKR & SET @ 3570. RU SWAB. WELL STARTED FLOWING.
12-29-03: FLOW TEST. RUN AFTER FRAC SURVEY, GR FR 3904-3400. SET BLANKING PLUG IN 2.25" F PROFILE. REL FROM ON/OFF TOOL.
12-30-03: SWAB TBG DN TO 1800. RIG DOWN. TURN WELL OVER TO PRODUCTION.

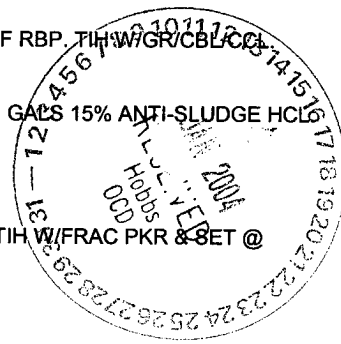

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Denise Pinkerton TITLE Regulatory Specialist DATE 1/12/2004
TYPE OR PRINT NAME DENISE PINKERTON Telephone No. 915-687-7355

(This space for State Use)

APPROVED Ray W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER
CONDITIONS OF APPROVAL, IF ANY:

DATE

JAN 22 2004