

Office

Energy, Minerals and Natural Resources

May 27, 2004

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM

87505

RECEIVED

DEC 21 2009

HOBSUCD

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

WELL API NO.

30-041-20809

5. Indicate Type of Lease

STATE ☐FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
STOLTENBERG

8. Well Number 001

9. OGRID Number

263940

10. Pool name or Wildcat

TULE SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator

SOVEREIGN EAGLE, LLC

3. Address of Operator

P.O. BOX 968, ROSWELL, NM 88202-0968

4. Well Location

Unit Letter F : 1650' feet from the FNL line and 2310' feet from the FWL lineSection 26Township 2SRange 29E

NMPM

County ROOSEVELT

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

4394' GL

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness:

mil

Below-Grade Tank: Volume

bbls; Construction Material

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☒TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐MULTIPLE COMPL ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐P AND A ☐CASING/CEMENT JOB ☐OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1) MI Mayo Marr's. Bleed well down.

2) PU and GIH w/ tbg. Tag top of cement @ 2800'.

3) Circ. hole w/ 10# mud. Circ and spot 25 sx on CIBP @ 2820'.

4) TOH w/ tbg. TIH w/ wire-line to cut 4 1/2" 11.6# casing @ 2100' 2178'

5) Pull and lay down casing. TIH w/ tbg. Set 100' plug from 2050'-2150' to cover 8 5/8" shoe and 4 1/2" casing stub @ 2100' 50' in and out WOL and T&G. 78 78

6) Pull up and set 25 sx plug @ 381' to cover 13 3/8" shoe and 60' plug at surface. 381'

7) Cut off well-head, anchors and set dry hole marker as per OCD regulations. 381'

Spot 30 sx cmt at 1100'.

The Oil Conservation Division **Must be notified**
24 hours prior to the beginning of plugging operationsI hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE

Frank S. Morgan

TITLE Manager of Operations

DATE 12/18/09

Type or print name Frank S. Morgan

E-mail address: fmorgan@stratanm.com

Telephone No. (575) 622-1127

For State Use Only

APPROVED BY:

Mark Whitaker

TITLE


Compliance Officer

DATE 1/20/2010

Conditions of Approval (if any):

Stoltenberg #1 Plugging Diagram

- 1) MI Mayo Marr's. Bleed well down.
- 2) PU and GIH w/ tbg. Tag top of cement @ 2800'.
- 3) Circ. hole w/ 10# mud. Circ and spot 25 sx on CIBP @ 2820'.
- 4) TOH w/ tbg. TIH w/ wire-line to cut 4 1/2" 11.6# casing @ 2100'.
- 5) Pull and lay down casing. TIH w/ tbg. Set 100' plug from 2050'-2150' to cover 8 5/8" shoe and 4 1/2" casing stub @ 2100'. 50' in and out.
- 6) Pull up and set 25 sx plug @ 331' to cover 13 3/8" shoe and 60' plug at surface.
- 7) Cut off well-head, anchors and set dry hole marker as per OCD regulations.

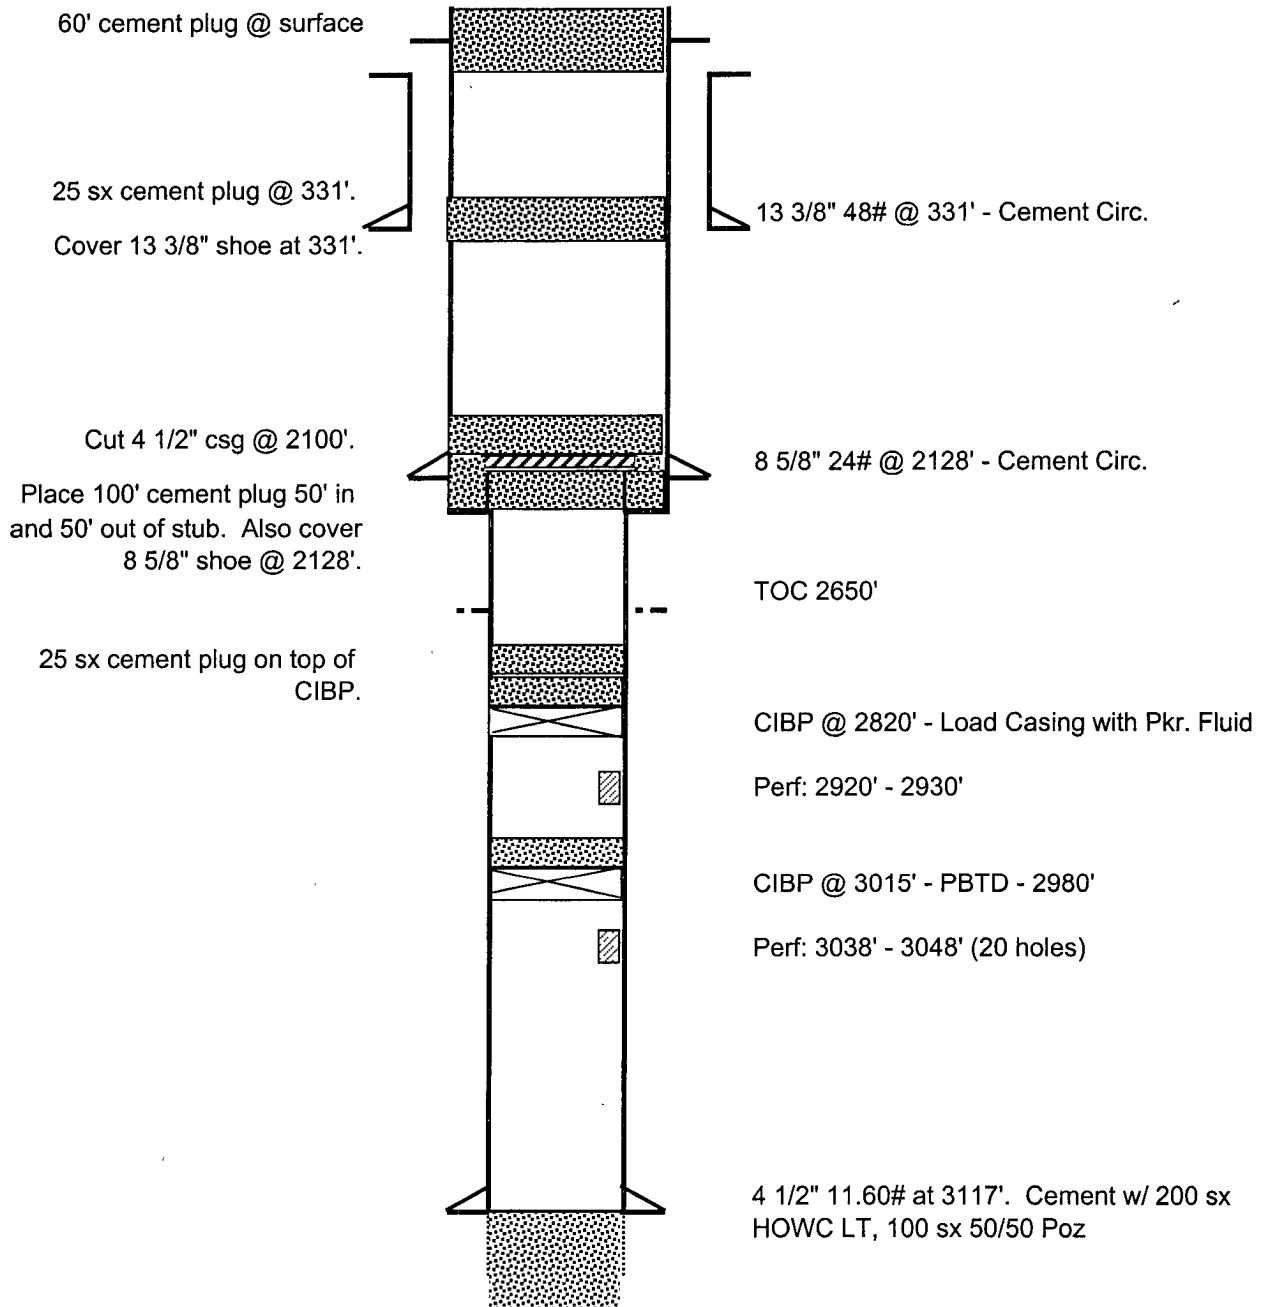

SOVEREIGN EAGLE, LLC

P.O. BOX 968

ROSWELL, NM 88202-0968

575-623-1957 TEL

575-623-3533 FAX

December 18, 2009

State of New Mexico
Oil Conservation Division
1625 N. French Dr.
Hobbs, NM 88240

RECEIVED

DEC 21 2009

HOBBSOCD


RE: Filing C-103 for Sovereign Eagle, LLC
Plug and Abandon
Stoltenberg #1
Roosevelt County, NM

Dear Examiner,

The Stoltenberg #1 is a TA well in Roosevelt County, New Mexico. Attached is a C-103 to plug and abandon this well.

Should you have any questions feel free to call Jennifer Zapata @ (575) 622-1127 or e-mail @ jzapata@stratanm.com. Thank you for your attention to this matter.

Sincerely,

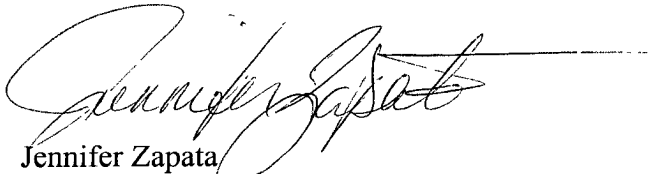A handwritten signature in cursive script, appearing to read "Jennifer Zapata", followed by a horizontal line.

Jennifer Zapata
Production Analyst