

DISTRICT I

1625 N. French Dr., Hobbs NM 88240

DISTRICT II

1301 W. Grand Avenue, Artesia NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec NM 87410

DISTRICT IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, New Mexico 87504-2088

Form C-103

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-01824
1. Type of Well: Oil Well ☐ Gas Well ☒ Other		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Yates Petroleum Corporation		6. State Oil & Gas Lease No. VO-5606
3. Address of Operator 105 South 4th Str., Artesia, NM 88210		7. Lease Name or Unit Agreement Name Blitzen AUB State
4. Well Location Unit Letter <u>M</u> : <u>660</u> feet from the <u>South</u> line and <u>660</u> feet from the <u>West</u> line Section <u>16</u> Township <u>11S</u> Range <u>34E</u> NMPM County <u>Lea</u>		8. Well No. 1
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4184' GR		9. Pool Name or Wildcat Wildcat Atoka

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

Propose to Plug & Abandon as follows:

- 1) Set CIBP @ 12100' and dump 35' cement on plug. Set CIBP @ 11195' and dump 35' cement on plug. Set CIBP @ 10050' and dump 35' cement on plug.
- 2) Perforate squeeze holes @ 7020' and pump cement to place 100' plug 7020-6920', inside and outside casing. WOC and tag.
- 4) Perforate squeeze holes @ 4233' and pump cement to place 100' plug 4233-4133', inside and outside casing. WOC and tag.
- 5) Perforate squeeze holes @ 2090' and pump cement to place 100' plug 2090-1990', WOC and tag.
- 6) Spot 100' cement plug 342-242'. -TAG
- 7) Spot 10 sx cement plug @ surface.
- 8) Install marker and clean location.

Proposed Schematic Attached.

Thereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Stormi Davis TITLE Regulatory Compliance Technician DATE 2/3/04

Type or print name Stormi Davis Telephone No. 505-748-1471

(This space for State use)

APPROVED BY Harry W. Wink TITLE OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE FEB 10 2004

Conditions of approval, if any:

Well Name: Blitzen "AUB" State No. 1 Field: _____


Location: 660' FSL & 660' FWL Sec. 16-11S-34E Lea Co., NM

GL: 4184' Zero: _____ AGL: _____ KB: 4197'

Spud Date: _____ Completion Date: _____


Comments: _____

Casing Program	
Size/Wt/Grade/Conn	Depth Set
13 3/8"	292'
8 5/8"	4183'
4 1/2" 11.6# HC P110 LT&C	13205'

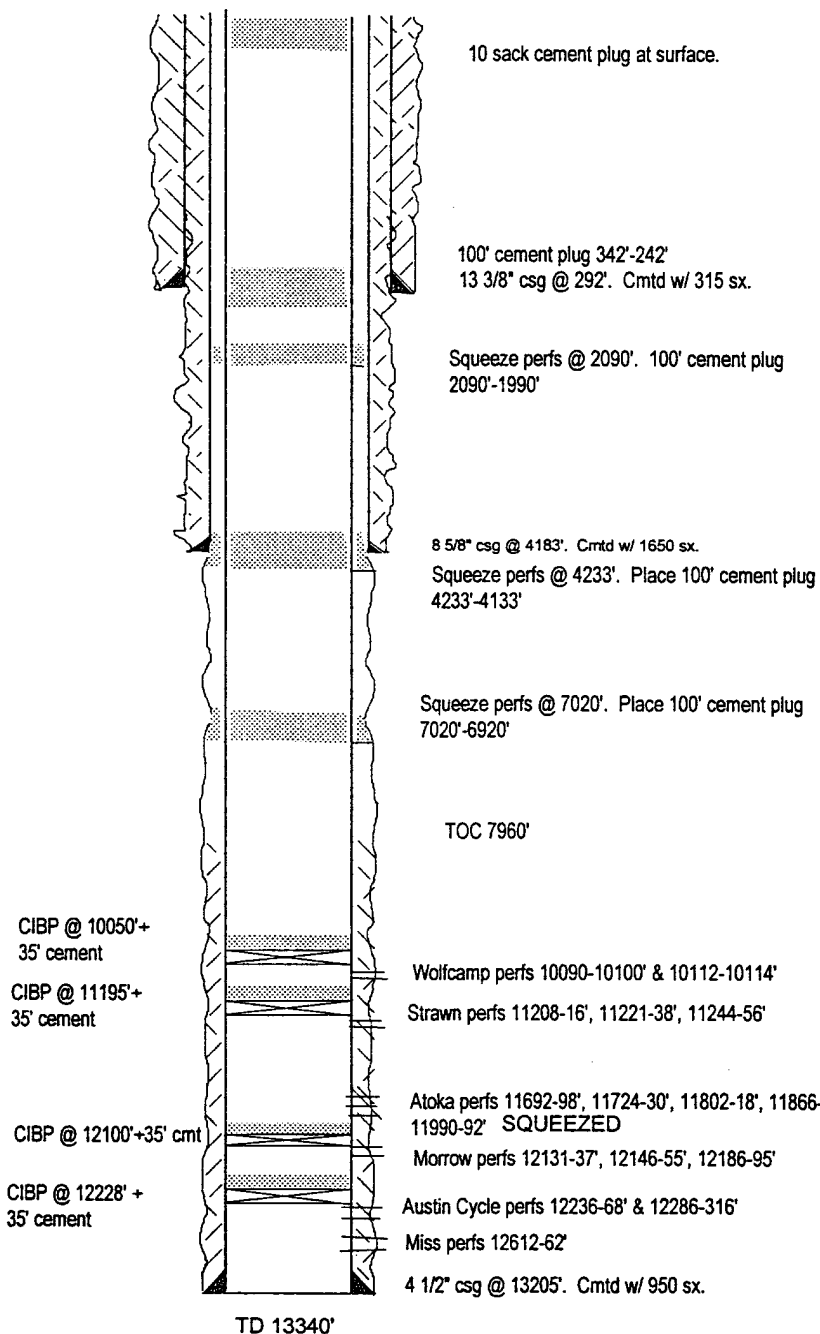

PROPOSED COMPLETION

Tops:	
Anhydrite	1984'
Salt	2090'
Yates	2754'
7 Rivers	2851'
Queen	3475'
Grayburg	3784'
San Andres	4019'
Glorieta	5478'
Tubbs	6926'
Abo	7727'
Penn	10224'
Miss	12420'
Devonian	13129'

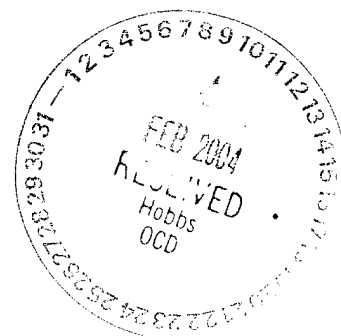

SKETCH NOT TO SCALE

DATE: 1/6/04