

UNITED STATES

RECEIVED

FORM APPROVED

EC	SUNDRY Do not use the	EPARTMENT OF THE II UREAU OF LAND MANA NOTICES AND REPO is form for proposals to II. Use form 3160-3 (API PLICATE - Other instruct	GEMENT RTS ON W drill or to re D) for such	e-enter an HOB proposals.	1 3 2010 BSOCI	Expires: J 5 Lease Serial No. NMNM57285		
1 Type of Well		8. Well Name and No. SUNBURST SHOGRIN FEDERAL 1 ▼						
Oil Well 2. Name of Open	Gas Well Oth		GRIN FEDERAL I					
CHESAPEA	KE OPERATING,	9. API Well No. 30-025-29543						
	A CITY, OK 73154		10. Field and Pool, or Exploratory LEA					
	ell (Footage, Sec., T	11. County or Parish, and State						
	S R34E NWSE 18					LEA COUNTY, N	~	
1	2. CHECK APPI	ROPRIATE BOX(ES) TO	INDICATI	E NATURE OF N	IOTICE, RI	EPORT, OR OTHER	RDATA	
TYPE OF S	TYPE OF SUBMISSION TYPE OF ACTION							
Notice of I	Intent	☐ Acidize	Deepen		☐ Production (Start/Resume)		☐ Water Shut-Off	
Subsequent Report		☐ Alter Casing	□ Fra	☐ Fracture Treat		ation	■ Well Integrity	
_		☐ Casing Repair	_	☐ New Construction		olete	Other	
☐ Final Abandonment Notice		Change Plans	_	Plug and Abandon		☐ Temporarily Abandon		
•		Convert to Injection	_	□ Plug Back		□ Water Disposal		
Attach the Bon following comp testing has been	is to deepen directions of under which the wor pletion of the involved	eration (clearly state all pertinenally or recomplete horizontally, it will be performed or provide operations. If the operation respandonment Notices shall be file in a linspection.)	give subsurface the Bond No. c sults in a multin	locations and measure n file with BLM/BIA le completion or reco	red and true ve Required sul moletion in a se	ertical depths of all pertine bsequent reports shall be new interval a Form 3160	ent markers and zones. filed within 30 days	
Chesapeake procedure:	e, respectfully, req	uests permission to plug	and abandor	this well per the	following		/	
Well Data			•					
Casing: 5-7 TOC: 8,422 TD: 11,800' PBTD: 10,2	;	0, & J-55 @ 11,800'	CEDURE	SEE AT CONDI		ED FOR OF APPROV	AL	
				Reviewa	(2) M	1 9/1/10		
14. I hereby certif	y that the foregoing is	Electronic Submission #8	39543 verified KE OPERATI	by the BLM Well NG, INC., sent to	Information the Hobbs	System		
Name(Printed/				ATORY COMPLIANCE SPEC				

· # 1....... Signature (Electronic Submission) Date 07/14/2010 THIS SPACE FOR FEDERAL OR STATE OFFICE US Approved By Title Date Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon AUG 1 2 2010 /s/ Dustin Winkler **S**fice Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowlingly and FAID MANAGEMENT or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its julisdiction (CARLSBAD FIFLD OFFICE)

Additional data for EC transaction #89543 that would not fit on the form

32. Additional remarks, continued

TAC: 9,914' SN: 10,104'

Open Perforations: Bone Springs 10,000' ? 10,057'

Procedure (Basic Energy Services)

1. M.I.R.U. N.D. W.H. N.U. B.O.P.
2. POOH rods. POOH Tbg, stand in derrick, tally.
3. RIH WL to 9,900'? Set CIBP.
4. RIH Tbg? Tag CIBP. Circ hole w/MLF. Cap BP w/35 sx H cmt. TOC @ 9,600'.
5. PUH to 6,600'? Spot 25 sx cmt.
6. PUH to 50' below 8 5/8" shoe @ 4,225'? Spot 50 sx cmt. Tag a.m.
7. PUH to 3,200'? Spot 25 sx cmt.
8. PUH to 1,800'? Spot 25 sx cmt.
9. PUH to 500'? Spot 60 sx cmt to surface
10. Cap well off. R.D.M.O.
11. Install dry hole marker, clean location and reclaim.

(CHK PN 890795)

CURRENT WELLBORE SCHEMATIC

WELL: SUNBURST SHOGRIN FED 1
FIELD: LEA BONE SPRING
COUNTY: LEA STATE: NEW MEXICO
LOCATION: 1,860.0 FSL & 1,980.0 FEL SEC 22, BLK,
ELEVATION: 3,768.00 GR -- 3,785.00 RKB
TD: 11,800.0 PBTD: Original Hole - 11720.0

PROP #: 890795

API: 3002529543 SPUD DATE: 12/28/1985 RIG RELEASE: 12/28/1985

FIRST SALES: WELLBORE TYPE:

	nal Hole, 7/1/2010 4:42:15 matic - Actual	Set Depth (IIKD)	vvelibo		String Top Conn	ection				
Jone Schie	manc - Actuar	11,800		nal Hole (in);: Drift (in) ∞ Wi		LT&C Top (ffKB) Blm (ffKB)				
		Casing Joints		892	17.00 J-55	17.0 11,799 0				
		Float Shoe	5 1/2		1	11,799.0 11,800.0				
		Perforations				Shot				
		Date	Zone	Top (fil	(B) Blm (flKB)	Dens Phasing (shots/fi) (*)				
		5/12/2010		10,	000 0 10,057.					
			NE SPRING, Origi DLFCAMP, Origina		287.0 10,302					
13 3/8" 54 5 J-55 Surf Csq			LECAMP, Origina LECAMP LWR, O		806 0 10,856 530 0 311,552					
13 3/8in, 54 50lbs/ft, J-55, 17-410 ftKB		2/6/1986 WOLFCAMP LWR: Original 11;530.0 11;552.0 1.0 Tubing String: Tubing - Production								
Cmt w/ 400 sx Circ w/ 106		Set Depth (ftKB) 10,141.	Wellbo	re nai Hole	Run Date	/9/2010				
SX		Item	20m. D. 2000 S. C. S. Fr.	11,0 15/27/18	34097 KW1881	Mariteratur E				
8 5/8" 32# & 24# J-55 Int Csq		Description OD (i	n) ID (in) 7/8 2 441	Wt (lbs/ft) Grada 6 50 N-80	EUE STOP Thread	(RKB) Bim (RKB) 17 0 9,913 9				
8 5/8in, 24 00lbs/ft, J-55,		Anchor/ 2	7/8 2.441	30000	. EUE 9,	913.9 9,916.9				
17-4,225 ftKB Cmt w/ 1700 sx Circ w/ 25		1 • 1	7/8 2 441 7/8	6 50 N-80	1 1	916 9 10,104.4				
sx		C. 2.24 Z 502 3 2 C. 2 1900 00 20 X 3	7/8	<u>Samo i in tener o can</u>		104.4 10,105.4 105.4 10,109.4				
SQZD Csg Leaks w/ 550 sx		Tubing 2		6.50 N-80		109.4 10,140.9				
to surf			7/8		EUE 10,	140 9 10,141.5				
	-	Stimulations Stim Details								
TOC by Vol Calc		Туре	Date	Zone	Top (ftKB)	Bottom (ftKB)				
		Sand Frac	6/2/2010	BONE SPRING 2ND SAND,	10,000.0	10,057.0				
DOME CODING CASE CASE				Original Hole						
BONE SPRING 2ND SAND, 10,000		Stim Details	3.5		100 NO 67 1/2 (1/2)	. Y				
10,000		Type Sand Frac	Date 6/2/2010	Zone BONE SPRING	Top (ftKB) 10,000.0	Bottom (fIKB) 10,057 0				
				2ND SAND,	10,000.0	10,007				
		2.00	and the contract to consecut	Original Hole	On 7 - 700. 400 to 7 - 1 - 700 to 7	NAC a Name the Park of the Co.				
		Stim Details Type	Date	Zone	Top (ftKB)	Bottom (ftKB)				
		Sand Frac	6/2/2010	BONE SPRING	10,000 0	10,057.0				
				2ND SAND, Original Hole						
}		Stim Details			L (526 S686)					
			Date 6/2/2010	Zone BONE SPRING	Top (ftKB) 10,000 0	Bottom (ftKB)				
Cemented Bridge Plug, 5		Saliu Frac	6/2/2010	2ND SAND,	10,000 0	10,057 0				
1/2in, 10,215 ftKB				Original Hole						
BONE SPRING, 10,287		Stim Details	Date	Zone	Top (fIKB)	Bottom (ftKB)				
WOLFCAMP, 10,806		Sand Frac	6/2/2010	BONE SPRING	10,000 0	10,057.0				
				2ND SAND, Original Hole		Š				
		Stim Détails	ministration visit and			SANTA COMPANY CASTA				
		Type Sand Frac	Date 6/2/2010	Zone BONE SPRING	Top (ftKB) 10,000 0	Bottom (ftKB) 10,057 0				
		Sand Frac	0/2/2010	2ND SAND,	10,000 0	10,037 0				
		2.777 2022	W.55 & W.55	Original Hole						
		Ctions acquirion	Date	Zone	Top (ftKB)	Bottom (flKB)				
1		Sand Frac	6/2/2010	BONE SPRING	10,000 0	10,057 0				
				2ND SAND, Original Hole						
WOLFCAMP LWR, 11,530		Cinsi-Detaile								
PBTD (Original Hole), 11,720 Cmt w/ 650 sx		Type Sand Frac	Date 6/2/2010	Zone BONE SPRING	Top (flKB) 10,000.0	Bottom (ftKB) 10,057.0				
5 1/2" 17# S-95, N-80 & J-55		Canaria	0/2/2010	2ND SAND,	10,000.0	10,057.0				
Prod Csq 5 1/2in, 17 00lbs/ft, J-55,				Original Hole						
17-11,800 ftKB										
TD (Original Hole), 11,800										
Well History										
	1530'-552' w/ 22 holes.	ZZ se spikintel i za za	\$ C. C. C. C. C. C. C.	Market Market Const.	4 / 5 1 1 1 Copy 5 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	in without a parties.				
2/7/1986 ACDZ w/ 1000 gal 15 2/8/1986 RE-ACDZ w/ 2500 ga										
2/11/1986 PERF @ 10806', 808'	', 814', 816', 818', 820', 822', 824', 82	6', 828', 834', 836'.	838', 844', 846'. 85	54', 856' w/ 1 ispf. 1	7 holes.					
2/12/1986 ACDZ w/ 1500 gal 15				,:. , :						
2/21/1986 PERF @ 10287'-1030	02' w/ 15 holes.	gai & 54000# 20/40	au							
2/22/1986 ACDZ w/ 1500 gal 15 2/28/1986 FRAC w/ 458 bbl H2C	% NeFe. D, 137 bbl CO2 & 17800# 20/40 sd.									
3/11/1986 NOTE: Wellfile says V	Wolfcamp perfs are open, but rpt'd to	OCD/BLM by origin	al operator as beh	ind BP @ 11480, b	ecause cannon cor	ningle Wolfcamp				
W/ Bone Springs. 11/18/1993 Pump 750 gal 7-1/4% acid w/additives down csg Flush w/25 bbl 2% KCl wtr Return to prod										
8/9/2007 Isolated csg leak to 4608' and 4639'.										
8/15/2008 CR @ 4449'. SQZD csg leaks from 4546-4642 to surf between 5 1/2" annulus & 8 5/8" w/ 550 sx cmt. 8/18/2008 DO cmt.										
Asset Manager: Shannon G	Nancy									
naset manager. Shannon G	piarity									

CURRENT WELLBORE SCHEMATIC

WELL: SUNBURST SHOGRIN FED 1

FIELD: LEA BONE SPRING

COUNTY: LEA STATE: NEW MEXICO


LOCATION: 1,860.0 FSL & 1,980.0 FEL SEC 22, BLK,

ELEVATION: 3,768.00 GR -- 3,785.00 RKB TD: 11,800.0 PBTD: Original Hole - 11720.0 PROP #: 890795

API: 3002529543 SPUD DATE: 12/28/1985 RIG RELEASE: 12/28/1985

Chesapeake

FIRST SALES: WELLBORE TYPE:

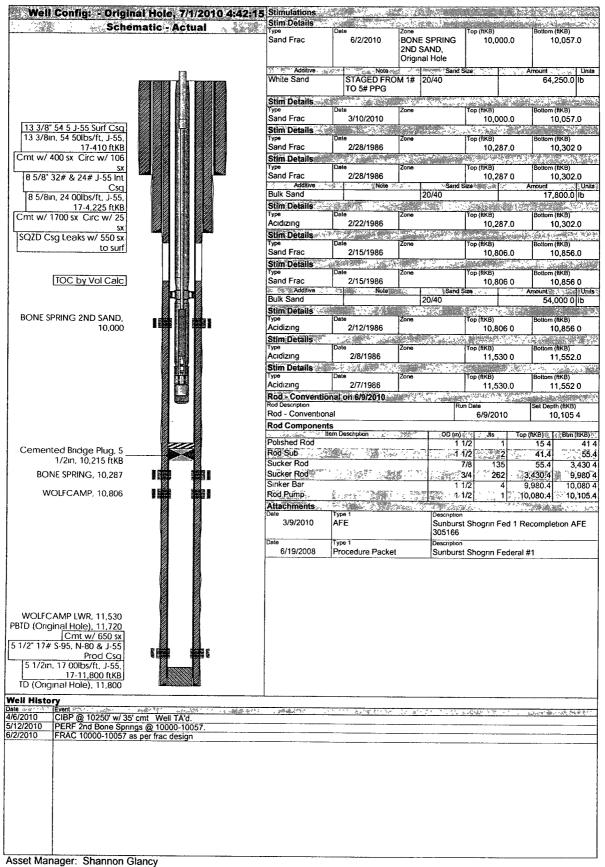

Proposal - Workover



SUNBURST SHOGRIN FED 1

Field:

LEA BONE SPRING

County:

LEA

State: **NEW MEXICO**


Location:

SEC 22, 19S-34E, 1860 FSL & 1980 FEL GL 3,768.00 KB 3,785.00

Elevation: KB Height: 17.00

Spud Date: 12/28/1985 Initial Compl. Date: API#: 3002529543 CHK Propterty #: 890795 1st Prod Date: 2/28/1986 PBTD: Original Hole - 10215.0

TD: 11,800.0

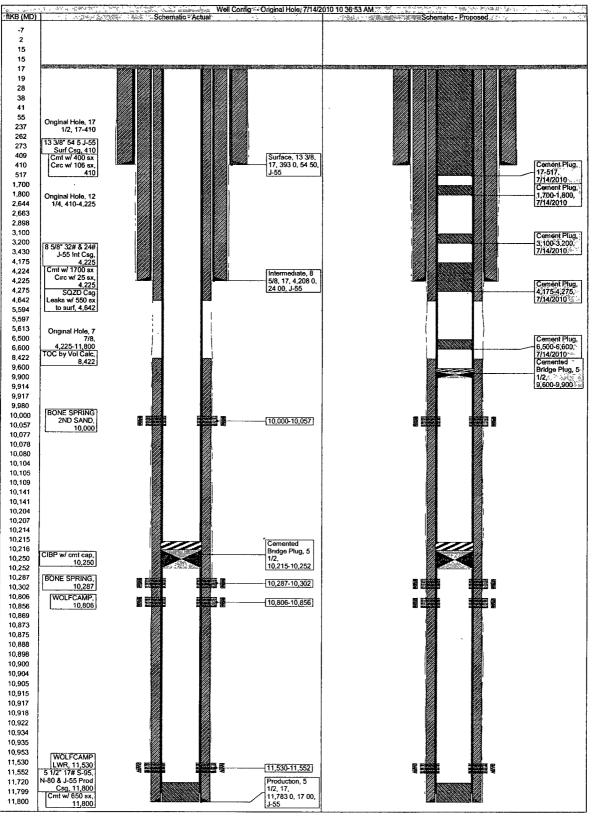

Page 1/1

RECEIVED

Sunburst Shogrin Fed 1 SEC 22, 19S-34E, 1860 FSL & 1980 FEL Lea, NM API #3002529543

AUG 1 3 2010 HOBBSOCD



Plugging Procedure

Well Data

Tubing:

2-7/8" 6.5# N-80 @ 10,141'

Casing:

5-1/2" 17# S-95, N-80, & J-55 @ 11,800'

TOC:

8,422'

TD:

11,800'

PBTD:

10,215' (CIBP)

Elevation:

3,785' KB

3,768' GL

TAC:

9,914'

SN:

10,104'

Open Perforations:

Bone Springs 10,000' - 10,057'

Procedure (Basic Energy Services)

- 1. M.I. R.U. N.D. W.H. N.U. B.O.P.
- 2. POOH rods. POOH Tbg, stand in derrick, tally.
- 3. RIH WL to 9,900' Set CIBP.
- 4. RIH Tbg Tag CIBP. Circ hole w/ MLF. Cap BP w/ 35sx H cmt. TOC @ 9,600'.
- 5. PUH to 6,600' Spot 25sx cmt.
- 6. PUH to 50' below 8%" shoe @ 4,225' Spot 50sx cmt. Tag a.m.
- 7. PUH to 3,200' Spot 25sx cmt.
- 8. PUH to 1,800' Spot 25sx cmt.
- 9. PUH to 500' Spot 60sx cmt to surface
- 10. Cap well off. R.D.M.O.

Chesapeake Operating, Inc.

NM-57285: Sunburst Shogrin Federal #1

API: 30-025-29543

Lea County, New Mexico

RE: Plugging and Abandonment Requirements, Conditions of Approval

H₂S monitoring equipment to be on location.

- 1. OK
- 2. OK
- 2a. Drill out CIBP at 10215'. Set CIBP at 11480' with 35' bailed cement or 25sx pumped cement. (Perfs)
- 2b. Spot a cement plug from 10960'-10750' (minimum 25sx). WOC and tag. If tag is deeper than 10750', attempt again. If tag is low, verify that cement is above 10860'. (Wolfcamp Perf attempt)
- 2c. Set CIBP at 10215' and bail 35' or spot 25sx on top. (Perfs)
- 3. OK
- 4. OK (Perfs)
- 5. Change: Perf and squeeze a plug from 8230'-8050'. WOC and tag at 8050' or shallower. If injection rate cannot be established, spot cement 50' below perfs. (Bone Spring)
- 5a. Perf and squeeze a plug from 5650'-5490'. WOC and tag at 5490' or shallower. If injection rate cannot be established, spot cement 50' below perfs. (Delaware)
- 6. Tag at 4135' or shallower Otherwise OK (Casing shoe)
- 7. Move: Spot plug from 3550'-3410' Otherwise OK (Yates BOS)
- 8. Move: Spot a plug from 1970-1850'. WOC and tag at 1850' or shallower. (TOS)
- 9. OK (Casing shoe Surface)
- 10. Verify cement to surface in all annuluses Otherwise OK
- 11. Ground Level Dry Hole Marker required in this area. **Requirements Attached.** Otherwise OK
- 12. Submit a subsequent report to the BLM.

See attached standard COAs.

DHW 072810

Requirements for ground level dry hole markers <u>Well Identification Markers</u> Conditions of Approval (COA)

The BLM Carlsbad Field Office (CFO) Conditions of Approval (COA) Requires that ground level dry hole markers be placed on well within the Lesser Prairie Chicken habitat area. The dry hole markers will be to the following specifications. The operator will construct the markers as follows:

- 1. An 8 inch X 8 inch steel plate 1/8 to 3/16 of an inch thick is to be placed on the old dry hole marker stand pipe 2 inches from ground level, in the Lesser Prairie Chicken habitat area.
- 2. Steel plate may be welded or bolted approximately 2 inches from ground level on the stand pipes. If plates are bolted to the stand pipe, the person installing the plate will be required to weld a pipe collar on the plate and place a minimum of two set screws/bolt on each collar. Aluminum data plates may be bolted with minimum ¼ inch bolt and locking nuts or self tapping fine threaded screws. A minimum of one in each corner is to be installed on each plate.
- 3. An 8 inch x 8 inch aluminum plate, which is 12 gauge or .080 sign material (1/8 inch aluminum plate may be used in place of the .080 plate) with the required information for that well stamped or engraved in a minimum 3/8 inch tall letter or number.
- 4. The following information will be stamped or engraved on the 8 inch X 8 inch aluminum plate in the following order.
 - a. First row: Operators name
 - b. Second row: Well name and number
 - c. Third row: Legal location to include ½ ¼, Section, Township, and range. If the legal location cannot be placed on one row it can be split into two rows with the ¼ ¼ (example: 1980 FNL 1980 FWL) being on the top row.
 - d. Fourth row: Lease Number and API number.
 - i. Example marker plate: (attached)

NMOCD Order No. R-12965 also required the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a ground level dry hole marker was installed as required in the COA's from the BLM.

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in a cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Any plug that requires a tag will have a minimum WOC time of 4 hours.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified when the wellhead is cut off to verify that cement is to surface in the casing and all annuluses.** The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

DHW 112309



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm





In Reply Refer To: 1310

AUG 1 3 2010 HOBBSOCD

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Environmental Protection Specialist 575-234-5909, 575-361-2648 (Cell)

Terry Gregston Environmental Protection Specialist 575-234-5958

Bobby Ballard Environmental Protection Specialist 575-234-2230

Randy Rust Natural Resource Specialist 575-234-5943

Linda Denniston Environmental Protection Specialist 575-234-5974

Jennifer Van Curen Environmental Protection Specialist 575-234-5905

Justin Frye Environmental Protection Specialist 575-234-5922 Cody Layton Natural Resource Specialist 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Todd Suter Surface Protection Specialist 575-234-5987

Doug Hoag Civil Engineering Technician 575-234-5979

Tanner Nygren Natural Resource Specialist 575-234-5975

John Fast Natural Resource Specialist 575-2345996