New Mexico Oil Conservation Division, District 1

Form 3160-5 (August 1999) UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

1625 N. French Drive Hobbs, NM 88240

FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000

					Lease Serial	Ü
DRY N	OTICES AND	REPORTS	ON	WELLS	NM0321281	

Do not use this form for abandoned well. Use For	6. If Indian, Allo	ottee or Tribe Name					
SUBMIT IN TRIPLICATE -	7. If Unit or CA/Agreement, Name and/o						
1. Type of Well Oil Well Gas Well X Other 2. Name of Operator			Injection	8. Well Name ar	nd No. #291 /		
OXY USA Inc. 3a. Address P.O. Box 50250, Midland, TX 79710-	0250	3b. Phone No. (include a	16696 rea code)	9. API Well No. 30-041-20825			
4. Location of Well (Footage, Sec., T., R., M., or Survey 1 1980 FSL 1980 FWL NESW(K) Sec 29	Description)	432-685-5717			ol, or Exploratory Area San Andres Assoc rish, State		
12. CHECK APPROPRIATE	BOX(ES) TO IND	DICATE NATURE OF	NOTICE, REPO				
TYPE OF SUBMISSION			TYPE OF ACTION				
X Notice of Intent Subsequent Report Final Abandonment Notice	Acidize Alter Casing Casing Repair Change Plans Convert to Injection	Deepen Fracture Treat New Construction X Plug and Abandon Dn Plug Back	Production Reclamation Recomplete Temporaril Water Dispo	Abandon .	Water Shut-Off Well Integrity Other		
 Describe Proposed or Completed Operation (clearly If the proposal is to deepen directionally or recomp. Attach the Bond under, which the work will be per following completion of the involved operations. It testing has been completed. Final Abandonment N determined that the final site is ready for final inspe TD-4400' PBTD-4356' Perfs-425. 	lete horizontally, give siformed or provide the Efficiency of the operation results in Jotices shall be filed on ction.)	ubsurface locations and mea Bond No. on file with BLM a a multiple completion or t	asured and true verty/BIA. Required surecompletion in a necluding reclamation	ical depths of all p bsequent reports sl ew interval, a Form n, have been comp	ertinent markers and zon hall be filed within 30 days 13160 4 shall be filed on		
8-5/8" 24# @ 2014' w/ 950sx, 12-1, 5-1/2" 15.5# csg @ 4400' w/ 800sx Circ Hole w/ 10# MLF and between p	, 7-7/8" hole, ⁻	urf-Circ TOC-Surf-Circ	SEP	EIVED 1 7 2010 BSOCD			
1. RIH & Set CIBP @ 4210' M&P 25sx 2. M&P 25sx cmt @ 3600-3460' WO C 3. M&P 25sx cmt @ 2400-2275' WO C 4. M&P 25sx cmt @ 2064-1944' WOC 5. M&P 25sx cmt @ 1200-1080' WOC 6. M&P 45sx cmt @ 300'-Surface	<u>-</u>	APPROV ENDING	/ED FOR 3 		PERIOD		
I hereby certify that the foregoing is true and correct Name (Printed Typed) David Stewart		Title Sr. Re	egulatory Ana	lyst			
Wai Stell		Date 9/7	(10				
• THIS	SPACE FOR FED	ERAL OR STATE OF	FICE USE				
Approved by \S/DAVID R GI	ASSEC	7 7 Title	IM ENGINEER	Date	CED 1 / 2010		

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would exact the applicant holds legal or equitable title to those rights in the subject lease which would exact the applicant proceeding operations present in the subject lease which would exact the applicant follows. Section 1001, and Title 43 U.S.C. Section 1012, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States and Tasks, Tentifolism that the proceeding of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks, Tentifolism that the procedure of the United States and Tasks and

OXY USA Inc. - Proposed Todd Lower SA Unit #291 API No. 30-041-20825

45sx @ 300'-Surface


25sx @ 1200-1080'

25sx @ 2064-1944'

25sx @ 2400-2275'

25sx @ 3600-3460'

CIBP @ 4210' w/ 25sx

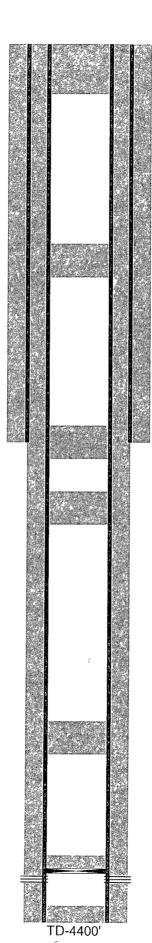


12-1/4" hole @ 2014' 8-5/8" csg @ 2014' w/ 950sx-TOC-Surf-Circ

7-7/8" hole @ 4400' 5-1/2" csg @ 4400' w/ 800sx-TOC-Surf-Circ

Perfs @ 4259-4289'

PB-4356'

OXY USA Inc. - Current Todd Lower SA Unit #291 API No. 30-041-20825

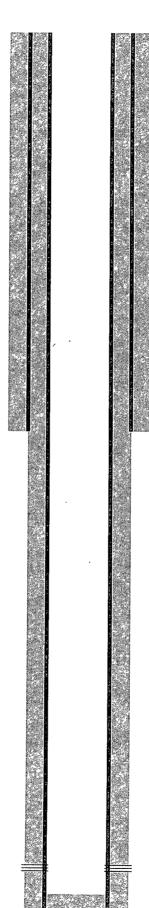

12-1/4" hole @ 2014' 8-5/8" csg @ 2014' w/ 950sx-TOC-Surf-Circ

7-7/8" hole @ 4400' 5-1/2" csg @ 4400' w/ 800sx-TOC-Surf-Circ

Perfs @ 4259-4289'

PB-4356'

TD-4400'

BUREAU OF LAND MANAGEMENT

Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272 RECEIVED

SEP 17 ZU10 HOBBSOCD

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office, prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours call (575) 627-0205 or after office hours call (575) 420-2832. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. <u>Monument:</u> Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.